

RAD GREEN PCA REPORT

HOUSING AUTHORITY OF BERGEN COUNTY

One Bergen County Plaza, Floor 2

Hackensack, New Jersey 07601

George Stavrou



RAD PROGRAM PHYSICAL CONDITION ASSESSMENT of DAVID F. ROCHE APARTMENTS 2 Aladdin Avenue Dumont, New Jersey 07628

PREPARED BY:

EMG

222 Schilling Circle, Suite 275

Hunt Valley, Maryland 21031

800.733.0660

410.785.6220 (fax)

www.emgcorp.com

EMG CONTACT:

Edward Beeghly

Program Manager

800.733.0660, x7607

ebeeghly@emgcorp.com

EMG Project #: 107534.13R-003.306

Date of Report: September 8, 2014

On-Site Date: March 4, 2014

YOUR PARTNER IN REAL ESTATE LIFECYCLE PLANNING & MANAGEMENT
www.emgcorp.com

EMG

ENGINEERING PEACE OF MIND

GREEN RECOMMENDATIONS AT A GLANCE

GREEN CONSERVATION MEASURE	RECOMMEND FOR REHABILITATION				
	Already Exists	N/A	Yes	No	Report Reference / Comment
BUILDING ENVELOPE					
Install EnergyStar Windows			✓		Section 3.3.3
Install EnergyStar Sliding Doors		✓			Section 3.3.3
Install Storm Windows		✓			Section 3.3.3
Install Window Sun Shades – already on ½ of south and southwest facing but not west facing	✓		✓		Section 3.3.3
Install Additional Thermal Insulation			✓		Section 3.3.4
Install Vegetative Roofing			✓		Section 3.3.4
Install EnergyStar Rated Reflective Metal			✓		Section 3.3.4
Install EnergyStar Rated Asphalt Shingle		✓			Section 3.3.4
Convert Carpeted Surfaces to Smooth-and-Cleanable Surfaces			✓		Section 3.7.2
Replace Siding with Cementitious (cement fiber) Siding		✓			Section 3.3.2
Implement Air Leakage Control			✓		Section 3.3.2
MECHANICAL SYSTEMS	Already Exists	N/A	Yes	No	Report Reference / Comment
Install Vent Dampers	✓				Section 3.4.1 and 3.4.2
Convert Equipment to Electronic Ignition	✓				Section 3.4.1 and 3.4.2
Install Boiler Controls	✓				Section 3.4.2.1
Replace Inefficient Boiler	✓				Section 3.4.2.1
Install Programmable/ Setback Thermostats				✓	Sections 3.4.2.1, 3.4.2.2
Insulate Hot Water or Steam Pipes	✓				Sections 3.4.1.1, 3.4.2.1, 3.4.2.2
Seal and Insulate Ducts		✓			Sections 3.4.2.1, 3.4.2.2
Install Geothermal Heat Pumps				✓	Energy Audit Section 4.4
Install Geothermal System for Heating and Hot Water				✓	Energy Audit Section 4.4
Install Swamp Coolers		✓			Energy Audit 5
Implement Temperature and Humidity Monitoring			✓		Section 4.4
Install Photo-Controls for Exterior Lighting	✓				Section 3.2.6
Upgrade or Replace Inefficient Motors			✓		Energy Audit 5
Install Water-Saving Toilets			✓		Section 3.4.1.2
Install Water Saving Faucets / Showerheads			✓		Section 3.4.1.2
Convert Exterior Lighting Fixtures			✓		Section 3.2.6
Convert Hot Water Heater System to Solar			✓		Energy Audit 4.1
Install EnergyStar Heating Systems	✓				Sections 3.4.2.1, 3.4.2.2
Install EnergyStar Cooling Systems			✓		Sections 3.4.2.1, 3.4.2.2
Install Energy Efficient Water Heaters	✓				Sections 3.4.1.1, 3.4.1.2

GREEN CONSERVATION MEASURE	RECOMMEND FOR REHABILITATION				
INDOOR AIR QUALITY	Already Exists	N/A	Yes	No	Report Reference / Comment
Duct Bathroom Exhaust Fans to Exterior	✓				Section 3.4.2.2
Green Household Cleaning Products			✓		Section 4.4
Low VOC Carpeting			✓		Section 3.7.2.3
Install Rubber Walk Off Mats			✓		Section 4.4
Install Rubber Stair Treads			✓		Section 4.4
Install Carbon Monoxide Detectors			✓		Section 3.6
ELECTRICAL SYSTEMS	Already Exists	N/A	Yes	No	Report Reference / Comment
Install Power Co-Generation System			✓		Energy Audit 4.3
Install Fuel Cells Owned by a Property			✓		Energy Audit 4.5
Install Wind Power System			✓		Energy Audit 4.2
Install Solar PV System			✓		Energy Audit 4.1
Replace Fluorescent Lamps with EnergyStar Lamps in Apartments			✓		Section 3.7.2.4
Replace Fluorescent Lamps with EnergyStar Lamps in Common Areas			✓		Section 3.7.1.2
Replace Ceiling Fans with EnergyStar Fans in Apartments			✓		Section 3.7.2.4
Install LED Exit Signs			✓		Section 3.6
Install Occupational Sensors for Interior Lighting			✓		Energy Audit 5.3
Install EnergyStar Refrigerators	✓				Section 3.7.2.2
Install EnergyStar Dishwashers		✓			Section 3.7.2.2
Install Lighting Controls in Building			✓		Energy Audit 5.2
RECYCLING / LANDSCAPING	Already Exists	N/A	Yes	No	Report Reference / Comment
Consider Native / Xeriscape Landscaping Plan	✓				Section 3.2.3
Follow Integrated Pest Management Plan	✓				Part III
Implement Household Recycling Plan	✓				Section 3.2.6
Implement Household Hazardous Recycling Plan			✓		Section 3.2.6
Implement Construction Debris Recycling Plan			✓		Section 3.2.6
Porous Paving Surfaces			✓		Section 3.2.2
Install Soil Moisture Sensors			✓		Section 3.2.4
Utility Leak Monitoring Program			✓		Section 3.2.7

GREEN ELEMENT CHECKLIST AT A GLANCE

Checklist for Review of Green Physical Condition Assessment Elements	Report Reference
Sufficiently recent (within 120 days)	Cover Page - Date
Certification that contractor meets all required qualifications	Certification Section Page 1 & Appendix H
Green recommendations to reduce energy usage	Throughout Report
Green recommendations to reduce water usage	Section 3.4.1.2
Green recommendations to safeguard/improve indoor environmental air quality	Section 4.4
Summary of the green alternatives, their costs and cost/health impacts	Section 4.4
Utility/temperature and humidity monitoring costs	Section 4.4
Comments on the financial or health benefits of suggested green alternatives	Section 4.4
Green item recommendation data source and pricing identified	UW Model and Part II Energy Audit Section 1
Payback analysis when recommending replacement of traditional items with green items at the end of their useful life	UW Model
Payback analysis when recommending early replacement of existing items with green(er) items	UW Model
IPM and EA recommendations for rehab/reserves/operations	Part II Energy Audit Part III IPM Report
Evidence of sizing calculation for HVAC, or explanation as to inappropriateness	Energy Audit 3.1
Evidence the PCA contractor tested the duct-work for leakage	Energy Audit 3.1
Lighting replacements for all common areas	Section 3.7.1.2
Evidence of sizing consideration for DHW, if individual	Energy Audit 4
Kitchen and bath exhaust fans (Energy Star if cost-efficient)	Section 3.4.2.2
Carbon monoxide alarms	Section 3.6
Low- or non-VOC paint, caulking, sealants, etc	Sections 3.3.2
Carpet replacement (smooth surface flooring or low-VOC)	Section 3.7.2.3
Rubber walk- mats at entryways	Section 4.4
Rubber stair treads	Section 4.4
Cement board siding	Section 3.3.2
Green management of construction/rehab debris	Section 3.2.6
Green roofing (EnergyStar shingles, reflective roof, garden roof)	Section 3.3.5
Water efficient landscaping	Section 3.2.3
Thermostats (Energy Star)	Sections 3.4.2.1, 3.4.2.2
Checklist for Review of Green Energy Audit Elements	Report Reference
Certification that Energy Auditor meets all required qualifications	Certification Section Page 1 and Appendix H
Prudent energy-related improvements to the property with estimates of cost and financial calculations of probable payback when accounting for the remaining useful life of existing components	Energy Audit Section 5
Recommendations include such variables as operating hours, equipment efficiency, and building and occupant energy demand characteristics	Energy Audit Section 5
Building meets current code, with respect to energy-related items	Section 4.1
Actual costs, appropriate rates and utility configuration of the subject property (rather than sample or profile property)	Energy Audit 2.2
Financial calculations are sufficiently transparent to permit an understanding of the variables considered and their appropriateness	UW Model & Energy Audit Section 5
Recommendation on whether additional insulation, air sealing or caulking and sealing, is a cost-justified expenditure	Energy Audit 5.2
Co-generation, if potentially feasible	Energy Audit 4.3

Checklist for Review of Green Energy Audit Elements	Report Reference
Current energy usage and costs (kilowatt-hour, therms, utility cost)	Energy Audit 2.3, 2.4, 2.5
Recommended energy efficiency improvements	Energy Audit Section 5
Installed cost estimates for recommended energy efficiency measures	Energy Audit Section 5
Expected useful life of recommended energy measures	Energy Audit Section 5
Annual energy saving estimates (consumption and cost reductions)	Energy Audit Section 5
Simple payback period in years for each recommended measures	Energy Audit Section 5
Potential savings in water consumption expenses which are associated with energy improvements	Energy Audit Section 5

TABLE OF CONTENTS

Certification	1
Part I – RAD Physical Condition Assessment	3
1. Executive Summary	4
1.1. Cost Tables	4
2. Purpose and Scope	10
2.1. Purpose	10
2.2. Property Expected Useful Life Estimate	11
2.3. Opinions of Probable Cost	11
2.4. Methodology	12
2.5. Critical Repairs	12
2.6. Rehabilitation Needs and Green Significant Additions.....	12
2.7. Long Term Physical Needs	13
2.8. Personnel Interviewed	13
2.9. Owner Provided Documentation	14
2.10. Capital Improvements for Market Upgrades	14
2.11. Pre-Survey Questionnaire	14
2.12. Weather Conditions	15
3. Description and Observations	16
3.1. Existing Building General Description	16
3.1.1. Apartment Unit Types and Unit Mix.....	16
3.1.2. Apartment Units Observed	16
3.2. Site.....	18
3.2.1. Topography	18
3.2.2. Storm Water Drainage.....	18
3.2.3. Parking, Paving and Sidewalks	19
3.2.4. Landscaping and Grounds	20
3.2.5. Patio, Terrace, and Balcony	20
3.2.6. General Site Improvements.....	20
3.2.7. Utilities	22
3.3. Structural Frame and Building Envelope.....	22
3.3.1. Foundations.....	22
3.3.2. Exterior Walls	23
3.3.3. Exterior and Interior Stairs.....	24
3.3.4. Exterior Windows and Doors	24
3.3.5. Roofing	26
3.4. Mechanical and Electrical Systems.....	28
3.4.1. Plumbing.....	28
3.4.1.1 Common Area Plumbing and Domestic Hot Water	28
3.4.1.2 In-Unit Plumbing and Domestic Hot Water	29
3.4.2. Heating, Ventilating, and Air Conditioning (HVAC)	30
3.4.2.1 Common Area HVAC.....	30
3.4.2.2 In-Unit HVAC	32
3.5. Building Elevators and Conveying Systems.....	33
3.6. Fire Protection and Security Systems	34
3.7. Interior Elements	35
3.7.1. Common Areas.....	35
3.7.1.1 Interior Finishes	35
3.7.1.2 Building Electrical Service and Lighting.....	37
3.7.2. Dwelling Units.....	38

3.7.2.1 Cabinetry and Countertops	38
3.7.2.2 Appliances	38
3.7.2.3 Interior Finishes	39
3.7.2.4 In-Unit Electrical Service and Lighting	40
3.8. Other Structures	41
4. Code Compliance and Accessibility.....	42
4.1. Energy Conservation Code Review	42
4.2. Building, Zoning, and Fire Code Compliance.....	42
4.3. Accessibility	43
4.4. Indoor Air Quality and Mold.....	44
4.5. Follow Up Recommendations	45
5. Environmental Concerns	46
6. Green Building Principles.....	49
Part II – Energy Audit.....	50
1. Executive Summary	51
2. Utilities & Benchmarking	53
2.1. Utility Metering.....	53
2.2. Utility Rates	55
2.3. Electricity	55
2.4. Natural Gas	57
2.5. Domestic Water	59
2.6. Benchmarking.....	61
3. Load Sizing	64
3.1. HVAC Sizing Results.....	64
3.2. Domestic Water Heater Sizing Results	65
4. Green Energy Technology.....	66
4.1. Solar Energy Feasibility.....	66
4.2. Wind Energy Feasibility	68
4.3. Combined Heat and Power (CHP) Feasibility	68
4.4. Geothermal Energy Feasibility	69
4.5. Fuel Cell Technology.....	69
4.6. Green Energy Technology Recommendations	70
5. Energy Conservation Measures.....	71
5.1. Energy Conservation Recommendations.....	71
5.2. Energy Conservation Descriptions.....	71
5.3. Energy Conservation Measures Considered	73
6. Operations and Maintenance	75
6.1. Resident Education	75
6.2. Operation and Maintenance Recommendations.....	76
7. Appendices	77
Appendix A:	Photographic Record
Appendix B:	Site Plans
Appendix C:	Energy Audit Calculations
Appendix D:	Manual J Calculations
Appendix E:	Supporting Documentation
Appendix F:	EMG Accessibility Checklist
Appendix G:	Pre-Survey Questionnaires
Appendix H:	Resumes

CERTIFICATION

EMG has completed a RAD Physical Condition Assessment (RPCA) and a Limited Environmental Screening of the subject property, David F. Roche Apartments located at 2 Aladdin Avenue in Dumont, Bergen County, New Jersey 07628.

The RPCA was performed at the Client's request using methods and procedures consistent with good commercial and customary practice conforming with:

- Client supplied scope of work for market upgrades.
- Fannie Mae (FNMA) Document FNMA, Delegated Underwriting Services (DUS) Guide Section 3 entitled "Physical Needs Assessment Guidance to the Property Evaluator".
- Green Physical Condition Assessment Statement of Work and Contractor Qualifications.

This report is exclusively for the use and benefit of the Client identified on the first page of this report, the Client's successors, and the HUD RAD office. This report is not for the use or benefit of any other person or entity, nor may it be relied upon by any other person or entity, for any purpose, without the advance written consent of EMG. The purpose for which this report shall be used shall be limited to the use as stated in the contract between the client and EMG.

The opinions EMG expresses in this report were formed utilizing the degree of skill and care ordinarily exercised by any prudent architect or engineer in the same community under similar circumstances. EMG assumes no responsibility or liability for the accuracy of information contained in this report which has been obtained from the Client or the Client's representatives, from other interested parties, or from the public domain. The conclusions presented represent EMG's professional judgment based on information obtained during the course of this assignment. EMG's evaluations, analyses and opinions are not representations regarding the design integrity, structural soundness, or actual value of the property. Factual information regarding operations, conditions and test data provided by the Client or their representative has been assumed to be correct and complete. The conclusions presented are based on the data provided, observations made, and conditions that existed specifically on the date of the assessment.

EMG certifies that EMG has no undisclosed interest in the subject property, EMG's relationship with the Client is at arms-length, and that EMG's employment and compensation are not contingent upon the findings or estimated costs to remedy any deficiencies due to deferred maintenance and any noted component or system replacements.

EMG's PCA cannot wholly eliminate the uncertainty regarding the presence of physical deficiencies and the performance of a subject property's building systems. Preparation of a PCR in accordance with ASTM E2018-08 is intended to reduce, but not eliminate, the uncertainty regarding the potential for component or system failure and to reduce the potential that such component or system may not be initially observed. This RPCA was prepared recognizing the inherent subjective nature of EMG's opinions as to such issues as workmanship, quality of original installation, and estimating the remaining useful life of any given component or system. It should be understood that EMG's suggested remedy may be determined under time constraints, formed without the aid of engineering calculations, testing, exploratory probing, code compliance, the removal of materials, or design considerations. Furthermore, there may be other alternate or more appropriate schemes or methods to remedy the physical deficiency. EMG's opinions are generally formed without detailed knowledge from individuals familiar with the performance of the component or system.

In preparation of this report EMG has used staff who are certified to complete building energy audits by RESNET or BPI (or their training providers), or be a Certified Energy Manager (CEM), or be a State equivalent certified energy auditor, or be a professional architect, or be a registered professional engineer, or be a RESNET certified Home Energy Rater or BPI Certified Building Analyst.

EMG staff has training in evaluating building systems and conditions and continue to receive training on an annual basis. EMG staff is LEED certified or have equivalent certifications. EMG staff takes training classes in environmental and energy subjects on a regular basis with at least 10-hours of education per year.

EMG is not be under suspension or debarment by HUD, or involved as a defendant in criminal or civil action with HUD. EMG has an acceptable record of performance with HUD and has completed hundreds of reports where the residents receive Section 8 or public housing assistance. EMG produces reports that are well regarded in the marketplace in terms of content, timeliness and responsiveness. We have the capacity to complete the project inspection and prepare the report in a time frame acceptable to the Lender/Owner

Any questions regarding this report should be directed to the Program Manager at ebeeghly@emgcorp.com or at 800.733.0660, x7607.

Prepared by: Jill Orlov
Field Observer/Energy Auditor
Project Manager

Reviewed by:



Brett Byers, Reviewer for
Edward Beeghly
Program Manager

PART I - RAD PHYSICAL CONDITION ASSESSMENT

1. EXECUTIVE SUMMARY

The Client contracted with EMG to conduct a RAD Physical Condition Assessment (RPCA) and a Limited Environmental Screening consisting of field observations, document review and related due diligence tasks of the subject property, David F. Roche Apartments located at 2 Aladdin Avenue in Dumont, Bergen County, New Jersey 07628. The PCA was performed on March 4, 2014.

The multifamily property has one, six-story apartment building containing a total of 99 rental apartment units and a single-story gazebo on a site of approximately 2.26 acres. Construction of the property was completed in 1982.

On-site amenities consist of a rental office, community room, library, TV room and laundry facilities.

Generally, the property was constructed within industry standards, has been well maintained during recent years, and appeared to be in good to fair overall condition. The property representative provided EMG documentation and information regarding maintenance procedures and capital repair/s during the past three years. These upgrades include:

- Domestic and heating boilers – 2012
- Common area kitchen – 2012
- Apartment unit kitchen and appliances – 2011
- Seal coating asphalt parking lots – 2014 done after assessment was completed
- Contaminated soil removal – 2013 completed
- Fence replacement due to soil removal project

EMG's cost evaluation takes into consideration these previous improvements, the quality as well as the level of maintenance and workmanship at the subject property. EMG observed elements of the reported work during the site reconnaissance.

There are a number of Critical Repairs, Rehabilitation Needs and Long Term Physical Needs which should be accomplished during the next 20 years as part of the preventive maintenance program. These needs are identified in the various sections of this report and are summarized in the tables.

The following Critical Repair items were observed:

- No smoke detectors located within bedrooms
- No carbon monoxide detector in natural gas fired generator room
- Sidewalk with differential settlement causing potential trip hazard.
- An isolated area of insulation potentially containing asbestos in the boiler was observed as damaged, brittle and exposed. As such, EMG recommends that an Asbestos Survey be conducted.

It is assumed that the client will be addressing Critical Needs during rehab activities.

1.1. COST TABLES

The cost tables on the following pages identify the Critical Repairs, Rehabilitation Needs and Physical Needs over the Term for the property. The cost methodology is explained in Section 2 and further detail is provided for the individual cost items in report Sections 3 through 4.

Critical Needs Summary

Project Name: David F. Roche Apartments

Street Address: 2 Aladdin Avenue

City, State: Dumont, New Jersey

Zip Code: 07628

Critical Repair Description	PCA Contractor Estimate	Actual Cost	Included in Rehab or To Be Completed Prior To Closing?
Install smoke detectors in sleeping rooms, 99 @ \$347 ea	\$34,353		Included in Rehab
Ductwork Suspect Asbestos Sampling & Remediation, \$3500	\$3,500		Included in Rehab
Install carbon monoxide detector in natural gas fired generator room, 1 @ \$177	\$177		Included in Rehab
Sidewalk with differential settlement causing potential trip hazard, 25 SF @ \$7/SF	\$175		Included in Rehab

TOTAL: All Critical Needs	\$38,205	\$0
TOTAL: Critical Needs Included in Rehab	\$38,205	\$0
TOTAL: Critical Needs To Be Completed Prior To Closing	\$0	\$0

Project Name David F. Roche Apartments
Street Address 2 Aladdin Avenue
City, State Dumont, New Jersey
Zip Code 07628

Total # of Units: 99
Original PCA Submission Date: 1/0/00
Last Time All Bids (Budget) Updated:

REHABILITATION SPECIFICATIONS
IMPROVEMENTS

WORK						
Work Item (A)		Description of Improvements Work (B)	Quantity (C)	Unit Cost (D)	Budget (E)	Date of Bid Expiration (F)
Rehab Items (Code, Description)		Increase row height to fully display description text				
3.2.2	Storm Water Drainage		0	\$0.00	\$0	
3.2.4	Parking and Driveways		0	\$0.00	\$0	
3.2.4.01	Parking and Driveways Other #1		0	\$0.00	\$0	
3.2.4.02	Parking and Driveways Other #2	Replace heaved concrete	25	\$7.00	\$175	
3.2.6	Land and Grounds: Irrigation		0	\$0.00	\$0	
3.2.9.01	Compactor		0	\$0.00	\$0	
3.2.9.02	Site Other #2		0	\$0.00	\$0	
3.2.9.03	Site Other #3		0	\$0.00	\$0	
3.2.9.04	Site Other #4		0	\$0.00	\$0	
3.3.2.2	Exterior Walls		0	\$0.00	\$0	
3.3.2.3	Insulation		0	\$0.00	\$0	
3.3.2.4.01	Sliding Glass Doors		0	\$0.00	\$0	
3.3.2.4.02	Windows		0	\$0.00	\$0	
3.3.2.5.01	Exterior Doors		0	\$0.00	\$0	
3.3.2.5.02	Storm Doors		0	\$0.00	\$0	
3.3.2.9.01	Caulking and Sealant		0	\$0.00	\$0	
3.3.2.9.02	Control joint sealant	Reseal joints	664	\$6.31	\$4,187	
3.3.2.9.03	Bldg Envelope Other #3		0	\$0.00	\$0	
3.3.2.9.04	Bldg Envelope Other #4		0	\$0.00	\$0	
3.3.4	Roofs		0	\$0.00	\$0	
3.4.1.2.01	Domestic Boilers - High		0	\$0.00	\$0	
3.4.1.2.02	Domestic hot water storage tanks		0	\$0.00	\$0	
3.4.1.2.03	DHW #3		0	\$0.00	\$0	
3.4.1.2.04	DHW #4		0	\$0.00	\$0	
3.4.1.3.01	Water Savers: Faucets		0	\$0.00	\$0	
3.4.1.3.02	Water Savers: Shower Heads		0	\$0.00	\$0	
3.4.1.3.03	Water Savers: Toilets		0	\$0.00	\$0	
3.4.2.1.01	HVAC Common Area Heating		0	\$0.00	\$0	
3.4.2.1.02	HVAC In-Unit Heating		0	\$0.00	\$0	
3.4.3.1.01	Bath Exhaust Fans		0	\$0.00	\$0	
3.4.3.1.02	HVAC Common Area Cooling		0	\$0.00	\$0	
3.4.3.1.03	HVAC In-Unit Cooling		0	\$0.00	\$0	
3.4.9.01	Programmable Thermostats		0	\$0.00	\$0	
3.4.9.02	Heat Exchanger		0	\$0.00	\$0	
3.4.9.03	Condensing Unit 6 tons		0	\$0.00	\$0	
3.4.9.04	Air Handling Units		0	\$0.00	\$0	
3.5	Elevators		0	\$0.00	\$0	
3.5.01	Elevator Cab Interiors		0	\$0.00	\$0	
3.6.01	CO Detectors/Alarms	Install CO detector in boiler room	1	\$177.00	\$177	
3.6.02	Smoke Detectors	Install smoke detectors in sleeping rooms	99	\$347.00	\$34,353	
3.6.03	Fire Pump overflow pan		1	\$2,320.00	\$2,320	
3.7.1.01	Common Area Floor Coverings		0	\$0.00	\$0	
3.7.1.02	Common Area Interior Lighting		0	\$0.00	\$0	
3.7.1.03	Common Area Interior Lighting		0	\$0.00	\$0	
3.7.1.04	Exit Signs		0	\$0.00	\$0	
3.7.1.05	Exterior Lighting		0	\$0.00	\$0	
3.7.1.9.01	Common Area Tile Flooring		0	\$0.00	\$0	
3.7.1.9.02	0		0	\$0.00	\$0	
3.7.2.1.01	Kitchen Cabinets		0	\$0.00	\$0	
3.7.2.1.02	Kitchen Counter Tops, Sinks		0	\$0.00	\$0	
3.7.2.1.03	Kitchen Floor Coverings		0	\$0.00	\$0	
3.7.2.11.01	Dishwashers		0	\$0.00	\$0	
3.7.2.11.02	Range Hoods		0	\$0.00	\$0	
3.7.2.11.03	Ranges		0	\$0.00	\$0	
3.7.2.11.04	Refrigerators 1	Replace older refrigerators with energy star units.	10	\$435.00	\$4,350	
3.7.2.11.05	Refrigerators 2		0	\$0.00	\$0	
3.7.2.19	Other Appliances		0	\$0.00	\$0	
3.7.2.19.01	Kitchen Exhaust Fans		0	\$0.00	\$0	
3.7.2.19.02	Kitchen Other #1		0	\$0.00	\$0	
3.7.2.19.03	Kitchen Other #2		0	\$0.00	\$0	
3.7.2.19.04	Kitchen Other #3		0	\$0.00	\$0	
3.7.2.2.01	Bath Counter Tops, Sinks		0	\$0.00	\$0	
3.7.2.2.02	Bath Floor Covering		0	\$0.00	\$0	
3.7.2.2.03	Bath Vanities		0	\$0.00	\$0	
3.7.2.29.01	Bath tub and Surround		0	\$0.00	\$0	
3.7.2.29.02	Bath Other #2		0	\$0.00	\$0	
3.7.2.29.03	Bath Other #3		0	\$0.00	\$0	
3.7.2.29.04	Bath Other #4		0	\$0.00	\$0	

WORK						
Work Item (A)		Description of Improvements Work (B)	Quantity (C)	Unit Cost (D)	Budget (E)	Date of Bid Expiration (F)
3.7.2.3.01	Interior Carpet		0	\$0.00	\$0	
3.7.2.3.02	Interior Doors		0	\$0.00	\$0	
3.7.2.3.03	Interior Painting		0	\$0.00	\$0	
3.7.2.39.01	Interior Other #1		0	\$0.00	\$0	
3.7.2.39.02	Interior Other #2		0	\$0.00	\$0	
3.7.2.39.03	Interior Other #3		0	\$0.00	\$0	
3.7.2.39.04	Interior Other #4		0	\$0.00	\$0	
3.7.2.4.01	Ceiling Fans		0	\$0.00	\$0	
3.7.2.4.02	In-Unit Lighting Bulbs		0	\$0.00	\$0	
3.7.2.4.03	In-Unit Lighting Fixtures		0	\$0.00	\$0	
3.7.2.4.04	Apartment Unit Light Fixture		0	\$0.00	\$0	
3.7.2.4.05	Intercom system		0	\$0.00	\$0	
3.8.01	Ductwork Suspect Asbestos	Sample and abate	1	\$3,500.00	\$3,500	
3.8.02	Fire Alarm Control Panel		0	\$0.00	\$0	
3.8.03	Ventilation/Exhaust in Compactor	Replace exhaust fan	1	\$8,035.00	\$8,035	
3.8.04	Common Area Painting		0	\$0.00	\$0	
3.8.05	Site Light - HPS Poles Convert to	Replace lighting fixtures with LED	11	\$950.00	\$10,450	
3.8.06	Dumpsters - Property Owned	Replace dumpsters	6	\$437.50	\$2,625	
3.8.07	Common Area Washing Machines		0	\$0.00	\$0	
3.8.08	Common Area Dryers		0	\$0.00	\$0	
3.8.09	Generator - natural gas 93.8 kVa		0	\$0.00	\$0	
3.8.10	ADA - parking signage	Move signage	2	\$100.00	\$200	
3.8.11	ADA - Common Area Men's	Wrap sink drain	1	\$65.00	\$65	
3.8.12	Other #12		0	\$0.00	\$0	
3.8.13	Other #13		0	\$0.00	\$0	
3.8.14	Other #14		0	\$0.00	\$0	
3.8.15	Other #15		0	\$0.00	\$0	
N/A	Relocation Costs		N/A	N/A	\$0	

Total Improvements Eligible for Rehab Escrow \$70,437

10.0% Contingency \$7,044

Total Rehab Escrow Improvements Plus Contingency = TOTAL FUNDING \$77,481

Comment cells provided below:

Comments:

Additional comments:

20 Year Schedule for:

David F. Roche Apartments

David F. Roche Apartments

	2015	2015	2016	2017	2018	2019	2020	2021	2022	2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	2033	2034	20 Year		20 Year
Replacement Component	Rehab	Year 1	Year 2	Year 3	Year 4	Year 5	Year 6	Year 7	Year 8	Year 9	Year 10	Year 11	Year 12	Year 13	Year 14	Year 15	Year 16	Year 17	Year 18	Year 19	Year 20	Total		+ Rehab
3.2.2 Storm Water Drainage	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	
3.2.4 Parking and Driveways	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	
3.2.4.01 Parking and Driveways Other #1	0	0	17,688	0	0	0	0	17,688	0	0	0	0	17,688	0	0	0	0	17,688	0	0	0	0	70,752	70,752
3.2.4.02 Parking and Driveways Other #2	175	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	175	
3.2.6 Land and Grounds: Irrigation	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	
3.2.9.01 Compactor	0	12,839	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	12,839	12,839	
3.2.9.02 Site Other #2	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	
3.2.9.03 Site Other #3	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	
3.2.9.04 Site Other #4	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	
3.3.2.2 Exterior Walls	0	0	0	0	0	7,748	7,748	7,748	7,748	0	0	0	0	0	0	7,748	7,748	7,748	7,748	0	0	0	61,980	61,980
3.3.2.3 Insulation	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	
3.3.2.4.01 Sliding Glass Doors	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	
3.3.2.4.02 Windows	0	0	0	0	0	0	113,729	113,729	113,729	113,729	0	0	0	0	0	0	0	0	0	0	0	454,916	454,916	
3.3.2.5.01 Exterior Doors	0	0	0	0	0	0	1,600	0	0	0	0	0	0	0	0	0	0	0	0	0	0	1,600	1,600	
3.3.2.5.02 Storm Doors	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	
3.3.2.9.01 Caulking and Sealant	0	0	0	0	0	0	0	0	0	0	0	34,325	0	0	0	0	0	0	0	0	0	34,325	34,325	
3.3.2.9.02 Control joint sealant	4,187	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	4,187	0	0	0	0	4,187	8,375	
3.3.2.9.03 Bldg Envelope Other #3	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	
3.3.2.9.04 Bldg Envelope Other #4	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	
3.3.4 Roofs	0	0	0	0	0	0	0	0	0	0	0	0	69,231	0	0	0	0	0	0	0	0	69,231	69,231	
3.4.1.2.01 Domestic Boilers - High Efficiency	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	
3.4.1.2.02 Domestic hot water storage tanks	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	3,000	0	0	3,000	3,000	
3.4.1.2.03 DHW #3	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	
3.4.1.2.04 DHW #4	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	
3.4.1.3.01 Water Savers: Faucets	0	6,211	6,211	6,211	6,211	6,211	0	0	0	0	0	6,211	6,211	6,211	6,211	6,211	0	0	0	0	0	62,113	62,113	
3.4.1.3.02 Water Savers: Shower Heads	0	990	990	990	990	990	990	990	990	990	0	8,910	0	0	0	0	0	0	0	0	0	17,820	17,820	
3.4.1.3.03 Water Savers: Toilets	0	10,560	10,560	10,560	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	31,680	31,680	
3.4.2.1.01 HVAC Common Area Heating	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	
3.4.2.1.02 HVAC In-Unit Heating	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	
3.4.3.1.01 Bath Exhaust Fans	0	0	28,315	28,315	28,315	28,315	0	0	0	0	0	0	28,315	28,315	28,315	28,315	28,315	0	0	0	0	226,520	226,520	
3.4.3.1.02 HVAC Common Area Cooling	0	13,260	0	0	0	0	0	0	0	0	0	0	0	0	0	0	13,260	0	0	0	0	26,520	26,520	
3.4.3.1.03 HVAC In-Unit Cooling	0	0	0	3,276	3,276	3,276	3,276	3,276	3,276	3,276	6,552	6,552	3,276	0	0	0	0	0	3,276	3,276	3,276	49,140	49,140	
3.4.9.01 Programmable Thermostats	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	
3.4.9.02 Heat Exchanger	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	4,694	0	0	4,694	4,694	
3.4.9.03 Condensing Unit 6 tons	0	0	0	0	5,720	0	0	0	0	0	0	0	0	0	0	0	0	0	0	5,720	0	11,440	11,440	
3.4.9.04 Air Handling Units	0	14,800	0	0	0	0	0	0	0	0	0	0	0	0	0	0	7,400	7,400	0	0	0	29,600	29,600	
3.5 Elevators	0	0	0	0	0	0	0	0	0	0	88,291	0	0	88,291	0	0	0	0	0	0	0	176,582	176,582	
3.5.01 Elevator Cab Interiors	0	0	0	0	0	0	0	0	0	0	14,560	0	0	14,560	0	0	0	0	0	0	0	29,120	29,120	
3.6.01 CO Detectors/Alarms	177	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	177	0	0	0	0	177	354	
3.6.02 Smoke Detectors	34,353	34,353	0	0	0	0	0	0	0	0	0	68,706	0	0	0	0	0	0	0	0	0	103,059	137,412	
3.6.03 Fire Pump overflow pan	2,320	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	2,320	
3.7.1.01 Common Area Floor Coverings	0	23,062	0	0	0	0	0	0	23,062	0	0	0	0	0	0	23,062	0	0	0	0	0	69,186	69,186	
3.7.1.02 Common Area Inter. Lighting Bulbs	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	
3.7.1.03 Common Area Inter. Lighting Fixtures	0	14,196	0	0	0	0	0	0	0	0	0	0	0	0	0	0	14,196	0	0	0	0	28,392	28,392	
3.7.1.04 Exit Signs	0	0	0	0	0	0	8,697	0	0	0	0	0	0	0	0	0	0	0	0	0	0	8,697	8,697	
3.7.1.05 Exterior Lighting	0	6,600	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	6,600	6,600	
3.7.1.9.01 Common Area Tile Flooring	0	5,789	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	5,789	5,789	
3.7.1.9.02	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	

20 Year Schedule for:

David F. Roche Apartments

David F. Roche Apartments

	2015	2015	2016	2017	2018	2019	2020	2021	2022	2023	2024	2025	2026	2027	2028	2029	2030	2031	2032	2033	2034	20 Year		20 Year
Replacement Component	Rehab	Year 1	Year 2	Year 3	Year 4	Year 5	Year 6	Year 7	Year 8	Year 9	Year 10	Year 11	Year 12	Year 13	Year 14	Year 15	Year 16	Year 17	Year 18	Year 19	Year 20	Total		+ Rehab
3.7.2.1.01 Kitchen Cabinets	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3.7.2.1.02 Kitchen Counter Tops, Sinks	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	38,165	38,165	38,165	114,494	114,494	114,494
3.7.2.1.03 Kitchen Floor Coverings	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3.7.2.11.01 Dishwashers	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3.7.2.11.02 Range Hoods	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3.7.2.11.03 Ranges	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	15,605	15,605	15,605	15,605	62,420	62,420	62,420
3.7.2.11.04 Refrigerators 1	4,350	0	0	0	0	0	0	0	0	0	0	0	4,302	4,302	4,302	4,302	8,652	4,302	4,302	4,302	4,302	43,065	47,415	47,415
3.7.2.11.05 Refrigerators 2	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3.7.2.19 Other Appliances	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3.7.2.19.01 Kitchen Exhaust Fans	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3.7.2.19.02 Kitchen Other #1	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3.7.2.19.03 Kitchen Other #2	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3.7.2.19.04 Kitchen Other #3	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3.7.2.2.01 Bath Counter Tops, Sinks	0	7,047	7,047	7,047	7,047	7,047	7,047	7,047	7,047	7,047	0	0	0	0	0	0	0	0	0	0	0	0	63,419	63,419
3.7.2.2.02 Bath Floor Covering	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3.7.2.2.03 Bath Vanities	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3.7.2.29.01 Bathtub and Surround	0	0	0	0	0	0	15,635	15,635	15,635	15,635	15,635	15,635	15,635	15,635	15,635	0	0	0	0	0	0	0	140,712	140,712
3.7.2.29.02 Bath Other #2	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3.7.2.29.03 Bath Other #3	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3.7.2.29.04 Bath Other #4	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3.7.2.3.01 Interior Carpet	0	0	0	0	0	0	13,609	13,609	13,609	13,609	13,609	13,609	13,609	13,609	13,609	0	0	0	0	0	0	122,480	122,480	122,480
3.7.2.3.02 Interior Doors	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3.7.2.3.03 Interior Painting	0	10,898	10,898	10,898	10,898	10,898	10,898	10,898	10,898	10,898	0	10,898	10,898	10,898	10,898	10,898	10,898	10,898	10,898	10,898	10,898	0	196,163	196,163
3.7.2.39.01 Interior Other #1	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3.7.2.39.02 Interior Other #2	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3.7.2.39.03 Interior Other #3	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3.7.2.39.04 Interior Other #4	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3.7.2.4.01 Ceiling Fans	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3.7.2.4.02 In-Unit Lighting Bulbs	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3.7.2.4.03 In-Unit Lighting Fixtures	0	0	0	0	0	0	0	6,435	0	0	0	0	0	0	0	0	0	0	0	0	0	6,435	6,435	6,435
3.7.2.4.04 Apartment Unit Light Fixture	0	7,722	0	0	0	0	0	0	0	0	0	0	0	0	0	0	7,722	0	0	0	0	15,444	15,444	15,444
3.7.2.4.05 Intercom system	0	0	56,133	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	56,133	56,133	56,133
3.8.01 Ductwork Suspect Asbestos Sampling &	3,500	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	3,500	3,500
3.8.02 Fire Alarm Control Panel	0	0	12,114	0	0	0	0	0	0	0	0	0	0	0	0	0	0	12,114	0	0	0	24,228	24,228	24,228
3.8.03 Ventilation/Exhaust in Compactor Room	8,035	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	8,035	0	0	0	0	8,035	16,070	16,070
3.8.04 Common Area Painting	0	0	0	0	0	0	9,572	9,572	9,572	0	0	0	0	0	0	0	0	0	0	0	0	28,715	28,715	28,715
3.8.05 Site Light - HPS Poles Convert to LED	10,450	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	10,450	10,450
3.8.06 Dumpsters - Property Owned	2,625	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	2,625	2,625
3.8.07 Common Area Washing Machines	0	7,700	7,700	0	0	0	0	0	0	0	0	3,850	0	0	0	0	7,700	7,700	0	0	0	34,650	34,650	34,650
3.8.08 Common Area Dryers	0	0	0	0	0	0	3,638	3,638	0	0	0	0	0	0	0	0	0	0	0	0	0	7,276	7,276	7,276
3.8.09 Generator - natural gas 93.8 kVa	0	0	0	43,380	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	43,380	43,380	43,380
3.8.10 ADA - parking signage	200	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	200	200	200
3.8.11 ADA - Common Area Men's Restroom I	65	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	65	65	65
3.8.12 Other #12	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3.8.13 Other #13	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3.8.14 Other #14	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
3.8.15 Other #15	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
Total	70,437	176,026	157,656	110,677	62,457	64,484	196,438	210,263	205,564	165,183	138,647	168,696	169,164	181,820	78,969	80,535	89,974	83,454	87,687	77,965	61,347	2,567,007	2,637,444	2,637,444
Inflated Total	70,437	176,026	161,597	116,280	67,259	71,179	222,251	243,841	244,351	201,260	173,150	215,945	221,958	244,528	108,860	113,794	130,310	123,888	133,426	121,599	98,072	3,189,574	3,260,011	3,260,011

2. PURPOSE AND SCOPE

2.1. PURPOSE

The purpose of the RAD program is to allow Public Housing and Moderate Rehabilitation (Mod Rehab) properties to convert, to long-term Section 8 rental assistance contracts. The program also allows Rent Supplement (Rent Supp), Rental Assistance Payment (RAP), and Mod Rehab properties to convert tenant-based vouchers issued upon contract expiration or termination to project-based vouchers. The goal is to restructure the financing and to bring properties up to market standards through an initial rehabilitation and subsequent repairs and/or replacements over the next twenty year period. The restructuring program has three basic goals:

1. *Social* - Preserving the “affordable housing stock” by maintaining the long term physical integrity of HUD subsidized rental housing insured by FHA.
2. *Economic* - Reducing the long term Project based Section 8 rental assistance costs and reducing the costs of insurance claims paid by FHA.
3. *Administrative* - Promote greater operating cost efficiencies and establish systems to administer the program and terminate relationships owners/properties that violate agreements or program requirements

The purpose of the RAD Physical Condition Assessment (RPCA) is to assist the client in assessing the physical condition of the property and meeting the stated goal of the program to encourage affordable multifamily rehabilitation of properties using sustainable Green Building principles. These sustainable Green Building principles are comprised of energy efficiency, sustainability, indoor air quality, and recycling. They also incorporate the “Health Housing” approach which was established by HUD in 1999 in response to a Congressional Directive regarding growing concerns about environmental health in children. This program is designed to incorporate Green principles into property rehabilitation and scheduled repairs and/or replacements over the next twenty years.

The RAD PCA is comprised of three parts:

Part 1: PCA Report comparing Traditional and Green Requirements. The traditional PCA identifies repairs and/or replacements necessary in the first year and in the subsequent twenty years. The PCA will estimate costs using both “traditional” and “Green” principles and provides discussion on the benefits (financial and otherwise) of the green alternative material or system.

Part 2: Energy Audit.

It evaluates how energy and water is used at the property. This documents and recommends energy-related improvements that can be made to the property, the costs of the improvements, and provides a simple financial payback analysis. It includes an initial assessment of potentially viable alternatives for generating electricity, heating water, and heating and cooling the conditioned space at the building.

Part 3: Utility Consumption Baseline – It contains data on utility usage at the property, both tenant-paid and owner-paid, and including all common areas for a full 12-month period. It establishes a baseline to allow for benchmarking, and for future measurement of consumption and costs. As such, the utility baseline creates a whole building consumption profile in achieving its aim of establishing the standard on which future consumption can be compared.

For this PCA, at least 25% of apartment units and a representative sample of major building systems and components were observed and their physical condition evaluated in accordance with ASTM E2018-08. The report identifies Critical Repairs, Rehabilitation Specifications, and Long Term Physical Needs. The report also estimates costs using both “traditional” and “green” principles and provides discussion on the benefits of the green alternative. The standard is a non-luxury standard adequate for the rental market intended at the original approval of Project-based assistance. The physical needs identified are intended to reflect those necessary for the Project to retain its original market position as an affordable Project in a decent, safe and sanitary condition. The intent is to include those improvements that the Project requires to compete in the non-subsidized market, resulting in a marketable Project that competes on rent rather than amenities.

The property management staff and code enforcement agencies were interviewed for specific information relating to the physical property, code compliance, available maintenance procedures, available drawings and other documentation. The property systems and components were observed and evaluated for their present condition and the estimated cost for repairs and/or capital reserves are included in the cost estimates. All findings relating to these opinions of probable costs are included in the narrative sections of this report.

The physical condition of building systems and related components are typically defined as being in one of three categories: Good, Fair, and Poor. For the purposes of this report, the following definitions are used:

- Good = Satisfactory as-is. Requires only routine maintenance during the reserve term. Repair or replacement may be required due to a system’s estimated useful life.
 - Fair = Satisfactory as-is. Repair or replacement is required due to current physical condition and/or estimated remaining useful life.
 - Poor = Immediate repair, replacement, or significant maintenance is recommended.
- In an effort to quickly find key information EMG has created the following quick reference guide for the client and report reviewer.

2.2. PROPERTY EXPECTED USEFUL LIFE ESTIMATE

Subject to the qualifications stated in this paragraph and elsewhere in this report, the remaining useful life (RUL) of the property is estimated to be not less than 35 years. The foregoing estimate as to useful life is an expression of a professional opinion and is not a guarantee or warranty, express or implied. This estimate is based upon the observed physical condition of the property at the time of the EMG’s visit and is subject to the possible effect of concealed conditions or the occurrence of extraordinary events, such as natural disasters or other “acts of God”, which may occur subsequent to the date of the on-site visit.

The remaining useful life for the property is further based on the assumption that: (a) the Critical Repairs, Rehabilitation Needs, and future repairs for which replacements provided as capital reserves are recommended are completed in a timely and workmanlike manner; and (b) a comprehensive program of preventive and remedial property maintenance is continuously implemented using an acceptable standard of care. The estimate is made only with regard to the expected physical or structural integrity of the improvements on the property, and no opinion regarding economic or market conditions, the present or future appraised value of the property, or its present or future economic utility is expressed by EMG.

2.3. OPINIONS OF PROBABLE COST

This section provides estimates for Critical Repairs, Rehab Items, and 20 Year Reserve Items as noted within this RPCA.

These estimates are based on Invoice or Bid Documents provided either by the Owner or facility and construction costs developed by construction resources such as *EnergyStar.gov*, *R.S. Means* and *Marshall & Swift*, EMG's experience with past costs for similar properties, city cost indexes, and assumptions regarding future economic conditions.

2.4. METHODOLOGY

Based upon-site observations, research and judgment, along with referencing Expected Useful Life (EUL) tables from various industry sources, EMG opines as to when a system or component will most probably require replacement. Accurate historical replacement records, if provided are typically the best sources of information. Exposure to the elements, initial quality and installation, extent of use, the quality and amount of preventive maintenance exercised, and other similar items are all factors that impact the effective remaining useful life of a system or component. The Remaining Useful Life (RUL) or effective remaining life of a component or system equals the EUL less its effective age. The estimated useful life calculations are based on those found in the Fannie Mae (FNMA) Document; FNMA, Delegated Underwriting Services (DUS) Guide Section 3 entitled "Physical Needs Assessment Guidance to the Property Evaluator".

Where quantities could not be derived from actual takeoff, lump sum or allowances are used. Estimated costs to correct are based on professional judgment and the probable or actual extent of the observed defect, inclusive of the cost to design, procure, construct and manage the corrections.

Each building system or component is further identified with the following references if costs or other actions are applicable:

- RM = Routine maintenance
- CR = Critical Repair
- RS = Rehabilitation Scope
- RR = Replacement Reserve
- NA = Not Applicable

2.5. CRITICAL REPAIRS

Based on observations of readily apparent conditions, Critical Repairs have been identified as health and safety deficiencies, violations of Section 8 housing quality standards or FHA's regulatory agreement standards that require immediate attention. These repairs include conditions that endanger the safety or well being of residents. It is expected that Critical Repairs will be completed prior to closing.

2.6. REHABILITATION NEEDS AND GREEN SIGNIFICANT ADDITIONS

The Rehab cost estimate is an estimate of repairs, replacements, or significant deferred or other maintenance items recommended within the next year. The Rehab cost estimate includes items which pass the early replacement criteria or which provide a direct environmental benefit to the property. This RPCA identifies repairs necessary in the first year following restructuring. It offers "traditional" and "green" components that meet local building codes. It clearly identifies if "green" components exceed local building code requirements. It gives two "green" options, if available, for example evaluating 16 SEER and 19 SEER air-conditioning costs and efficiencies. It estimates costs using both "traditional" and "green" principles and it provides comments on the benefits (financial and otherwise) of the green alternative. As part of the savings analysis, the analysis includes evaluating costs and benefits for two levels of "green" for certain mandatory "green" options that may apply to the property.

Green Building or sustainable building is the practice of reducing the impact of buildings on the environment, both during construction and as part of the operation of the building systems. Their use of water, energy, and materials should be reduced through the use of new planning methods and material usage.

EMG's goal was to identify all opportunities to: 1) improve energy efficiency; 2) minimize water use; 3) use recycled or recyclable materials, 4) protect the indoor air quality; 5) reduce the 'carbon footprint' of the buildings and site; and 6) proper disposal of replaced materials.

In the table located on the following pages, EMG has identified components which will require replacement either immediately, within the first year (Rehab items), or over the course of the next twenty years (20 Year Reserve Items). We compare the cost of traditional replacements and compare them to "green" replacements. The anticipated benefits of green approaches are discussed throughout the report, along with increased short term costs for the long term benefits of choosing "Green" or sustainable alternatives.

Green Significant Additions are those items that meet the "green principles" and are recommended for early replacement in the subsequent year.

2.7. LONG TERM PHYSICAL NEEDS

Long Term Physical Needs are for recurring probable expenditures, which are not classified as operation or maintenance expenses, which should be annually budgeted for in advance. Long Term Physical Needs are reasonably predictable both in terms of frequency and cost. However, they may also include components or systems that have an indeterminable life but nonetheless have a potential liability for failure within an estimated time period. These items are included in the 20 Year Reserve Schedule.

This methodology excludes systems or components that are estimated to expire after the reserve term of 20 years and that are not considered material to the structural and mechanical integrity of the subject property. Furthermore, systems and components that were not deemed to have a material effect on the use were also excluded. Costs that are caused by acts of God, accidents or other occurrences that are typically covered by insurance, rather than reserved for, are also excluded.

Replacement costs were solicited from ownership/property management, EMG's discussions with service companies, manufacturers' representatives, and previous experience in preparing such schedules for other similar facilities. Costs for work performed by ownership's or property management's maintenance staff were also considered.

EMG's reserve methodology involves identification and quantification of those systems or components requiring reserve funds within the evaluation period which is defined as the age minus the reserve term. Additional information concerning systems or components respective replacement costs (in today's dollars), typical expected useful lives, and remaining useful lives were estimated so that a funding schedule could be prepared. The Long Term Physical Needs presupposes that all required remedial work has been performed or that monies for remediation have been budgeted for items defined as a Critical Repair or Rehab item.

2.8. PERSONNEL INTERVIEWED

In the process of conducting the RPCA and follow-up telephone calls, the following personnel from the facility and government agencies were interviewed:

Name and Title	Organization	Phone Number
Jason Rooney Property Manager	Housing Authority of Bergen County	201.387.9107
Vincent Bufis Assistant to Director of Property Management	Housing Authority of Bergen County	201.206.9413

Name and Title	Organization	Phone Number
Juan Perez Superintendent	Housing Authority of Bergen County	201.926.4861
Steve Cavadias Building and Zoning Inspector	Dumont Building and Zoning Department	201.387.5034
Matt Banta Fire Chief	Dumont Fire Department	201.387.5042

EMG met with Jason Rooney, the on-site Point of Contact (POC), who was cooperative and provided information that appeared to be accurate based upon our subsequent site observations. It is EMG's opinion that the on-site contact was knowledgeable about the subject property and questions EMG posed during the interview process. The POC's management involvement at the property has been limited to the past two weeks.

2.9. OWNER PROVIDED DOCUMENTATION

Prior to the PCA, relevant documentation was requested that could aid in the knowledge of the subject property's physical improvements, extent and type of use, and/or assist in identifying material discrepancies between reported information and observed conditions. The review of submitted documents does not include comment on the accuracy of such documents or their preparation, methodology, or protocol. The following documents were provided for review while performing the RPCA:

- Site plan
- Floor plans
- Utility billing information
- Warranty Information
- Proposal for Environmental Services by H2M Associates dated July 31, 2012 – soil contamination removal

No other documents were available for review.

2.10. CAPITAL IMPROVEMENTS FOR MARKET UPGRADES

The report identifies Short Term and Long Term Physical Needs. The standard is a non-luxury standard adequate for the rental market intended at the original approval of Project-based assistance. The Capital Improvements for Market Upgrades identified are intended to reflect those necessary for the Project to retain its original market position as an affordable Project in a decent, safe and sanitary condition. The intent is to include those improvements that the Project requires to compete in the non-subsidized market, resulting in a marketable Project that competes on rent rather than amenities.

EMG has evaluated the subject property and based on EMG's experience and observations, no market upgrades are recommended.

2.11. PRE-SURVEY QUESTIONNAIRE

A Pre-Survey Questionnaire was sent prior to EMG's on-site visit. The completed questionnaire is included in Appendix G. Information obtained from the questionnaire has been used in preparation of this RPCA.

2.12. WEATHER CONDITIONS

Weather conditions at the time of the onsite review were partly cloudy, with temperatures in the low 20s (°F) and light to moderate winds. In addition, there were approximately six inches of snow on the ground.

3. DESCRIPTION AND OBSERVATIONS

3.1. EXISTING BUILDING GENERAL DESCRIPTION

3.1.1. Apartment Unit Types and Unit Mix

The following table identifies the reported apartment types and mix at the subject property. Measurements were provided by the Housing Authority.

Apartment Unit Types and Mix		
Quantity	Type	Floor Area
98	1 Bedroom/1 Bathroom	571 SF
1	2 Bedrooms/1 Bathroom – superintendent unit	916 SF
There is currently 1 vacant unit.		
There are currently no down units.		
99	TOTAL	

There was one vacant unit on the day of our site visit.

3.1.2. Apartment Units Observed

Approximately 25 percent of the apartment units and all vacant units were observed in order to gain a clear understanding of the overall property condition. Other areas accessed included the exterior of the entire property, the roof and all of the interior common areas. The following apartments were observed:

Apartment Units Observed		
Unit/Floor	Type	Remarks
609/Sixth	1 Bedroom/1 Bathroom	Occupied, good condition.
606/Sixth	1 Bedroom/1 Bathroom	Occupied, fair to poor condition. Very dirty with urine odor.
604/Sixth	1 Bedroom/1 Bathroom	Occupied, good condition.
602/Sixth	1 Bedroom/1 Bathroom	Occupied, good to fair condition. ADA unit. Loose bathroom drain pipe insulation. Holes in interior doors. Toilet grab bars non-compliant in length
610/Sixth	1 Bedroom/1 Bathroom	Occupied, fair to poor condition. ADA unit. No kitchen drain pipe insulation.
516/Fifth	1 Bedroom/1 Bathroom	Occupied, good condition.
512/Fifth	1 Bedroom/1 Bathroom	Occupied, good condition.
503/Fifth	1 Bedroom/1 Bathroom	Occupied, good condition.
507/Fifth	1 Bedroom/1 Bathroom	Occupied, good condition.
508/Fifth	1 Bedroom/1 Bathroom	Occupied, good condition.

Apartment Units Observed		
Unit/Floor	Type	Remarks
406/Fourth	1 Bedroom/1 Bathroom	Occupied, good condition. Faucet difficult to turn on. Ceramic tile tub surround has slight joint expansion/cracking.
401/Fourth	1 Bedroom/1 Bathroom	Occupied, good condition. Radiator clicking noise.
318/Third	1 Bedroom/1 Bathroom	Occupied, good condition. Ceramic tile tub surround has slight joint expansion/cracking.
314/Third	1 Bedroom/1 Bathroom	Occupied, good condition. Ceramic tile tub surround has slight joint expansion/cracking.
313/Third	1 Bedroom/1 Bathroom	Occupied, good condition.
219/Second	1 Bedroom/1 Bathroom	Occupied, good condition. Entrance closer and latch not functioning properly
215/Second	1 Bedroom/1 Bathroom	Occupied, good condition.
211/Second	1 Bedroom/1 Bathroom	Occupied, good condition. Clicking radiator.
202/Second	1 Bedroom/1 Bathroom	Occupied, good condition. ADA unit. No kitchen drain pipe insulation. Clicking radiator.
208/Second	1 Bedroom/1 Bathroom	Occupied, good condition.
101/First	1 Bedroom/1 Bathroom	Occupied, good condition. Hearing impaired unit
103/First	1 Bedroom/1 Bathroom	Occupied, good condition. Ceiling grid in bathroom slightly rusty over tub.
105/First	1 Bedroom/1 Bathroom	Occupied, good condition. Stretched AC unit cord to receptacle.
104/First	2 Bedrooms/1 Bathroom	Occupied, good condition. Superintendent unit.
102/First	1 Bedroom/1 Bathroom	Occupied, fair condition. Stained carpet.
Vacant Units		
316/Third	1 Bedroom/1 Bathroom	Vacant, good condition. Ceramic tile tub surround has slight joint expansion/cracking.
Down Units		
None		

A "down unit" is a term used to describe a non-rentable apartment due to fire damage, water damage, missing appliances, damaged floor, wall or ceiling surfaces, or other significant deficiencies. The Point of Contact stated that there were no down units at the subject property.

All areas of the property were available for observation while on site.

3.2. SITE

3.2.1. Topography

Item	Description	Action	Condition	Replacement
Topography	Relatively flat	RM	Good	Traditional
Adjacent Properties	Department of Public Works, parkland with pool, softball field, city parking lot	NA	NA	NA
Retaining Walls	Concrete masonry unit – low with chain link fence	RM	Good	Traditional

Green Physical Condition Discussions: As part of any re-landscaping plan, incorporate design features that enhance the soil quality, reduce storm water runoff and pollution, and encourage beneficial insects and wildlife. This measure also minimizes ongoing water requirements, maintenance needs, and green waste. In addition, seek to incorporate design features into the site that channel runoff to swales, porous surfaces, and holding areas. These measures reduces water runoff, helps filter and treat storm water, and protects the local ecosystem.

Observations/Comments:

- The property topography and adjacent uses did not appear to present conditions detrimental to the property. No significant areas of erosion were observed affecting the property. Based on the results of this assessment, no further actions appear to be required at this time.
- The concrete block retaining wall is in good condition requiring routine maintenance.

3.2.2. Storm Water Drainage

Item	Description	Action	Condition	Replacement
Drainage Systems and Erosion Control	Surface flow and inlets to underground piping to municipal system	RM	Good	Traditional
On-Site Retention	Not Applicable	NA	NA	NA
Pavement System	Non-porous	RM	Good	Traditional

Green Physical Condition Discussions: Increasing porous surfaces decreases runoff and protects the health of creeks, wetlands and other bodies of water. Reducing runoff improves soil health because it retains valuable topsoil on-site. EMG evaluated opportunities to increase storm water retention on site by replacing or rehabilitating parking lots, sidewalks, and other hardscape features with porous pavement. These measures help reduce water runoff, help filter and treat storm water, and protect the local ecosystem. Pervious paving surfaces can cost more than hard surfaces but can easily be incorporated into future onsite hard surface repairs and replacements.

Observations/Comments:

- Evidence of storm water runoff from adjacent properties was not observed. Based on the results of this assessment, no further actions appear to be required at this time.
- The storm water system appeared to provide adequate runoff with no evidence of major ponding or erosion noted. Based on the results of this assessment, no further actions appear to be required at this time.

3.2.3. Parking, Paving and Sidewalks

Item	Description	Action	Condition	Replacement
Parking and Paving	Surface lots 65 total parking stalls, including handicapped-accessible stalls 6 handicapped-accessible parking stalls of which 1 is van-accessible Asphalt	RR	Good	Traditional
Sidewalks, Curbs and Gutters	Concrete Brick pavers at main entrance	CR	Good to poor	Traditional
Site Access	Three driveways into site from adjacent street.	RM	Good	Traditional

Green Physical Condition Discussions: For replacement or rehabilitation of sidewalks and other hardscape features such as footings, mat foundations, slab on grade, slabs on metal deck, cast in place and tilt up walls, drives and equipment pads, displace Portland cement in concrete mixes with at least 20 percent recycled content materials (flyash or slag). This measure increases the durability and strength of the concrete, reduces greenhouse gas emissions associated with cement production, and helps keep flyash out of landfills.

Increasing porous surfaces decreases runoff and protects the health of creeks, wetlands and other bodies of water. Reducing runoff improves soil health because it retains valuable topsoil on-site. Types of pervious or porous pavement include porous aggregate, porous turf, plastic geocells, open-jointed paving blocks, open-cell paving grids, porous concrete, granite or crushed rock, and soft porous surfacing such as bark or mulch.

Specify light color pigments or aggregates for any replacement or rehabilitation of sidewalks and other hardscape features. This measure reduces the building's cooling costs and minimizes the heat island effect by reducing the amount of heat retained by surrounding asphalt, concrete, and building structures. Adding colorants and pigments to mixes of concrete and asphalt does not generally increase costs. Changing aggregate colors is also relatively inexpensive.

Observations/Comments:

- In order to maximize the pavement life, pothole patching, crack sealing, seal coating and re-stripping of the asphaltic concrete paving will be required during the reserve term. The cost for this work is included in the 20 Year Reserve Schedule as a Reserve Item.
- The paving system does not require full replacement within the 20 year reserve, therefore porous paving is not recommended. Consideration to porous pavement systems should occur when the entire system is in need of replacement.
- The property will be subjected to only minor concrete repairs of flatwork during the life of the loan. High-volume fly-ash concrete mixes are widely available and typically cost the same as low-volume mixes. The recommendation is made to specify recycled concrete materials for flatwork repairs. Use of recycled concrete will comply with LEED-EB Material and Resources Credit 2 – Optimize Use of Alternative Materials.
- An isolated section of heaved concrete along the northeast facing elevation and a small portion of curb left at the end of the service drive create potential tripping hazards and require immediate repair or replacement. The cost for this work is included in the 20 Year Reserve Schedule as a Rehab Item.

3.2.4. Landscaping and Grounds

Item	Description	Action	Condition	Replacement
Landscaping	Trees, grass and shrubs	RM	Good	Traditional
Irrigation	Automatic underground system	RM	Good	Traditional

Green Physical Condition Discussions: As part of any re-landscaping plan, incorporate design features that enhance the soil quality, reduce storm water runoff and pollution, and encourage beneficial insects and wildlife. This measure also minimizes ongoing water requirements, maintenance needs, and green waste. In addition, seek to incorporate design features into the site that channel runoff to swales, porous surfaces, and holding areas. These measures reduces water runoff, helps filter and treat storm water, and protects the local ecosystem.

Observations/Comments:

- Landscaping is minimal at the property and improvements are not necessary or planned. However, future landscaping efforts at the property should be “sustainable” featuring native plants and shrubs. Native landscaping can achieve significant savings over time by reducing labor, water, and chemical costs.
- The in-ground sprinkler system is controlled by manual valves operated by the maintenance staff.
- EMG recommends installing soil moisture sensors to detect the amount of moisture contained in soil. Once the specified level of moisture is reached, the sensors prevent the automatic watering system from operating.
- The site point of contact reported there are not problems with the underground irrigation system. EMG recommends only ongoing routine maintenance of the system. Based on the results of this assessment, no further actions appear to be required at this time.

3.2.5. Patio, Terrace, and Balcony

Item	Description	Action	Condition	Replacement
Patios	Concrete-paved terrace around the gazebo at the rear of the property	RM	Good	Traditional
Balconies	Not applicable	NA	NA	NA

Observations/Comments:

- The ground-level terrace slabs have no signs of movement. Routine maintenance will be required during the reserve period.

3.2.6. General Site Improvements

Item	Description	Action	Condition	Replacement
Signage	Street address numbers	CR	Poor	Traditional
Site Lighting	Parking lot light standards – 10 double and 1 single head –high pressure sodium @ 400 watt Wall packs – 8 high pressure sodium @ 100 watt Photo sensor Control	RR	Fair	Green

Item	Description	Action	Condition	Replacement
Building Lighting	Wall packs – 8 high pressure sodium @ 100 watt Photo sensor Control	RR	Fair	Green
Fencing	Chain link	RM	Good	Traditional
Dumpsters	Set on pads in enclosures Trash compactors	RS	Fair to poor	Traditional
Recycling & Waste Management	Recycling plan is in place Construction debris plan is recommended	NA	NA	Green

Green Physical Condition Discussions: High density residential properties should always consider, where space permits, the provision of bike parking/storage for residents, visitors, and employees. This measure will reduce traffic and pollution while increasing occupant/worker health. Secured and covered storage can be under building overhangs, stairwells (inside or out), bike lockers, in parking garages, or other means. The property may benefit by providing bicycle storage. The property layout provides several areas that could be converted to locked bicycle storage for residents; however, management has identified that there is not a great demand for bicycle storage at the facility.

Observations/Comments:

- The property address identification signage at the front entrance is in good condition requiring routine maintenance. The property monument signage for the entrance driveway has been removed and is under a design phase. It was initially removed during the soil remediation project. No costs are included in the tables; although, this is required to be replaced immediately for authorities to identify the property.
- A payback analysis was completed for replacement of the existing building mounted lighting with high efficacy LED wall packs. The payback period is 6.6 years and early replacement is recommended. The cost for this work is included in the 20 Year Reserve Schedule as a Reserve Item.
- A payback analysis was completed for replacement of the existing site lighting fixtures with LED fixtures. The payback period is 3.6 years and early replacement is recommended. The cost for this work is included in the 20 Year Reserve Schedule as a Reserve Item.
- The Dumpsters are owned and maintained by the property. Six Dumpsters were dropped and sustained damage requiring replacement. Based on the Estimated Useful Life and the observed conditions, replacement is recommended. The cost for this work is included in the 20 Year Reserve Schedule as a Rehab Item.
- The compactor appears to be in good to fair operational condition. Based on the Estimated Useful Life replacement is recommended. The cost for this work is included in the 20 Year Reserve Schedule as a Reserve Item.
- EMG recommends the property owners institute a Green Waste Management Plan that includes items from future construction/renovation. The plan should set a 50% recycle and/or salvage goal to reduce landfill disposal. Materials to be recycled and/or salvaged include: clean dimensional wood, plywood, concrete, CMU, brick, gypsum board, asphalt shingles, glass, carpet & pad, and pipe. This type of plan has little or no direct cost to the property. Requirements for including recycling and/or salvage costs should be added to all Requests for Proposals put out for contractor bids.

3.2.7. Utilities

The following is a table of utilities supplied to the site and the names of the suppliers:

Site Utility Providers	
Utility	Supplier
Sanitary sewer	Township of Dumont Water Department
Storm sewer	Township of Dumont Water Department
Domestic water	Township of Dumont Water Department – United Water
Electric service	PSEG
Natural gas service	PSEG
Telephone service	Verizon
Cable Television	Comcast

Green Physical Condition Discussions: It is recommended that property management perform regular visual assessments of known underground piping locations. These assessments can be performed as part of routine activities such as trash pickup, lawn mowing or while walking from one area of the property to another. The purpose is to look for tell-tale signs of utility piping leakage. These tell-tale sign manifest themselves as wet spots, non-weather related puddles, areas are always wet, soil undermining and noticeable increases in domestic water consumption. Such occurrence should be report to the local utility supplier immediately.

It is recommended that property management perform regular visual assessments of building and common area lighting. These assessments can be performed as part of routine activities such as trash pickup, lawn mowing or while walking from one area of the property to another. The purpose is to look for tell-tale signs of electrical utility waste. These spot assessments document light fixtures that are on during the day, damage or missing lighting fixtures, malfunctioning timer or photo cells.

Observations/Comments:

- The on-site representatives reported that the utilities provided are adequate for the property.
- Green Energy Technologies are evaluated in the Energy Audit in Part II of this report.

3.3. STRUCTURAL FRAME AND BUILDING ENVELOPE

3.3.1. Foundations

Item	Description	Action	Condition	Replacement
Floor	Concrete slab-on-grade	RM	Good	Traditional
Footings	Concrete perimeter and pad footings	RM	Good	Traditional
Basements and Crawl Spaces	Not applicable	NA	NA	NA

Green Physical Condition Discussions: For replacement or rehabilitation of features such as footings, mat foundations, slab on grade, slabs on metal deck, cast in place and tilt up walls, drives and equipment pads, displace Portland cement in concrete mixes with at least 20 percent recycled content materials (flyash or slag). This measure increases the durability and strength of the concrete, reduces greenhouse gas emissions associated with cement production, and helps keep flyash out of landfills.

Observations/Comments:

- The foundations and footings could not be directly observed while on-site. No apparent signs of significant cracking or movement that would indicate excessive settlement were observed. Based on the results of this assessment, no further actions appear to be required at this time.
- The construction drawings indicated concrete footings approximately 24 inches below grade.

3.3.2. Exterior Walls

Item	Description	Action	Condition	Replacement
Typical Finishes and Cladding	Brick veneer	RR	Good	Traditional
Other finishes	Painted concrete posts	RM	Good	Traditional
Sealants	Caulking and sealants at joints, finish transitions, and at wall openings.	RR	Good	Traditional

Green Physical Condition Discussions: For repainting, specify recycled-content paint. The recycled-content should be at least 50 percent and can come from post-industrial or post-consumer sources. VOCs shall not exceed 250 grams per liter for recycled paint. This measure keeps unwanted paint out of landfills.

For rehabilitation or replacement of exterior siding, specify environmentally preferable siding products. Fiber cement, stucco, metal, brick and stone are durable and easy to maintain. FSC-certified wood siding is made with sustainably harvested wood. Depending on the siding product chosen, this measure may increase durability, reduce waste, maintenance and replacement costs, or support sustainable forestry practices.

Three popular forms of siding are not recommended due to environmental and durability concerns:

- Vinyl siding is a non-recyclable product that poses a landfill burden. In addition, vinyl manufacture produces dioxin, a persistent environmental toxin.
- Conventional wood siding imposes high maintenance costs and may involve detrimental harvesting practices.
- Composition siding (or hardboard) looks like wood siding and requires more ongoing maintenance than wood siding. It is made with wood fibers from industrial process waste or fast-growing tree species. The product is susceptible to water damage when improperly installed and is not recommended..

In addition to its aesthetic function, siding protects a building's exterior walls from wind, sunlight, pests and water. The following siding options are environmentally preferable compared to vinyl, conventional wood or composition siding:

- Fiber-cement siding is gaining popularity as a safe, durable product and is made of Portland cement, sand and cellulose fibers.
- Stucco is a common siding material in many areas of the country. It is made of sand, water, and cement. Some stucco has an acrylic finish.
- Brick or stone veneers are often used in new construction to give the façade a classic look.
- Metal siding is gaining popularity due to its durability, lack of maintenance needs, and because it is lightweight.
- Wood siding certified by the Forest Stewardship Council (FSC) comes from sustainably managed forestry operations. Another environmentally preferable option is siding made from reclaimed wood that may come from old buildings, telephone poles, or river and lake bottoms. Wood can hold up with proper maintenance, but the siding options listed above are likely to last longer and require less maintenance than wood.

Observations/Comments:

- Painting and patching of the exterior walls are recommended during the reserve term. The areas requiring painting, such as the soffits and columns at the front entrance are minimal. This work can be accomplished through routine maintenance.
- The Energy Audit recommends replacement of caulking, building sealants and weather stripping as part of the measures to control air leakage in the buildings. Refer to the Energy Audit section for discussion.
- The brick does not have cracking or efflorescence evident. Based on the age and the condition of the exterior walls, it is recommended that a dedicated repair program be instituted for anticipated degradation of the mortar joints and overall exterior wall performance. Walls should be routinely checked for fractured, spalling or missing mortar joints, and cleaning or tuck pointing of the brick and joints should be performed where necessary. The cost for this work is included in the 20 Year Reserve Schedule as a Reserve Item.
- The construction joints are in fair condition. Separation at the joint was observed requiring replacement. The cost for this work is included in the 20 Year Reserve Schedule as Rehab item.

3.3.3. Exterior and Interior Stairs

Item	Description	Action	Condition	Replacement
Exterior Steel Stairs	Not applicable	NA	NA	NA
Interior Concrete and Metal Stairs	The interior stairs are concrete-filled steel pan treads. The handrails and balusters are constructed of metal.	RM	Good	Traditional

Observations/Comments:

- The interior stairs, balusters, and handrails are in good condition and will require routine maintenance over the evaluation period.

3.3.4. Exterior Windows and Doors

Item	Description	Action	Condition	Replacement
Windows	Aluminum-framed storefront system at front entrance Aluminum-framed units with fixed or sliding panes of glazing with exterior screens, double-hung units Double –glazed Factory finished metal spandrel panels No Low-E coating Caulking at perimeter of frames	RR	Good to fair	Green
Exterior Doors	Aluminum storefront entrance doors Hollow metal doors in metal frames Lever handles or push/pull panic hardware with deadbolts	RR	Good to fair	Green

Item	Description	Action	Condition	Replacement
Apartment Doors	Apartments accessed from interior corridor Hollow metal doors in metal frames Lever or knob handles with deadbolts	RM	Good	Traditional
Overhead Doors	Coiling roll-up door at compactor with mechanical openers	RM	Good to fair	Traditional

Green Physical Condition Discussions: Windows and patio doors generally make up a significant fraction of a multifamily unit's exterior walls. They are also generally the weakest link in the building's thermal envelope. Windows can allow unwanted heat into the building during the summer and can account for as much as 25 percent of heat loss in the winter. High-performance windows help control heat gain and loss. Unfortunately replacing single-pane windows with newer, more efficient ones is generally not cost effective as a stand-alone retrofit. Replacement is generally more cost effective when pursued in conjunction with general wall rehabilitation to address rot, water damage, and other issues.

Rehabilitation provides an opportunity for increased energy savings and thermal comfort via door replacement and repair. Poor entrance door construction, an absence of wind barriers or airlocks, and inadequate weather-stripping can allow unwanted heat and cold into the building.

Observations/Comments:

- The windows are reported to be original. Based on their Estimated Useful Life and the observed conditions, replacements are recommended during the reserve term. In addition, the sill flashing was observed to be sloped towards the building versus positive flow away from the window and caulking. During the next window replacement this should be rectified to allow the sealant to have a full life expectancy.
- A payback analysis was completed for replacement of the existing windows with Energy Star rated units having low-E glazing and argon-filled panes. The payback period is more than the useful life of the component and early replacement is not recommended. Replacement of the windows is recommended. The cost for this work is included in the 20 Year Reserve Schedule as a Reserve Item.
- The building features entrance doors that provide egress to conditioned hallways and non-conditioned stairwells. The assemblies appeared to be in good condition at the time of the inspection and do not warrant green replacement as there is little added efficiency to be gained.
- The first floor main entrance lobby features an airlock via entrance vestibule and maintaining weather stripping on these doors should be part of an ongoing operations and maintenance program.
- EMG recommends that all future replacements of doors exposed to the weather are performed using EnergyStar rated systems and that all future apartment and common area doors not exposed to the weather are replaced with appropriately fire rated renewable resource or rapidly renewable wood products.
- Based on the Estimated Useful Life and the observed conditions, replacement of the storefront building access system is recommended during the reserve term. The common area doors were not found to be of good energy efficiency rating. Where possible, we recommend all future replacements utilize a well-sealed, insulated-pane storefront access system. The cost for this work is included in the 20 Year Reserve Schedule as a Reserve Item.
- No significant problems were observed with the interior apartment entry doors. Based on their Estimated Useful Life and the observed conditions, replacements are not recommended during the reserve term.
- All future replacements of dwelling unit doors are recommended to utilize renewable resource or rapidly renewable wood products.

- The sealant appeared to be flexible and smooth. Replacement and/or repairs should be addressed as part of routine maintenance. Based on the results of this assessment, no further actions appear to be required at this time.
- The overhead service door appeared to be in good to fair condition requiring routine maintenance.

3.3.5. Roofing

Item	Description	Action	Condition	Replacement
Type	Flat			
Finish	Built-up membrane with granular coated cap sheet	RR	Fair to poor	Green
Maintenance	Maintained by in-house staff or outside contractor as needed			
Age	The roof finishes are approximately 8 years			
Warranties	Information regarding roof warranties or bonds was not available.			
Drainage	Internal drains	RM	Good	Traditional
Flashing	Sheet metal base and edge flashing	RM	Good	Traditional
Parapet and Copings	Metal drip edge; no parapet	RM	Good	Traditional
Soffits, Eaves, and Fascias	Concealed soffits	RM	Good	Traditional
Skylights	Not applicable	NA	NA	NA
Attics	Not applicable	NA	NA	NA
Ventilation	Not applicable	NA	NA	NA
Other	Steel-framed, concrete panel cantilevered sun shades over some south facing windows	RM	Good	Traditional

Green Physical Condition Discussions:

Reflective Roofing

As part of any roofing rehabilitation, reduce the roof temperature by specifying cool roof products that meet Energy Star levels of efficiency. Installing a radiant barrier can reduce 90 percent or more of roof deck radiant heat. This measure reduces the air-conditioning load, minimizes the heat island effect, and extends the roof life.

To qualify for the Energy Star label, roofing products must meet the following specifications:

- For low-slope roofs (surfaces with a slope of 2:12 inches or less), the initial solar reflectance must be at least 0.65. The material must maintain a solar reflectance of at least 0.50 after three years of installation under normal conditions.
- For high-slope roofs (surfaces with a slope of 2:12 inches or greater), the initial solar reflectance must be at least 0.25. The material must maintain a solar reflectance of at least 0.15 after three years of installation under normal conditions.

A payback analysis was performed to install an Energy Star rated reflective roofing system. The payback period was calculated as longer than the life of the product. Based on the results of the payback analysis, the use of reflective roofing materials is not recommended. The cost for this work is included in the 20 Year Reserve Schedule as a Green Significant Addition.

Vegetative Roofing

Green roofs are a combination of vegetation and soil planted on a waterproof membrane atop a roof. They reduce roof temperature, cooling costs, and storm runoff. In addition to reducing cooling costs and minimizing storm water runoff, green roofs also:

- Filter pollution
- Reduce sewage system loads
- Protect underlying roof material from UV and temperature fluctuations
- Provide habitat for small animals
- Absorb carbon dioxide (CO₂)
- Offer an attractive alternative to traditional roofs
- Reduce noise transfer from the outdoors

Based on the current roofing configuration, vegetative roofing appears to be a viable alternative. EMG recommends assessing the potential of an investment in Green Roofing. An Architect should consult with the roofing contractor to determine structural upgrade requirements, if any, and the overall cost.

Observations/Comments:

- The subject property does not have central common area or dwelling unit air conditioning and therefore is not a candidate for energy savings related to installing an EnergyStar rated roofing system based on financial payback.
- According to the Point of Contact, there are no active roof leaks. This opinion was confirmed by our visual observations.
- No evidence of roof deck or insulation deterioration was observed or, according to the Point of Contact, reported. These items should be inspected during any future roofing repair or replacement. Based on the results of this assessment, no further actions appear to be required at this time.
- No evidence of fire retardant treated plywood (FRT) was observed in EMG's limited survey, and no use of FRT was reported by the Point of Contact. Based on the results of this assessment, no further actions appear to be required at this time.
- The primary roof is approximately eight years old. According to the Point of Contact, the previous roofing replacements have included the complete removal of the prior roof. Based on the Estimated Useful Life and the observed conditions, replacement is recommended during the reserve term. The cost for this work is included in the 20 Year Reserve Schedule as a Reserve Item.
- Roof drainage appeared to be adequate. Clearing and minor repair of drain system components should be performed regularly as part of routine maintenance.

3.4. MECHANICAL AND ELECTRICAL SYSTEMS

3.4.1. Plumbing

3.4.1.1 Common Area Plumbing and Domestic Hot Water

Item	Description	Action	Condition	Recommendation
Water Meter	Meters in vaults along public street	RM	Good	Traditional
Domestic Water Supply	Copper pipe	RM	Good	Traditional
Domestic Waste and Ventilation	Cast iron pipe	RR	Fair to poor	Traditional
Domestic Hot Water	Central gas-fired boiler - 2 2 boilers @ 550,000 Btu/hr, 161 kW 2 storage tanks with 200-gallon capacity each	RR	Good	Green
Vent Damper	Domestic Water Boilers are equipped with vent dampers			
Electronic Ignition	Domestic Water Boilers have electronic ignition			
Insulation	Piping and tank insulation	RM	Good to fair	Green
Common Area Restroom Fixtures	Commercial grade bath fixtures and accessories Standard flow fixtures	RM	Good	Green

Observations/Comments:

- The plumbing systems appear to be well maintained. The water pressure appears to be adequate. The plumbing systems will require routine maintenance during the reserve term.
- There is no evidence that the property uses polybutylene piping for the domestic water distribution system. In addition, the POC indicated that polybutylene piping is not used at the property.
- The pressure and quantity of hot water appear to be adequate.
- Domestic water heater sizing is included in the Energy Audit.
- The boilers are replacements and are reportedly two years old. Based on the Estimated Useful Life and the observed conditions, replacements are recommended during the reserve term. The cost for this work is included in the 20 Year Reserve Schedule as a Reserve Item.
- A payback analysis was not completed for replacement of the existing high efficiency domestic water boilers as no significant improvement in efficiency is available.
- The hot water storage tanks are replacements. Based on the Estimated Useful Life, replacements are recommended during the reserve term. The cost for this work is included in the 20 Year Reserve Schedule as a Reserve Item.
- Hot water piping, tanks and heat exchangers are well insulated.
- Approximately 50 LF of four-inch no hub cast iron soil piping in the mechanical room and visible portions above ceilings was observed with surface corrosion but there is no evidence or reports of leaks or deterioration leading to suspicion of the piping integrity. No further actions appear to be necessary at this time.

- The copper domestic water piping appeared to be in sound condition. No leaks have been reported and none were observed during the site visit. Property management has not received reports of leaks in risers or distribution laterals. No further action appears to be necessary at this time.

3.4.1.2 In-Unit Plumbing and Domestic Hot Water

Item	Description	Action	Condition	Recommendation
Domestic Hot Water	Served by central system. Refer to Section 3.4.1.1.	NA	NA	NA
Insulation	Piping insulated	RM	Good to fair	Green
Apartment Bathrooms	Lavatory, vanity, shower or bathtub, water closet	RR	Good to fair	Green

Where accessible we observed that the domestic hot water piping in the individual dwelling unit is insulated.

The existing showers and sinks have water saving fixtures; sinks have 2.2 gpm and showers have 2.5 gpm aerators. Plumbing fixture flow rates are detailed in the water testing table below. The existing toilets are rated at 3.5 gallons per flush (GPF).

Hot water temperature was physically measured at a random but representative number of dwelling units. The temperatures recorded are as follows:

Sample Location	Faucet Location	Measured Temperature
Dwelling Unit - 609	Bathroom	125.6° F (121° F at tub)
Dwelling Unit - 609	Kitchen	119.5° F
Dwelling Unit - 602	Bathroom	123° F
Dwelling Unit - 602	Kitchen	119.5° F
Dwelling Unit - 516	Bathroom	117.1° F (115.9° F at tub)
Dwelling Unit - 516	Kitchen	120.1° F
Laundry Room	Laundry Sink	122.4° F
Community Room	Kitchen	115.1° F
Rental Office	Bathroom	123.6° F

EMG performed a flow test of the bathroom and kitchen faucets and showerhead and found each fixture to meet the requirements of the 1995, the National Energy Policy Act as follows:

Sample Location	Fixture	NEPA Guidance – Gallon Per Minute /Flush	Flow Test Results
Dwelling Unit - 406	Faucets	2.2 - 2.75 gpm	2.2 gpm
Dwelling Unit - 609	Showers	2.5- 3.0 gpm	2.5 gpm
Dwelling Unit - all	Toilet	1.6 gpf	1.6 gpf

Observations/Comments:

- The water pressure and quantity of hot and cold water was observed to be adequate. Based on the results of this assessment, no further actions appear to be required at this time.
- Bathroom plumbing fixtures were generally original with a few replacements. Kitchens were completely replaced approximately three years ago. Based on the level of maintenance, type of material, and observed conditions, significant replacements are not anticipated during the term. However, some repairs and/or replacements are anticipated during the reserve period. The cost for this work is included in the 20 Year Reserve Schedule as a Reserve Item.
- The domestic water distribution piping does not have a history of chronic leaks. Based on the results of this assessment, no further actions appear to be required at this time.
- No polybutylene piping was observed at this property, and the maintenance supervisor reported that it was not used at the property. Based on the results of this assessment, no further actions appear to be required at this time.
- Hot water piping is insulated as observed in an opening in the vacant unit. No further action is required at this time.

3.4.2. Heating, Ventilating, and Air Conditioning (HVAC)**3.4.2.1 Common Area HVAC**

Item	Description	Action	Condition	Recommendation
Maintenance	Maintained by outside contractor			
Age and Type	The heating equipment is two years old. The air conditioning equipment varies in age. HVAC equipment is reportedly replaced on an "as needed" basis.			
Heating & Air Conditioning	Central system with boilers – apartments and common area rooms Through the wall air conditioners – apartments (provided one each unit in bedroom), community room, office and laundry Electric split systems with pad-mounted condensing units Air handling units serve the common area corridors	RR	Good to fair	Green
Refrigerant	R-22 at split units R-410A at through the wall units			

Item	Description	Action	Condition	Recommendation
Quantity/Capacity	4 boilers @ 550 MBH each, 94% Efficiency 2 condensing units (serves southeast end common areas – all floors/ serves lobby and all elevator lobbies) @ 7.5 tons each, 9 EER – 1996 Condensing unit (front – serves north end common areas – all floors) @ 6 tons, 9 EER - 2003 Through the wall AC units - 6 community room/kitchen; 1 laundry; 2 office @ 10,000 BTU, EER 9.4 – most over 10, 25% under 5 years Air handler units - 1996			
Vent Damper	Boilers are equipped with vent dampers			
Boiler Controls	The boilers are equipped with Outside Air temperature Reset Controls			
Distribution	Air handlers - two-pipe distribution systems to coils Two circulating pumps @ 5 hp	RR	Good to fair	Green
Controls	Local thermostats	GS	Good	Green
Ducts	Concealed ducts above ceilings	GS	Good	Green
Insulation	Ducts insulated and sealed Piping and tanks insulated	RR	Fair to poor	Green
Supplemental systems	Dedicated split system for lobby, community room kitchen, TV room Gas-fired space heater for laundry room	RR	Good	Green
Ventilation	Bathroom and kitchen exhaust fans 28 Fans	RR	Good	Green
Load Sizing	Manual J Load Sizing Calculations are included in the Energy Audit	NA	NA	NA

Observations/Comments:

- The boilers were installed in 2012. The boilers have been well maintained. Based on their Estimated Useful Life and the observed conditions, replacements are recommended during the reserve term. The cost for this work is included in the 20 Year Reserve Schedule as a Reserve Item.
- A payback analysis was not completed for replacement of the existing high efficiency boilers as no significantly more efficient equipment is currently available.
- Refer to the Energy Audit for discussion of boiler controls and vent dampers as Energy Conservation Measures, as appropriate.
- Based on the level of maintenance, type of material, and observed conditions, significant replacements of the circulation pumps and associated piping are not anticipated during the term. However, some repairs and/or replacements are anticipated during the reserve period. The cost for this work is included in the 20 Year Reserve Schedule as a Reserve Item.
- The heat exchanger for the heating water system was installed in 2012. Based on the Estimated Useful Life and the observed conditions, replacement is recommended during the reserve term. The cost for this work is included in the 20 Year Reserve Schedule as a Reserve Item.

- Hot water piping at the air handler on the east end and some exposed piping in the top level of the stairwells are poorly insulated. Approximately 40 linear feet of insulation is missing and will require installation. Refer to the Energy Audit for further discussion and payback analysis if appropriate.
- The condensing units appeared to be between (1) nine and (2) 18 years old. Based on the Estimated Useful Life and the observed conditions, replacements are recommended during the reserve term.
- A payback analysis was completed for replacement of the existing condensing units with Energy Star rated condensing units (11 EER or better). The payback period is longer than the equipment EUL and early replacement is not recommended. The cost for replacing the unit at the end of its useful life is included in the 20 Year Reserve Schedule as a Reserve Item.
- The air handling units have been adequately maintained. Based on the Estimated Useful Life and the observed conditions, replacement is recommended during the reserve term. The cost for this work is included in the 20 Year Reserve Schedule as a Reserve Item.
- The ductwork in the mechanical room was observed to have cracked suspect asbestos insulation. Proper abatement is required with a Certified Industrial Hygienist. The cost for this work is included in the 20 Year Reserve Schedule as a Rehab Item.
- The through-the-wall air-conditioning units have been maintained. Due to their estimated Remaining Useful Life (RUL), replacement is recommended during the reserve term.
- A payback analysis was completed for replacement of the existing through-the-wall air-conditioning units with Energy Star rated AC units (10.8 EER or better). The payback period is 4.3 years and early replacement is recommended. The cost for this work is included in the 20 Year Reserve Schedule as a Reserve Item.
- The trash chute rooms retain the odors from the refuse. It appears that there is inadequate ventilation or exhaust in the compactor room. Installation of ventilation system is required. The cost for this work is included in the 20 Year Reserve Schedule as a Reserve Item.

3.4.2.2 In-Unit HVAC

Item	Description	Action	Condition	Recommendation
Maintenance	Maintained by in-house staff			
Age and Type	Approximately 75% are over 10 years and 25% are under 5 years. HVAC equipment is reportedly replaced on an "as needed" basis.			
Heating and Air Conditioning	Hydronic baseboard heat serve by the central system described above Individual thru-wall air conditioning units	RR	Good to Fair	Green
Refrigerant	R-22 - older R-410A - newer			
Quantity/Capacity	One provided by the property for each bedroom; tenant responsibility to provide additional if needed in living room One Air Conditioner @ ¾ ton each per apartment, approximately 9 SEER for older; 9.4 EER for the newer ones Two Baseboard Heating Units per apartment Some units have a resistance heater above the door in the bathroom			
Distribution	Outlet vents at thru-wall unit	RR	Good	Traditional

Item	Description	Action	Condition	Recommendation
Controls	Standard thermostats	GS	Fair	Green
Ducts	Not applicable	NA	NA	NA
Insulation	Not applicable	NA	NA	NA
Ventilation	Bathroom and kitchen exhaust fans	GS	Fair	Green
Load Sizing	Manual J Load Sizing Calculations are included in the Energy Audit	NA	NA	NA

It was reported by the POC, approximately 75% of the AC units are over 10 years and 25% are under 5 years. A replacement program is in place on an "as needed" basis.

The apartment units are not equipped with programmable thermostats. The pre-programmed settings that come with Energy Star qualified programmable thermostats are intended to deliver savings without sacrificing comfort. Depending on the tenant's schedule, one can see significant savings. The key is to establish a program that automatically reduces heating and cooling based on the tenants' lifestyles. Programmable thermo stats are not recommended for elderly living apartments.

The kitchen in each apartment unit is vented to the exterior by through the wall vents. The bathroom is ventilated to the exterior by through the wall vents.

Observations/Comments:

- The hot water baseboard fin-tube units are original and require routine maintenance.
- The through-the-wall air-conditioning property provided bedroom units range in age. Based on the Estimated Useful Life and the observed conditions, replacements are recommended during the reserve term.
- A payback analysis was completed for replacement of the existing air conditioners with Energy Star rated AC units (9.4 EER or better). The payback period is 4.3 years and early replacement is recommended for the older units but not the newer units. The cost for this work is included in the 20 Year Reserve Schedule as a Reserve Item.
- The through-the-wall air-conditioning units in the living room if installed are supplied by the residents and are reportedly their responsibility to maintain or replace. Based on the results of this assessment, no further actions appear to be required at this time.
- The kitchen and bathroom exhaust fans are ducted to the exterior of the building. Based on their estimated Remaining Useful Life (RUL), replacement of the exhaust fans with energy star rated fans during the reserve term is recommended. The cost for this work is included in the 20 Year Reserve Schedule as a Reserve Item.

3.5. BUILDING ELEVATORS AND CONVEYING SYSTEMS

Item	Description	Action	Condition	Recommendation
Type and Quantity	Two hydraulic passenger elevators @ 2,000 and 2,500-pound capacities Manufactured by Thyssen Krupp motors – 2005 Approximately 100 fpm Controllers manufactured by Galaxy – 2005 Control board replaced 2 weeks ago	RM	Good	Traditional
Maintenance	Service contract with Slade			

Item	Description	Action	Condition	Recommendation
Inspection Certificate	Requested but not found. Assumed to be behind schedule			
Equipment	Located in room adjacent to shaft	RR	Good to fair	Traditional
Other Devices	Electric safety stops Emergency communication equipment	RM	Good	Traditional
Elevator Cab Finishes	Vinyl tile floor, stainless steel and plastic-laminated wood wall panels, metal panel soffited ceiling with recessed light fixtures	RR	Good	Traditional

Observations/Comments:

- The maintenance staff stated that the elevator equipment is in good condition. The controllers were replaced in 2006. No problems were observed at the time of EMG's site visit. Based on the results of this assessment, no further actions appear to be required at this time. Based on the Estimated Useful Life and the observed conditions, some component repair and/or replacement is anticipated during the reserve term. The cost for this work is included in the 20 Year Reserve Schedule as a Reserve Item.
- Replacement of the floor finish and wall panels in the cabs is recommended. The cost for this work is included in the 20 Year Reserve Schedule as a Reserve Item.
- According to the Point of Contact, the emergency communication equipment in the elevator operates properly. This opinion was not confirmed by our visual observations. Based on the results of this assessment, no further actions appear to be required at this time.

3.6. FIRE PROTECTION AND SECURITY SYSTEMS

Item	Description	Action	Condition	Recommendation
Sprinkler Systems	Wet pipe, automatic sprinkler system with flow switches, pull stations, and alarm horns Wet/Dry standpipes, Siamese connections and hose cabinets Backflow preventer Fire water pump and diesel powered pumping equipment	RM	Fair	Traditional
Other Equipment and Devices	Central alarm panel - 1993, strobe light alarms, illuminated exit signs, battery back-up light fixtures, hard-wired with battery back-up	RR CR	Fair to poor	Traditional
Special Systems	Not applicable	NA	NA	NA
Fire Extinguishers	Located throughout interior spaces Last service date in October 2013	RM	Good	Traditional
Fire Hydrants	Located along parking lot drive aisles	RM	Good	Traditional
Stair Wells	Exposed painted CMU stair well walls Fire-rated doors and door hardware Non-pressurized stairwells with mechanical smoke evaluation system	RM	Good	Traditional

Smoke detectors were not observed in every bedroom, but were in the immediate vicinity of the bedrooms. The smoke detectors are hardwired operated and meet the NFPA 101 requirements.

There is no fuel-fired combustion equipment in dwelling units hence carbon monoxide detectors are not required at this property. No carbon monoxide detector was located in the generator room.

Observations/Comments:

- Information regarding fire department inspections is included in Section 4.2.
- Per the NFPA 101 requirements, smoke detectors are not located at appropriate locations. Smoke detectors are required in every bedroom, in the immediate vicinity of the bedrooms outside of the bedroom, and on all levels of the dwelling unit. Additionally, the smoke detectors must be hard-wired, or the battery operated-type must have 10-year life, be tamper resistant, and are not interchangeable with appliances or toys. As such, smoke detector installation is required in all of the above noted locations. No smoke detectors were observed within the bedrooms. The cost for this work is included in the 20 Year Reserve Schedule as a Rehab Item. There is no Green Alternative for this item.
- Carbon monoxide detectors are required where fuel-fired combustion equipment such as water heaters or furnaces is located. As such, CO detector installation is required in the generator room. The cost for this work is included in the 20 Year Reserve Schedule as a Rehab Item. There is no Green Alternative for this item.
- The fire sprinklers are inspected by a qualified contractor on a routine basis. The fire sprinklers will require routine maintenance during the reserve term. The units had heads at the front entrance to each apartment only.
- The overflow pan at the fire pump was severely corroded requiring replacement. A cost allowance for this work is included in the 20 Year Reserve Schedule as a Rehab Item. There is no Green Alternative for this item.
- The fire extinguishers are serviced annually. The fire extinguishers were serviced and inspected within the last year.
- The pull stations and alarm horns will require routine maintenance during the reserve term.
- Smoke detector replacement is considered to be routine maintenance.
- Exit sign and emergency light replacement is considered to be routine maintenance.
- The central alarm panel is serviced regularly by a qualified fire equipment contractor. Equipment testing is not within the scope of a Physical Condition Assessment. Based on inspection documents displayed by the panel, the central alarm panel has been inspected within the last year. Based on the Estimated Useful Life and the observed conditions, replacement is recommended during the reserve term. The cost for this work is included in the 20 Year Reserve Schedule as a Reserve Item.
- The exit stairwells appear to have been constructed in accordance with applicable codes in force at the time of construction. The stairwells appear to be in general compliance.
- The stairwell doors and door hardware are fire-rated. Components bearing certification labels are displayed on the doors.

3.7. INTERIOR ELEMENTS

3.7.1. Common Areas

3.7.1.1 Interior Finishes

The following table identifies the interior common areas and generally describes the finishes in each common area.

Common Areas	
Renovations/FF&E	The common areas were last renovated approximately ten years ago. The FF&E primarily consists of chairs, desks, tables, customer waiting area furniture, and office equipment

Area	Floor	Walls	Ceilings	Action	Condition	Replacement
Rental Office	Carpet	Painted drywall	Suspended T-bar with tiles	RM	Good to fair	Green
Lobbies	Carpet	Brick blocks and painted drywall	Suspended T-bar with tiles	RR	Good to fair	Green
Elevator lobbies	Polished granite	Painted drywall	Suspended T-bar with tiles	RM	Good to fair	Green
Corridors	Carpet	Painted drywall	Suspended T-bar with tiles	RR	Good to fair	Green
Common Area Restrooms	Ceramic tile	Ceramic tile	Suspended T-bar with tiles	RM	Good	Green
Common Area Kitchen	Vinyl Composite Tile	Ceramic tile wainscot and painted drywall and CMU	Suspended T-bar with tiles	RR	Good	Green
Community Room	Carpet	Painted drywall	Suspended T-bar with tiles	RR	Good to fair	Green
TV Room	Carpet	Painted drywall	Suspended T-bar with tiles	RR	Good to fair	Green
Laundry Room	Vinyl Composite Tile	Painted CMU	Suspended T-bar with tiles	RR	Good	Green
Laundry Equipment	5 Washers, Residential scale, Coin-Op 4 Dryers, Residential scale, electric, Coin-Op			RR	Good to fair	Green

Green Physical Condition Discussions: For all residential or commercial-grade clothes washers, purchase or lease products that are Energy Star–qualified with a modified energy factor (MEF) of at least 1.72 and a maximum water factor of 8.0. For all residential-grade clothes dryers, purchase or lease products that are natural gas–fueled and ventless (require no exhaust). In addition, look for a dryer with a moisture sensor that automatically shuts off when your clothes are dry. This measure reduces energy and water bills.

Consider energy conservation measures, such as scheduling of operation of laundry facilities during non-peak electrical demand periods and using cold water rinse cycles in all new machines. Although warm or hot water is necessary to wash many types of clothing, cold water can be used in the rinse cycle for all applications. Converting laundries to cold rinse cycle can generate significant energy savings by cutting down on hot water use.

Observations/Comments:

- Based on the Estimated Useful Life and the observed conditions, painting of the interior walls is recommended during the reserve term. The cost for this work is included in the 20 Year Reserve Schedule as a Reserve Item.

- Recommended replacement of some of the common area flooring within should use a green natural linoleum product, as this material has an extended useful life and natural anti-microbial properties. Similar green flooring should be installed within the common laundry room. The cost for this work is included in the 20 Year Reserve Schedule as a Reserve Item.
- Based on the Estimated Useful Life and the observed conditions, carpet replacement is recommended during the reserve term. The recommendation is made for future improvements and replacement to use linoleum with no-VOC adhesive; as well as a recycled carpet (e.g. Shaw). The cost for this work is included in the 20 Year Reserve Schedule as a Reserve Item as a Green Significant item.
- The building's laundry room contains washers and dryers owned and maintained by the property. Only one front loading washer has been recently replaced and is Energy Star, the remaining washers and dryers are approximately 15 to 20 years old.
- Due to the estimated Remaining Useful Life (RUL) replacement of the washers and dryers is anticipated during the reserve term. The cost for this work is included in the 20 Year Reserve Schedule as a Reserve Item. The Green Alternative is recommended.
- EMG recommends the common laundry facilities are modified to a cold water rinse cycle in an effort to conserve energy. If the washing machines are owned by the property, conversion of the laundry rinse cycle to cold water can be done by maintenance staff or an outside service person.

3.7.1.2 Building Electrical Service and Lighting

Item	Description	Action	Condition	Recommendation
Service Type	Underground lines to pad-mounted transformers			
Service Sizes	2,000-Amp, 1,000-Amp and 800-Amp, 120/208-Volt, three-phase, four-wire, alternating current (AC)			
Electric Meters and Equipment	Meters and sub-meters in switchgear room; Circuit breaker panels located inside	RM	Good	Traditional
Wiring	Copper wire in metallic conduit	RM	Good	Traditional
Common Area Lighting	Energy Efficient Fluorescent 4 foot linear T-8 fixtures, 28 Watt – fixture not replaced – common area restrooms 4 foot linear T-12 fixtures, 40 Watt – AHU room on east end (1/2); corridor (5'17/2); library (3/4); laundry (3/2); community room (30/2); office (12/4); office restroom (1/2 – 2'); TV room (6/2); mechanical room (6/2); elevator room (2/2); 1 st floor lobby (33/2 - 2' U) 40 Watt Compact Fluorescent bulbs – gazebo (2/2), corridor (5/2); trash room (5/2)	RR	Good to fair	Green
Emergency generator	Natural gas powered 75 kW emergency electrical generator	RR	Fair	Traditional

Observations/Comments:

- The electrical power was reported to be adequate for the building demands. Based on the results of this assessment, no further actions appear to be required at this time.
- The switchgear, circuit breaker panels and electrical meters appeared to be in good condition. Based on the results of this assessment, no further actions appear to be required at this time.

- The emergency generator is reportedly exercised weekly and appeared to be in fair condition. Due to the estimated Remaining Useful Life (RUL) replacement of the generator is anticipated during the reserve term. The cost for this work is included in the 20 Year Reserve Schedule as a Reserve Item.
- It was reported that the main electrical service and some of the higher capacity sub-panel feeders are installed with aluminum wiring. It is recommended that these services be inspected on a bi-annual basis by performing an infrared assessment and performing any necessary repairs such as tightening connections that may have become loose. These assessments and typical repairs are considered to be routine maintenance. No additional action is recommended.
- A payback analysis was completed for replacement of the existing common area fluorescent lighting with Energy Star rated Super T-8 light bulbs and electronic ballasts. The payback period is 5 years and early replacement is recommended. The cost for this work is included in the 20 Year Reserve Schedule as a Reserve Item.

3.7.2. Dwelling Units

3.7.2.1 Cabinetry and Countertops

The kitchen cabinets are constructed of wood. The countertops are wood and have a plastic-laminated finish.

Green Physical Condition Discussions: Cabinet and countertop replacement projects should specify durable, formaldehyde-free materials, which will increase indoor air quality. Cabinets should feature hardwood assemblies and doors, or exterior-grade plywood or formaldehyde-free MDF boxes assembled with adhesives, screws, and bolts. Many composite woods are produced with formaldehyde binders that off-gas after installation. Formaldehyde glues in composite wood products come in two forms: urea and phenol. Urea-formaldehyde binders are more common.

- The kitchen cabinets and countertops are replacements from 2012. Based on their Estimated Useful Life and the observed conditions, replacement of cabinets will not be required during the reserve term. Countertop replacement is anticipated based on their estimated Useful Life. The cost of this work is included in the 20 Year Schedule as a Reserve Item.

3.7.2.2 Appliances

Each apartment unit kitchen typically includes the following appliances:

Appliance	Comment
Refrigerator	Frost-free
Range	Electric
Hood	Not provided
Dishwasher	Not provided
Disposal	Not provided

Green Physical Condition Discussions: Rehabilitation projects should encourage the use of EnergyStar rated refrigerators, dishwashers, and clothes washers as part of any appliance replacement. EnergyStar® appliances save water, energy, and money. EnergyStar is a joint program of the U.S. Environmental Protection Agency (EPA) and the U.S. Department of Energy (DOE). It is a voluntary labeling program that aims to reduce greenhouse gas emissions by helping consumers to purchase the most energy-efficient products available. EnergyStar sets standards for energy efficiency that roughly target the upper 20 percent of current off-the-shelf technologies. Products that meet the energy efficiency requirements are eligible for the EnergyStar label. In addition to saving energy, many qualified products

also save water. The planned rehabilitation project should include replacement of all refrigerators within the dwelling units and community room. In addition, the community room dishwasher should be replaced. The recommendation is made to ensure that EnergyStar compliant refrigerators be installed. Electric ranges are not rated by EnergyStar.

Observations/Comments:

- The kitchen appliances are reportedly three years old. Apartment appliances are reportedly replaced on an "as needed" basis.
- The majority of the refrigerators are Energy Star rated. Based on their estimated Remaining Useful Life (RUL) and their observed condition, the refrigerators will require replacement during the reserve term. The cost for this work is included in the 20 Year Reserve Schedule as a Reserve Item.
- The ranges appear to be well maintained. Based on their estimated Remaining Useful Life (RUL) and their observed condition, the ranges will require replacement during the reserve term. The cost for this work is included in the 20 Year Reserve Schedule as a Reserve Item.

3.7.2.3 Interior Finishes

The following table generally describes the interior finishes in apartment units:

Typical Apartment Finishes			
Room	Floor	Walls	Ceiling
Living room	Carpet	Painted drywall	Painted drywall Suspended acoustic tile on first floor only
Kitchen	Vinyl tile	Painted drywall	Painted drywall Suspended acoustic tile on first floor only
Bedroom	Carpet	Painted drywall	Painted drywall Suspended acoustic tile on first floor only
Bathroom	Ceramic tile	Painted drywall with ceramic tile tub or shower surround	Painted drywall Suspended acoustic tile on first floor only

The interior doors in each apartment unit are painted hollow-core wood doors set in wood frames. Wardrobe closets are accessed by metal, bi-fold doors.

Green Physical Condition Discussions: Flooring products may emit formaldehyde and other VOCs. As part of any flooring replacement, specify flooring products that have been tested and approved for low emissions according to the California "Standard Practice for the Testing of Volatile Organic Emissions from Various Sources Using Small Scale Environmental Chambers," also known as Specification 01350. Any adhesives used in installing flooring materials should be under 50 gm/VOCs). This measure will improve indoor air quality for occupants and reduce environmental damage associated with VOCs. In addition, to improve indoor air quality, alternate flooring materials should be explored (e.g. natural linoleum, bamboo, wool, natural grasses/fibers and ceramic tile). Vinyl flooring is often referred to as "linoleum;" however, does not feature the same physical properties of linoleum. The use of natural linoleum will reduce replacement costs, increase durability, and minimize the impact on the environment. Natural linoleum is made from rapidly renewable materials including linseed oil (from flax), powdered wood and/or cork, ground limestone, resin binders, and dry pigments with a natural jute fiber backing. Where carpet is installed or replaced, specification of low-VOC carpet (Carpet and Rug Institute (CRI)

“Green Label”), and a “green” installation method (e.g. no adhesives for carpet padding or carpet, air changes after installation, etc.) is recommended.

Observations/Comments:

- The residential units are typically renovated upon tenant turnover. The renovation generally consists of floor finish cleaning or replacement, interior painting, general cleaning, and repair or replacement of any damaged items.
- The interior finishes in the apartment units are not original. Based on estimated Remaining Useful Life (RUL), apartment unit painting will be required during the reserve term. The cost for this work is included in the 20 Year Reserve Schedule as a Reserve Item.
- The flooring is being changed from carpet to vinyl tile upon tenant turnover. The ADA units have already been changed. Based on its estimated Remaining Useful Life (RUL), the vinyl flooring will require replacement during the reserve term. The recommendation is made for future improvements and replacement to use linoleum with no-VOC adhesive. The cost for this work is included in the 20 Year Reserve Schedule as a Reserve Item.
- A few of the interior doors and door hardware have been damaged and will require replacement. The cost for this work is relatively insignificant and can be performed through routine maintenance.

3.7.2.4 In-Unit Electrical Service and Lighting

Item	Description	Action	Condition
Apartment Service Size	60-Amps, 120/240-Volt, single-phase, three-wire, alternating current (AC).		
Electric Equipment	Circuit breaker panels at each apartment	RM	Fair
Wiring	Copper wire in non-metallic sheathed cable	RM	Good

Lighting fixtures in the apartments are a mixture of residential-style fixtures. The following table describes the lighting configuration in each apartment unit type.

Apartment Unit Type	Incandescent (40 Watt) Fixtures/Bulbs	Fluorescent (CFL, 15 Watt) Fixtures/Bulbs	Fluorescent (T-12, 40 Watt) Fixtures/Bulbs
1-Bedroom	1 appliance	2/2 entry hall and dining	1/2 - 2' ADA bath 4' - 1/2 kitchen
2-Bedroom	1 appliance; 7 dining/living	2/2 entry hall and dining	4/8
TOTALS	99/116	198/396	113/226

An intercom system located in each unit provides remote access at the front entry.

Ground fault circuit interrupters (GFCI) were observed in the kitchen and bathroom in each unit.

Observations/Comments:

- The electrical service to the tenant units is adequate. The observed wiring was copper.
- The interior light fixtures appeared to be in good condition. Based on the Estimated Useful Life and the observed conditions, replacements are recommended during the reserve term.
- A payback analysis was completed for replacement of the incandescent lighting in the apartment units with Energy Star rated compact fluorescent (CFL) bulbs. The payback period is 3.6 years and early

replacement is recommended. The cost for this work is included in the 20 Year Reserve Schedule as a Reserve Item.

- A payback analysis was completed for replacement of the T-12 linear fluorescent lighting in the apartment units with Energy Star rated T-8 fluorescent bulbs. The payback period is 7.6 years and early replacement is recommended. The cost for this work is included in the 20 Year Reserve Schedule as a Reserve Item.
- The intercom system is still in use by the residents. Equipment testing is beyond the scope of work. Based on the Estimated Useful Life and the observed conditions, replacements are recommended during the reserve term. The cost for this work is included in the 20 Year Reserve Schedule as a Reserve Item.
- The wiring in the building was observed to be copper.

3.8. OTHER STRUCTURES

Item	Description	Action	Condition
Building Name	Stained wood framed gazebo with screened in panels with an asphalt shingle roof finish	RM	Good

Observations/Comments:

- The gazebo was observed to be in good condition requiring routine maintenance.

4. CODE COMPLIANCE AND ACCESSIBILITY

4.1. ENERGY CONSERVATION CODE REVIEW

The Energy Conservation Code applies to new construction and is utilized as minimum requirement standard. The methodology of this report offers assurance that recommended “green” replacements exceed the requirements of the local energy conservation code.

The 2009 version of the New Jersey Energy Conservation Construction Code was formally adopted on September 7, 2010. All projects permitted after this date will require compliance with the code. The ECCC is based upon the 2009 version of the International Energy Conservation Code (IECC). Based upon the current interpretation of the IECC, and the original date of construction of the property built in 1982, regulations regarding energy efficiency cannot be retroactively applied to the property. However, the recommended green replacements within the 12-month repair schedule of this report exceed the performance requirements set by the IECC as outlined in the following table:

Energy Conservation Code (ECC)			
Equipment Type	Subcategory or Rating Condition	Local ECC Minimum Efficiency	EMG Green Replacement Recommendation
Heating	Gas Furnace	90% AFUE	AFUE $\geq$ 95 or EnergyStar Rated
Cooling	Central Air Conditioning	13 SEER	>13 SEER or EnergyStar
Appliances	Appliances	No Standard	EnergyStar Rated
Insulation	Ceiling /Attic	R Value 38	R Value 40 and meet 2009 IECC & Amendments
Insulation	Floor above crawlspace or unfinished basement	R Value 30	R Value 38 and meet 2009 IECC & Amendments
Window	Double Glazed	U Factor 0.35	U factor $\leq$ 0.30 or EnergyStar Rated
Water heater	Natural Gas	In accordance with prevailing federal minimum standards	EnergyStar Rated
Water heater	Electric	In accordance with prevailing federal minimum standards	Energy Factor $\geq$.82 or a thermal efficiency of at least 90%.

4.2. BUILDING, ZONING, AND FIRE CODE COMPLIANCE

According to the New Jersey State Bureau of Housing Inspection, the Bureau does not have an annual inspection program for the Housing Authority. The Housing Authority performs self-inspections. A copy of the original Certificates of Occupancy were requested but were not available.

According to Steve Cavadias at the Dumont Building and Planning Department, the Building Department does not have an annual inspection program. They only inspect new construction, work that requires a building permit, and citizen complaints. A copy of the original Certificates of Occupancy were requested but were not available.

According to the Dumont Fire Prevention Bureau, code compliance information can only be obtained through submission of a written request under the Freedom of Information Act (FOIA). A request was submitted, and a copy of the request is included in Appendix C. Significant information will be forwarded upon receipt.

According to the Flood Insurance Rate Map, published by the Federal Emergency Management Agency (FEMA) and dated September 30, 2005, the property is located in Zone X, defined as an area outside the 500-year flood plain with less than 0.2% annual probability of flooding. Annual Probability of Flooding of Less than one percent.

According to the 1997 Uniform Building Code Seismic Zone Map of the United States, the property is located in Seismic Zone 2A, defined as an area of low to moderate probability of damaging ground motion.

4.3. ACCESSIBILITY

Section 504 of the Rehabilitation Act of 1973 is a Federal accessibility law that was enacted on June 2, 1988. Section 504 applies to multifamily properties that have or are currently receiving funding from a Federal source. In the case of new construction, substantial rehabilitation (15 or more units with the cost of alteration is 75 percent or more of the replacement cost of the completed facility), and Other Alterations (modernizations and alterations to the property), the property must have a minimum of five percent mobility accessible units and two percent of the units for visual / audio hearing impairments. The percentage can be increased by HUD involved at their discretion. In the case of Other Alterations, exceptions can be considered due to undue financial burdens or structural restrictions. However, the exceptions do not relieve the recipients from compliance utilizing other units/buildings or other methods.

Reasonable Accommodations as described in 24 CFR 8.4(b)(i), 8.24 and 8.33 are described as follows: When a family member requires an accessible feature(s) or policy modification to accommodate a disability, property owners must provide such feature(s) or policy modification unless doing so would result in a fundamental alteration in the nature of its program or result in a financial and administrative burden.

The Uniform Federal Accessibility Standard (UFAS) 24 CFR part 40 was adopted by HUD and made effective October 4, 1984. The UFAS applies only to new construction or to alterations to the existing buildings. Alterations are defined as work that costs 50 percent or more of the building's value when the work performed occurs within a twelve month period.

The Fair Housing Amendments Act (FHA) of 1988 amended Title VIII of the Civil Rights Act of 1968 to aid in the prohibitions against discrimination in housing on the basis of disability and familial status. The Fair Housing Act also made it unlawful to design and construct certain "covered multi-family dwellings" for first occupancy after March 13, 1991, in a manner that makes them inaccessible to persons with disabilities. The Fair Housing Act also established design and construction requirements to make such dwellings readily accessible to, and usable by, persons with disabilities.

Covered multi-family structures meeting the FHA criteria, and first occupied on or after March 13, 1991, are required to comply fully with FHA. Existing facilities constructed prior to this date are not addressed by FHA unless the property receives federal subsidies. EMG provides a general assessment of the property's construction as it pertains to FHA. EMG does not assess FHA accessibility as it pertains to discrimination against persons as outlined in the Civil Rights Act.

Fair Housing Act FHA requires that certain "covered multi-family buildings" be accessible. FHA indicates that all ground floor units on a property, be upgradeable to accommodate persons that are mobility impaired. The elements as defined by FHA for accessibility are outlined on EMG's Accessibility Checklist included in the Appendices.

Generally, Title III of the Americans with Disabilities Act (ADA) prohibits discrimination by entities to access and use of "areas of public accommodations" and "commercial facilities" on the basis of disability. Regardless of their age, these areas and facilities must be maintained and operated to comply with the Americans with Disabilities Act Accessibility Guidelines (ADAAG).

Buildings completed and occupied after January 26, 1992 are required to comply fully with ADAAG. Existing facilities constructed prior to this date are held to the lesser standard of complying to the extent allowed by structural feasibility and the financial resources available; otherwise a reasonable accommodation must be made.

During the RPCA, a limited visual observation for accessibility was conducted. The scope of the visual observation was limited to those areas set forth in the EMG Accessibility Checklist provided in Appendix F. It is understood by the Client that the limited observation described herein does not comprise a full Accessibility Compliance Survey, and that such a survey is beyond the scope of EMG's undertaking. Only a representative sample of areas were observed and, other than as shown on the accessibility checklist, actual measurements were not taken to verify compliance.

Based on the date of construction, 1982, the accessibility standards that apply to the Project are 504 and the ADA Guidelines. However, as the property is not new construction, or completing substantial rehabilitation or other rehabilitation, the property is only required to complete reasonable accommodations. Property management stated that Section 504 requests are completed on an individual case-by-case basis. Based on EMG's observations and interview of the Property Manager, the property is generally non-compliant with Section 504. Presently, eleven percent of the units are accessible for individuals with mobility impairments according to property management. There is one unit at present which have visual / audio modifications, thus not meeting the two percent accessible requirements of 504. Additional units should be made accessible for persons with visual or audio impairments during rehabilitation projects.

Based on EMG's observations, the facility did not appear to be accessible with Section 504 and ADA. Elements e observed at the property that were not accessible are as follows:

Parking

- Signage indicating accessible parking spaces for cars and vans was not provided. The signs are mounted too low.

Estimated Cost: 2 @ \$100 each =\$200

Common Area Restrooms

- Wrap drain pipes below lavatory with insulation; protect against contact with hot, sharp or abrasive surfaces. Insulation is loose in men's.

Estimated Cost: 1 @ \$65 each =\$65

4.4. INDOOR AIR QUALITY AND MOLD

EMG performed a limited visual assessment of indoor air quality improvement opportunities in readily accessible interior areas of the property. EMG recommends that property owners and tenants consider implementing the following methods to improve indoor air quality:

- Utilize non-toxic cleaning products can often be made with products you already have in your home, including baking soda, vinegar, and lemon juice
- Designate an outside area, away from doors, windows, and air intakes for your HVAC system for smoking
- Minimize allergy and asthma triggers from pests like cockroaches and mice, keep food tightly sealed, and allow eating only in certain areas. Clean those areas daily.
- When dusting, wipe down surfaces with a damp cloth to keep the dust down. Mop regularly.
- Carpets hold a lot of dust and can also hold moisture. Clean up spills immediately and get the area very dry to reduce the possibility of mold growth.
- If you have hardwood floors or other smooth surfaces underneath the carpet, consider removing carpeting completely.
- Eliminate "dust catchers" from sleeping areas. These include fabric curtains, and stuffed animals.

- Plants can purify some toxins from the air, but also can hold a lot of dust, and if overwatered, mold. Dust your plants regularly and don't overwater. Remove plants from rooms where sensitive individuals spend a lot of time, especially the bedroom.
- Wash bedding at least weekly in hot water to eliminate dust mites. Cold water washes designed to eliminate dust mites can also be found in online stores.
- Check your temperature and humidity levels. High temperatures and humidity levels can lead to mold growth.
- Consider carpeting that comes from sources that are naturally void of VOCs and other toxins. Moving away from petrochemical-based products, even if they are recycled, and are using natural fibers such as wool, jute, sisal, hemp, or coir (from coconut husks) benefit both environmentally-sensitive tenants and the environment.
- Install rubber "walk-off" mats or rugs for inside or outside of apartment unit doorways that can be washed in hot water (to eliminate dust and other particulate).
- Install rubber stair treads on common area stairways that can be easily swept, vacuumed and washed to eliminate dust and other particulate.

EMG performed a limited visual assessment for the presence of mold, conditions conducive to mold, and evidence of moisture in readily accessible interior areas of the property.

Suspect mold growth was observed in the following area:

- 2nd floor corridor supply vent. The area affected by the moisture was approximately one square feet in size.

Observations/Comments:

- EMG recommends installing rubber "walk-off" mats or rugs for inside or outside of apartment unit doorways that can be washed in hot water (to eliminate dust and other particulate). Wash the mats regularly and install a durable mat outside, in front of main building entry doorways.
- Install rubber stair treads on common area stairways that can be easily swept, vacuumed and washed to eliminate dust and other particulate. Wash the mats regularly and install a durable mat outside, in front of main building entry doorways.

4.5. FOLLOW UP RECOMMENDATIONS

EMG recommends pursuing the certification from the soil remediation company that the work is complete and soil contaminants are below action levels.

5. ENVIRONMENTAL CONCERNS

The Environmental Restrictions Checklist was completed by an EMG Registered Architect or Professional Engineer through interviewing a knowledgeable person associated with the Project (e.g., a Project manager, maintenance person or owner who has been involved with the Project for a sufficient period of time so as to be familiar with any environmental issues); followed by a walk-through assessment, providing a cursory observation of representative areas of the Project and surrounding properties viewed from the Project. The information provided by the knowledgeable person associated with the Project is assumed to be complete and correct.

Based solely upon review of the information obtained from the Environmental Restrictions Checklist, the following is a discussion of the positive responses:

Transformers potentially containing PCB's are located on the Project. Based on information provided by the utility company, the transformers may contain PCB's. As such, EMG recommends that an Operations & Maintenance Program be implemented. No costs are included for PSE&G to investigate if the transformer should be replaced.

Contacted Joe Walsh at PSE&G (201.330.6532) and left message regarding whether or not the transformer has been tested for PCB's. Pertinent information will be forwarded upon receipt.

The property maintains two hydraulically-operated elevators that had machinery replacement in 2005.

Based on the date of installation, the elevator systems are not anticipated to contain PCBs.

EMG observed evidence of asbestos in the form of: duct insulation or spray-on fire retardant in the boiler room. This material was observed to be in poor condition. An isolated area was damaged, brittle and exposed. As such, EMG recommends that an Asbestos Survey be conducted. The cost of this work is included as a Critical Repair item.

Based on review of this information, further inquiry is needed to assess the environmental conditions for the purposes of appropriate inquiry.

The electric utility company, PSE&G should be contacted due to the construction of the property in 1981 and before the 1984 cut off of using PCB's in transformers.

RAD Environmental Restrictions Checklist

Project Name and Location (Street, City, County, ST, Zip Code): David F. Roche Apartments 2 Aladdin Avenue Dumont, New Jersey 07628	Owner Name, Address (Street, City, ST, Zip Code), and Phone: Housing Authority of Bergen County One Bergen County Plaza Hackensack, New Jersey 07601 201.336.7600 Mr. George Stavrou	
Project Description: The multifamily property has one, six-story apartment building containing a total of 99 rental apartment units and a single-story gazebo on a site of approximately 2.26 acres. Construction of the property was completed in 1982.		
ENVIRONMENTAL REVIEW FINDINGS	YES	NO
FLOOD PLAIN		
Is the project located in a FEMA Special Flood Hazard Area?		√
Identify Map Panel and Date		
Does the project currently carry Flood Insurance?		√
Do any structures appear to be within or close to the floodplain?		√
HISTORIC PRESERVATION		
Is the property listed on the National Register of Historic Places?		√
Is the property located in a historic district listed on the National Register of Historic Places?		√
Is the property located in a historic district determined to be eligible for the National Register?		√
AIRPORT HAZARDS		
Is the project located in the clear zone of an airport? (24 CFR Part 51 D).		√
HAZARDOUS OPERATIONS		
Is there any evidence or indication of manufacturing operations utilizing or producing hazardous substances (paints, solvents, acids, bases, flammable materials, compressed gases, poisons, or other chemical materials) at or in close proximity to the site?		√
Is there any evidence or indication that past operations located on or in close proximity to the property used hazardous substances or radiological materials that may have been released into the environment?		√
EXPLOSIVE/FLAMMABLE OPERATIONS/STORAGE (24 CFR Part 51C)		
Is there visual evidence or indicators of above ground storage tanks (fuel oil, gasoline, propane etc.) or operations utilizing explosive/flammable material at or in close proximity to the property?		√
FOR YES RESPONSES, SUMMARIZE RESTRICTIONS BELOW:		

ENVIRONMENTAL REVIEW FINDINGS	YES	NO
TOXIC CHEMICALS AND RADIOACTIVE MATERIALS		
Petroleum Storage		
Is there any evidence or indication of the presence of commercial or residential heating activities that suggest that underground storage tanks may be located on the property?		√
If yes, are any such tanks being used? If yes, indicate below whether the tank is registered, when it was last tested for leaks, the results of that test, and whether there are any applicable state or local laws that impose additional requirements beyond those required under federal law.		

ENVIRONMENTAL REVIEW FINDINGS	YES	NO
TOXIC CHEMICALS AND RADIOACTIVE MATERIALS		
Petroleum Storage		
Are there any out-of-service underground fuel storage tanks? If yes, indicate whether the tank was closed out in accordance with applicable state, local and federal laws.		√
Is there any evidence or indication that any above ground storage tanks on the property are leaking?		√
Polychlorinated Biphenyls (PCB)		
Is there any evidence or indication that electrical equipment, such as transformers, capacitors, or hydraulic equipment (found in machinery and elevators, installed prior to July 1, 1984) are present on the site?	√	
If yes, is any such equipment (a) owned by anyone other than a public utility company; and (b) not marked with a "PCB Free" sticker? No sticker		√
If yes, indicate below whether such equipment has been tested for PCBs, the results of those tests, and (if no testing has been performed) the proposed testing approach. (Electrical equipment need not be tested but will be assumed to have PCBs) - unknown		√
If PCBs are found in non-electrical equipment over 50ppm it must be replaced or retrofitted, otherwise any equipment with PCBs or assumed to have PCBs require an O&M Plan.		
Asbestos Containing Materials (ACM)		
Is there any evidence or indication of ACM insulation or fire retardant materials such as boiler or pipe wrap, ceiling spray, etc. within the buildings on the property? If yes, the property is required to have an Operations and Maintenance Plan for asbestos containing materials.	√	
Lead Based Paint		
Are there residential structures on the property that were built prior to 1978?		√
If yes, has the property been certified as lead-free?		
If property has not been certified as lead-free, has a Risk Assessment been completed?		
If yes, has the owner developed a plan including Interim Controls to address the findings of the Risk Assessment including Tenant notifications and an Operations and Maintenance plan?		
If yes, has a qualified Risk Assessor reviewed the Owner's plan and O&M plan for compliance with 24 CFR 35?		
OTHER RESTRICTIONS		
Are there any other restrictions, including easements, on this property that you are aware of (other than those included above) (e.g. pipeline, aviation, microwave, utility, rights of way (ROW), ingress/egress etc.)		√
FOR YES RESPONSES, SUMMARIZE RESTRICTIONS BELOW:		
Transformers potentially containing PCB's are located on the Project. Based on information provided by the utility company, the transformers may contain PCB's. As such, EMG recommends that an Operations & Maintenance Program be implemented. No costs are included for PSE&G to investigate if the transformer should be replaced. Contacted Joe Walsh at PSE&G 201.330.6532 and left message regarding whether the transformer has been tested for PCB's. Pertinent information will be forwarded upon receipt. The utility company should be contacted to verify if the on-site transformer was manufactured after July 2, 1979 and does not contain PCB's The property maintains two hydraulically-operated elevators that had machinery replacement in 2005. Based on the date of installation, the elevator systems are not anticipated to contain PCBs. EMG observed evidence of asbestos in the form of: duct insulation or spray-on fire retardant in the boiler room. This material was observed to be in poor condition. An isolated area was damaged, brittle and exposed. As such, EMG recommends that an Asbestos Survey be conducted.		

6. GREEN BUILDING PRINCIPLES

Green Building or sustainable building is the practice of reducing the impact of buildings on the environment, both during construction and as part of the operation of the building systems. Their use of water, energy, and materials should be reduced through the use of new planning methods and material usage.

EMG's goal was to identify all opportunities to: 1) improve energy efficiency, 2) minimize water use, 3) use recycled or recyclable materials, 4) protect the indoor air quality, 5) reduce the 'carbon footprint' of the buildings and site, and 6) proper disposal of replaced materials.

The available Green Building Alternatives have been evaluated and are described in terms of cost and specification in the Mark to Market Underwriting tool. Where available, the Green Alternatives evaluated exceed the requirements of the current local energy conservation code. We compare the cost of traditional replacements and compare them to "green" replacements. The anticipated benefits of green approaches are discussed along with increased short term costs for the long term benefits of choosing "Green" or sustainable alternatives.

PART II - ENERGY AUDIT

1. EXECUTIVE SUMMARY

The Client contracted with EMG to conduct a Green Physical Condition Assessment (RPCA) and a Limited Environmental Screening consisting of field observations, document review and related due diligence tasks of the subject property, David F. Roche Apartments located at 2 Aladdin Avenue in Dumont, Bergen County, New Jersey 07628. The PCA was performed on March 4, 2014.

The multifamily property has one, six-story apartment building containing a total of 99 rental apartment units and a single-story gazebo on a site of approximately 2.26 acres. Construction of the property was completed in 1982.

On-site amenities consist of a rental office, community room, library, TV room and laundry facilities.

Many of the items covered in the RPCA also provide useful information to the energy audit. In lieu of redundant reporting on these items, the following table provides report references to relevant items in the RPCA:

Component	PCA Report Reference Section	Comments
Insulation (Wall, Attic, and Basement)	4.1	New construction code requirements outlined in Section 4.1. Upgrade to R-30
Exterior Doors	3.3.3	Energy Star replacements recommended at end of EUL.
Storm Doors	Not applicable	The property does not have storm doors.
Dishwashers	Not applicable	The property does not have dishwashers other than one in the superintendent's office
Windows	3.3.3	Existing windows are double paned. Energy Star replacements recommended at end of EUL.
Sliding Glass Doors	Not applicable	The property does not have sliding glass doors.
Thermostats	3.4.2.1, 3.4.2.2	Setback thermostats are recommended. Energy Star replacements recommended at end of EUL.
Domestic Water Heaters	Not applicable	Domestic water is provided by high efficiency boilers
Refrigerators	3.7.2.2	Already provided.
Water (Flow, Temperature)	3.4.1.2	Water testing outlined in section 3.4.1.2.
Ventilation	3.4.2.2	Replacement with Energy Star equipment recommended. See Green Comparison table.
Interior Lighting	3.7.2.4	CFL retrofit is recommended.
Common Areas	3.7.1.2	T-8 ballasts/bulbs recommended, Occupancy sensors recommended.
Exterior Lighting	3.2.6	Replace HPS wall packs and pole lights with LED wall packs.
Furnaces	Not applicable	Property does not have furnaces.
Boilers (natural gas)	3.4.2.1, 3.4.2.2	High efficiency models in place. See Green Comparison table.
Heat Pump	Not applicable	Property does not have heat pumps.
PTAC	Not applicable	Property does not have PTAC units.

Component	PCA Report Reference Section	Comments
AC (thru-the-wall)	3.4.2.1, 3.4.2.2	Replacement with high efficiency models recommended. See Green Comparison table.
Laundry Area	3.7.1	Energy Star washers with cold rinse restriction recommended.
Other Commercial Space	Not applicable	Property does not have commercial spaces.
HVAC system conversion	3.4.2	System conversion not recommended.
Utility Rate Options	1.1 (Energy Audit)	Current utility rates were reviewed and appear acceptable. The existing utility rates are similar to typical rates observed at similar properties.

2. UTILITIES & BENCHMARKING

2.1. UTILITY METERING

On-Site Utilities

The following is a summary of relevant information, addressed within the Utilities Data Sheet. See Section 3.2.7 for a listing of Utility Service providers.

Question	Answer
Water	
Identify the provider of water to the property.	Township of Dumont Water Department
Is gray water or well water is used for some purposes	No
How is the water usage measured	Three meters for the entire building.
Is the water paid by the residents via a separate meter?	No
Are there separate meters at the unit level	No
Is there a single water intake for each unit with unit specific water heaters	No
Where are the water meters physically located?	Pit
What is the number of water meters	Residential: 0 Common: 0 Master Meters: 1 Commercial: NA
Electric	
Are there any site generating activities to supplement (wind, solar)	No
What is the meter configuration? (How many covering what usage	One sub-meter per apartment unit Master meter for the entire building
Is the electricity paid by the residents via a separate meter?	Yes
Where are the electric meters physically located?	Generator/switchgear room
Are property and residential unit use separately metered?	Yes
Are there unit level electric meters or unit level breaker boxes?	Yes
What is the number of electrical meters	Residential: 99 Common: 1 Mixed Residential & Common: 1 Commercial: NA
Heating Fuel	
How is the property heated?	Boilers
What is the heat source	Natural gas
Are there individual heating units for each unit?	No - radiators
Are there individual meters for the heating fuel?	No
Are there separate heat sources for common areas/commercial areas?	No

Question	Answer
Heating Fuel	
Are all units/areas heated the same way?	Yes
Heating Fuel	
Is the heating fuel included in a utility paid by the tenant via a separate meter	No
For natural gas heat source, what is the number of heating fuel meters?	Residential: 0 Common: 0 Mixed Residential & Common: 1 Commercial: NA
Additional Utility Use Questions	
Are stoves electric or gas?	Electric
Are water heaters electric or gas?	NA
Are there individual unit water heaters?	No
Are there different utility uses by building (rental or office/community use) due to renovations or scattered sites?	No

2.2. UTILITY RATES

Based upon the utility information provided about the David F. Roche Apartments, the following energy rates were utilized in determining existing and proposed energy costs.

Electricity (Blended Rate)	Natural Gas	Water / Sewer
\$0.09/kWh	\$0.27/therm	\$6.51/kGal

The data analyzed provides the following information: breakdown of utilities by consumption, cost and annual profile, baseline consumption in terms of energy/utility at the facility, the Energy Use Index, or Btu/sq ft, and cost/sq ft. For multiple water meters, the utility data was combined to illustrate annual consumption for each utility type.

2.3. ELECTRICITY


The electricity requirements of the facility are satisfied by **PSE&G**.

Based on the electric usage & cost information provided, the average price paid during the past 12 months was \$0.09 per kWh. The total annual electricity consumption for the 12-month period analyzed is 691,251 kWh for a total cost of \$61,261.


The following table details in monthly electricity consumption and cost for the property:

Billing Month	Consumption (kWh)	Unit Cost	Total Cost
January	57,818	\$0.08	\$4,667.59
February	52,287	\$0.07	\$3,893.49
March	47,210	\$0.08	\$3,825.66
April	51,050	\$0.08	\$4,048.11
May	44,783	\$0.08	\$3,655.22
June	55,768	\$0.10	\$5,768.17
July	79,174	\$0.10	\$8,117.34
August	78,662	\$0.11	\$8,381.38
September	65,089	\$0.09	\$6,161.33
October	62,271	\$0.08	\$4,698.29
November	45,169	\$0.08	\$3,713.43
December	51,970	\$0.08	\$4,331.28
Total/Average	691,251	\$0.09	\$61,261.29

Electricity Consumption (kWh)

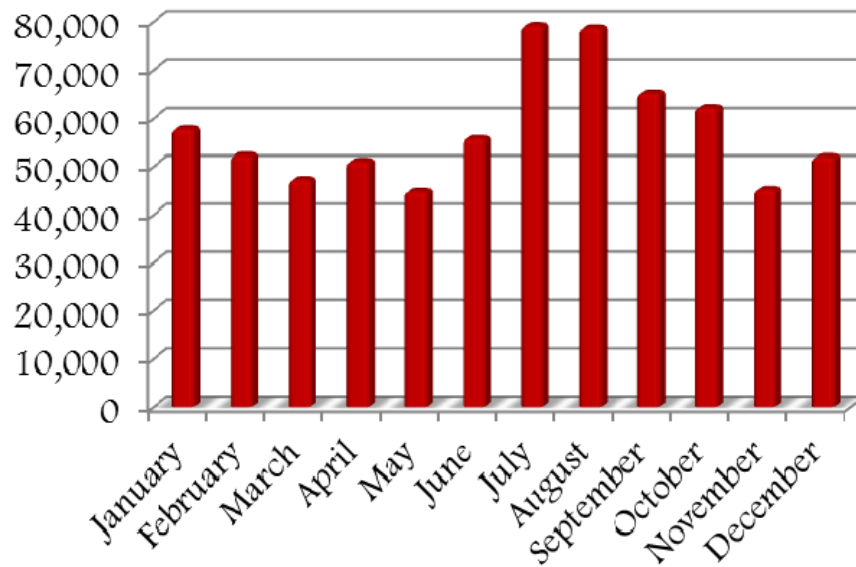

Electricity Cost (\$)

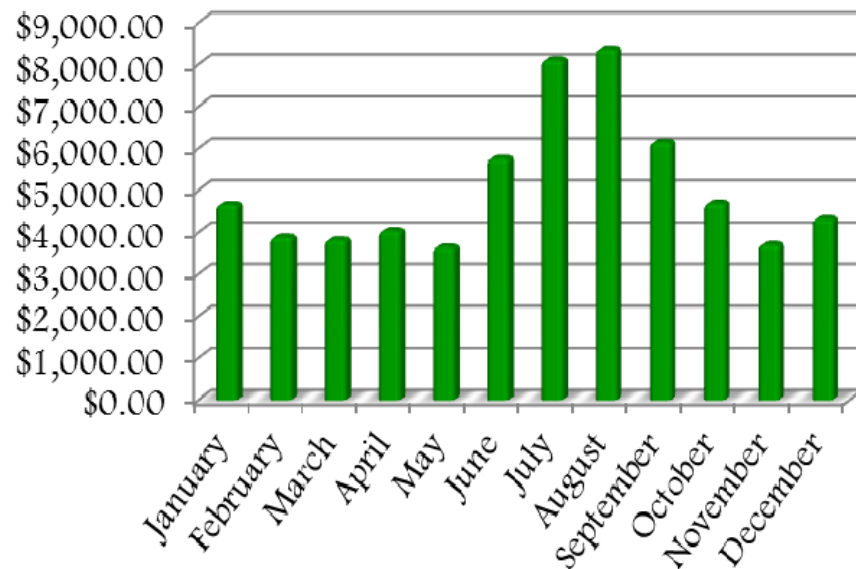

2.4. NATURAL GAS


The natural gas requirements of the facility are satisfied by PSE&G.

Based on the provided natural gas usage & cost data, the average price paid during the past 12 months was \$0.26 per therm. The total annual natural gas consumption for the 12-month period analyzed is 50,315 therms for a total cost of \$13,768.31.


The following table details in monthly natural gas consumption and cost for the property:

Month	Consumption (therms)	Unit Cost	Total Cost
January	8,203	\$0.33	\$2,712.56
February	8,268	\$0.33	\$2,689.86
March	7,441	\$0.24	\$1,763.12
April	6,558	\$0.13	\$836.37
May	3,335	\$0.15	\$493.19
June	2,071	\$0.17	\$359.95
July	1,281	\$0.22	\$278.63
August	870	\$0.26	\$229.19
September	1,069	\$0.24	\$255.38
October	2,312	\$0.17	\$388.96
November	3,060	\$0.52	\$1,594.14
December	5,846	\$0.37	\$2,166.96
Total	50,315	\$0.27	\$13,768.31

Natural Gas Consumption (therms)

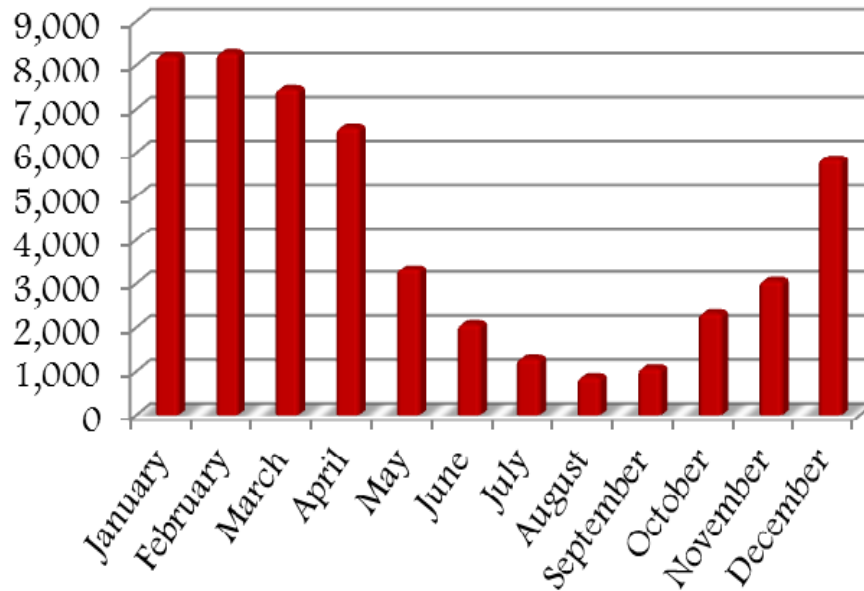

Natural Gas Cost (\$)

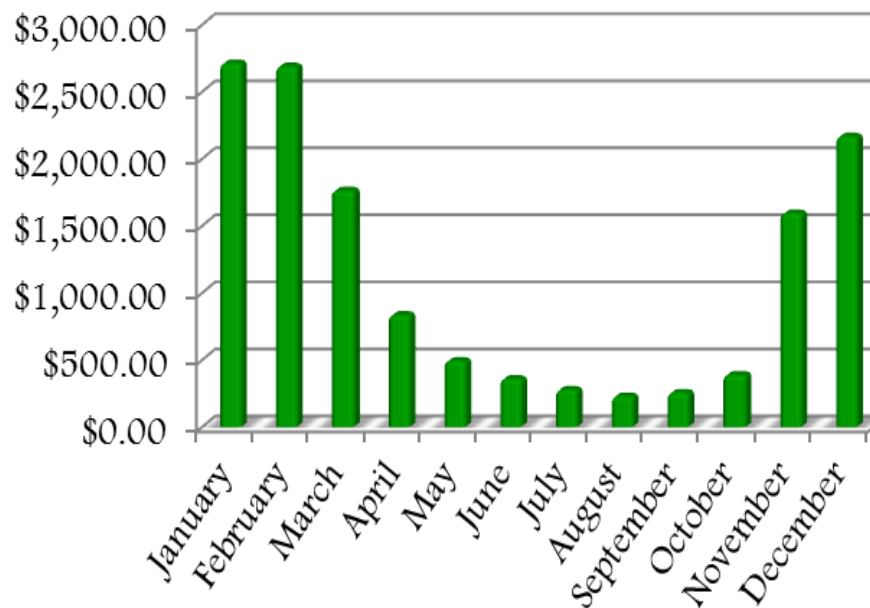


2.5. DOMESTIC WATER

The domestic water requirements of the facility are satisfied by Township of Dumont Water Department. Based on the provided domestic water usage & cost data, the average price paid during the past 12 months was \$6.57 per thousand gallons. Domestic water is billed on a monthly basis. The total annual domestic water consumption for the 12-month period analyzed is 3,997 thousand gallons (kGallons) for a total cost of \$26,016.09.


The following table details in monthly water consumption and cost for the property:

Month	Consumption (kGallons)	Unit Cost	Total Cost
January	251	\$7.13	1,793
February	333	\$6.51	2,168
March	320	\$6.49	2,078
April	318	\$6.50	2,066
May	310	\$6.53	2,026
June	254	\$6.80	1,724
July	391	\$6.29	2,460
August	378	\$6.33	2,398
September	547	\$6.02	3,291
October	322	\$6.52	2,096
November	269	\$6.84	1,836
December	304	\$6.85	2,081
Total	3,997	\$6.51	\$26,016.09

Domestic Water Usage (kGal)

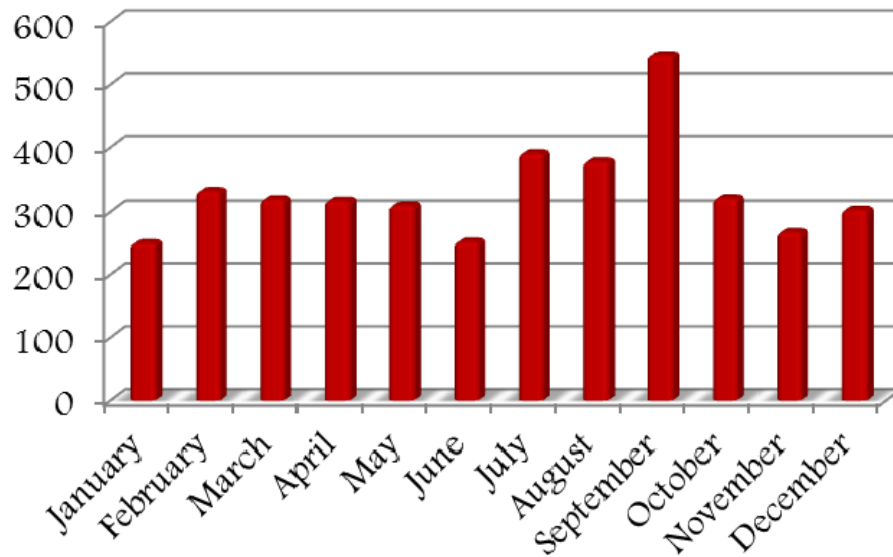

Water/Sewer Cost (\$)

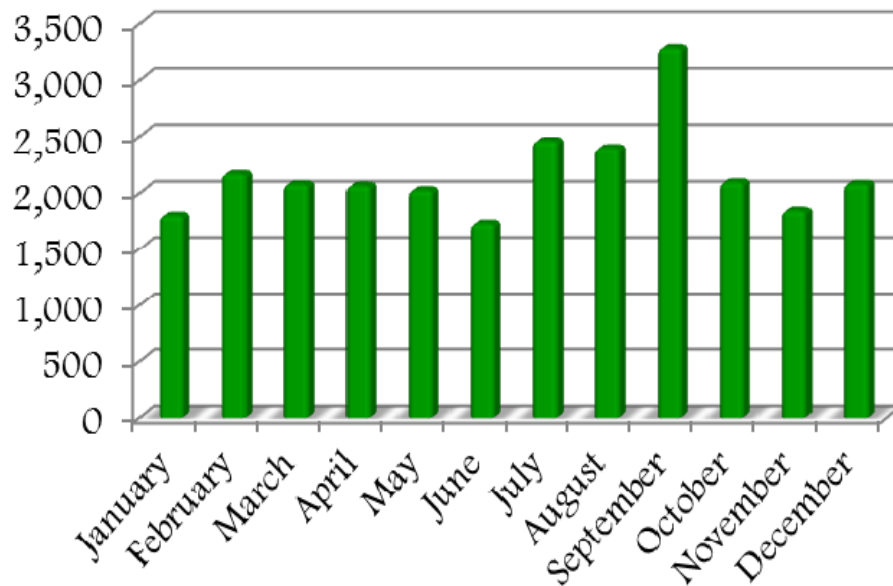

2.6. BENCHMARKING

The following table lists the building's area and its total energy and cost indices. The total energy index is a measure of energy intensity, or annual energy usage per square foot of building area. Similarly, the energy cost index is a measure of annual energy costs per square foot of building area. This data is primarily used to measure a facility's energy intensity against that of other similar buildings. EMG researched data from the Energy Information Administration and reviewed the Energy Star Portfolio Manager Tool and found inapplicable information on subsidized rental housing. Based on EMG's experience and data from the Handbook of Energy audits, 7th edition by Albert Thumann, P.E., and C.E.M. and William J. Younger, C.E.M. published by the Association of Energy Engineers, the mix of similar housing units typically have an energy intensity of between 60 and 200 KBtu/SF/yr. David F. Roche Apartments is at this range.

Heated Area (SF)	Total Annual Cost Of Energy (\$)	Energy Cost Intensity \$/SF-Year	Total Energy Intensity (KBTU/SF-YR)
84,786	\$61,261	\$0.72	87.2

Although regression model-based benchmarking is not a perfect science, it serves as a good initial indication of whether a particular building or project currently uses more or less water than would normally be expected for that size and type of building in that climate.

The results from the utility analysis and the HUD Water Benchmarking Tool indicate that the subject property is at the average benchmark for water consumption performance with 51 out of 100 as scored against peers.

HUD Residential Water Use Benchmarking Tool

For single-family, semi-detached, row/townhouse, multi-family walk-up and elevator buildings.

The HUD Residential Water Use Benchmarking Tool quantifies the performance of a user-defined building relative to the family of HUD residential buildings. A score of 75 denotes performance at the top 25th percentile of HUD residential buildings. A score of 50 denotes performance at the 50th percentile (in the middle) of HUD residential buildings. For definitions or help on the terms below, simply click on any underlined text. Click on "Return" text to come back to this page.

Directions: Provide entries in the gray spaces below with your building description and annual water consumption.

Building Description

ORNL 8/22/2007

Building Name: David F. Roche Apartments (optional entry)

5-digit Zip Code: 07628

[Not Sure?](#)

Mapping Location: Hackensack, NJ

<u>Gross Floor Area of Building(s) (ft2)</u>	<u>Building(s) is Single-Family Detached or Semi-Detached? (Y/N)</u>	<u>Is Residents Water Use Paid Directly by the PHA? (Y/N)</u>	<u>Number of Units in Building(s)</u>	<u>Number of Units in Building(s) with In-Unit Laundry Hookups or Central Laundry Access?</u>	<u>How Many Buildings share this Water Meter?</u>
84,786	N	Y	99	99	1

Annual Consumption

Building Annual Water Use: 3,997,000 (gallons/year)

Building Annual Water Use Cost: 26,016 (\$/year)

Average Annual Water Cost: \$0.7 (\$/100 gallons)

Results

	Your Building	HUD Typical
<u>Score Against Peers</u>	51	50
Annual Water Use (gal/year)	3,997,000	4,092,238
Annual Water Use Intensity (gal/ft2-year)	47.1	48.3
Annual Water Cost Intensity (\$/ft2-year)	0.31	0.31
Total Annual Water Cost (\$/year)	26,016	26,636

The results from the utility analysis and the HUD Energy Benchmarking Tool indicate that the subject property is slightly below average for energy consumption performance with 32 out of 100 as scored against peers.

HUD Residential Energy Use Benchmarking Tool

For single-family, semi-detached, row/townhouse, multi-family walk-up, and elevator buildings.

The HUD Residential Energy Use Benchmarking Tool quantifies the performance of a user-defined building relative to the family of HUD residential buildings. A score of 75 denotes performance at the top 25th percentile of HUD residential buildings. A score of 50 denotes performance at the 50th percentile (in the middle) of HUD residential buildings. For definitions or help on the terms below, simply click on any underlined text. Click on "Return" to come back to this page.

Directions: Provide entries in ALL the grey spaces that apply for your **Building Description** and **Annual Energy Consumption**.

Building Description

Preliminary: 9/17/07

Building Name: (optional entry)

5-digit Zip Code:

Heating Degree Days:

Mapping Location: Hackensack, NJ

Cooling Degree Days:

	<u>Gross Floor Area (ft²)</u>	<u>Total Number of Units</u>	<u>Is This a Multifamily Building with Central Laundry? (Y/N)</u>	<u>Is this a Multi-Family Walkup Building? (Y/N)</u>	<u>Heated Floor Area (ft²)</u>	<u>Year Built</u>
Building Description:	84,786	99	Y	N	84,786	1982

Annual Consumption

	<u>Electricity</u>	<u>Gas</u>	<u>#2 Fuel Oil</u>	<u>#4 Fuel Oil</u>	<u>District Steam</u>	<u>District Hot Water</u>	<u>Propane</u>
Select Units:	kWh	Therms	Gal	Gal	kLbs	MMBtu	Gal
Energy	691,251	50,315					
Cost (\$)	61,261	13,768					
Calculated unit cost:	\$0.09 \$/kWh	\$0.27 \$/therm	\$/gallon	\$/gallon	\$/kLbs	\$/kBtu	\$/gallon

Results

	Your Building	HUD Typical
Score Against Peers	32	50
Building Site Energy Use (kBtu/year)	7,390,048	5,949,728
Site Energy Use Intensity (kBtu/ft ² -year)	87.2	70.2
Energy Cost Intensity (\$/ft ² -year)	0.88	0.71
Total Annual Energy Cost (\$/year)	75,030	60,406

3. LOAD SIZING

3.1. HVAC SIZING RESULTS

The majority of the ducting system for the forced air HVAC system is concealed by finished walls and ceilings. EMG was able to observe a limited amount of ducting in close proximity to the air handling unit. Based on the limited observations of the type and level of duct work installation materials and methods EMG suspects more than 6 percent leakage loss during heating and cooling seasons.

The following is the efficiency information on the existing heating system:

Location Served	Description	Estimated Efficiency
Community room	Trane AHU – TVDB06AGOCBDRRG2	10 EER
Corridors	Trane AHU – MCCA008GAMOABA...	9 EER
Entire Building (Central System)	Four boilers @ 550 MBH each	94%

The following is the efficiency information on the existing cooling system:

Location Served	Description	Estimated SEER Rating
East end common areas	Condensing unit - Trane TTA090A300CB	9 EER
Central/rear building common areas	Condensing unit - American Standard/Trane TTA090A300CB	9 EER
Lobby	Condensing unit - Trane 2TTA0072A3000AA	11 EER
Apartments, laundry, community room, offices, community room kitchen	Through-the-wall AC - Electrolux FRA106HT1	9.4 EER Approximately 13 SEER

Manual J calculations estimate the building heat gain or loss based on the construction materials, level of insulation, door and window types and building orientation. The existing system appears to be appropriately sized based on the Manual J calculations. Future replacements should have an output rating that matches the current ratings.

Unit Type	Calculated Cooling Load	Calculated Heating Load
1 bedroom	1.3 tons	22,886 Btu/hr
2 Bedroom	1.5 tons	29,084 Btu/hr

3.2. DOMESTIC WATER HEATER SIZING RESULTS

A sizing analysis was not completed for the existing domestic water heating system; domestic water is served by high efficiency boilers and stored in water storage tanks.

Equipment	Input Capacity	Storage Capacity
Sizing Calculations	550 MBH each	(2) 200 gallon
Existing Domestic Water Heating System	Boilers - 2	Storage tanks

4. GREEN ENERGY TECHNOLOGY

4.1. SOLAR ENERGY FEASIBILITY

A photovoltaic array is a linked collection of photovoltaic modules, which are in turn made of multiple interconnected solar cells. The cells convert solar energy into direct current electricity via the photovoltaic effect. The power that one module can produce is seldom enough to meet requirements of a home or a business, so the modules are linked together to form an array. Most PV arrays use an inverter to convert the DC power produced by the modules into alternating current that can plug into the existing infrastructure to power lights, motors, and other loads. The modules in a PV array are usually first connected in series to obtain the desired voltage; the individual strings are then connected in parallel to allow the system to produce more current. Solar arrays are typically measured by the peak electrical power they produce, in watts, kilowatts, or even megawatts.

When determining if a site is suitable for a solar application, two basic considerations must be evaluated:

- At minimum, the sun should shine upon the solar collectors from 9 AM to 3 PM. If less, the application may still be worthwhile, but the benefit will be less.
- The array should face south and be free of any shading from buildings, trees, rooftop equipment, etc. If the array is not facing directly south, there will be a penalty in transfer efficiency, reducing the overall efficiency of the system.

Solar Arrays can be mounted on the ground and used as fencing, etc. or on the roof of a building. If the solar system is to be roof-mounted, a rough rule of thumb is that 200 to 400 square feet of roof space is needed for a 2 kilowatt (kW) installation. On flat surfaces (roofs or ground), tilted panel mounting can orient the PV panels to maximize energy generation and ensure visibility of the panels. The angle of the tilt is generally equal to the latitude of the location. Solar systems produce energy for as low 1.5-2¢ per kilowatt hour or \$4-6 per million BTU delivered. Most electric utility customers spend about 7-15¢ per kilowatt hour (\$20-44 per million BTU). Solar electricity costs about \$10 to \$12 a watt installed. Each standard solar panel is typically 4' by 8' and has a power generation capability between 185 watts/8 SF and 225 watts/8 SF. Typically, 200 watts/8 SF or 25 watts / SF are a good estimate to use.

Element	Response
Does the property have a south facing roof or available land of more than 250 square feet per required Solar Array Panel?	Yes
Is the area free from any shading such as trees, buildings, equipment etc throughout the whole day?	Yes
Is the property in an area with acceptable average monthly sunlight levels? http://www.verdeenergy.com/InsolationMap.pdf	Yes
Has the roofing been replaced within the past 3-5 years?	No
Is the roof structure sufficient to hold solar panels?	Yes
Is the property located in a state eligible for net metering? http://www.dsireusa.org/userfiles/image/summarymaps/netmeteringmap.gif	Yes

Solar collectors gather the sun's energy, transform its radiation into heat, and then transfer that heat to water, solar fluid, or air. The solar thermal energy can be used in solar water-heating systems, solar pool heaters, and solar space-heating systems.

Most solar water-heating systems for buildings have two main parts: a solar collector and a storage tank. There are four main types of solar collectors, integral collector-storage collector, evacuated-tube collector, and most common collector is called a flat-plate collector. The flat-plate collector is mounted on the roof and it consists of a thin, flat, rectangular box with a transparent cover that faces the sun. Small tubes run through the box and carry either water or other freeze resistant fluid, such as an antifreeze solution, to be heated. The tubes are attached to an absorber plate, which is painted black to absorb the heat. As heat builds up in the collector, it heats the fluid passing through the tubes. The heated glycol circulates through seamless copper coils to a separate storage hot water tank. Water in the tank passes over the coils and is heated to be used for residential and commercial domestic hot water or potential space heating use through a custom design HVAC system.

Solar Hot Water Questionnaire	Response
Does the property have a south, east, or west facing roof or available land of more than 100 square feet per required Solar Collector Panel?	Yes
Is the area free from any shading such as trees, buildings, equipment etc throughout the whole day?	Yes
Can the collectors be mounted at an incline of roughly 25-45 degrees? (equal to latitude of property)	Yes
Is the property in an area with acceptable average monthly sunlight levels?	Yes
Has the roofing been replaced within the past 3-5 years?	No
Is the roof structure sufficient to hold solar thermal collectors?	Yes & verify with contractor
Does the property have a central domestic hot water system?	Yes
Is there potential for solar pool heating?	Not Applicable
Is sufficient mechanical room space available to fit additional solar hot water storage tanks?	No

The annual performance of a solar water heating system with a storage tank is dependent on system characteristics, solar radiation available, ambient air temperature and on heating load characteristics which require further in depth analysis.

4.2. WIND ENERGY FEASIBILITY

Wind energy (or wind power) refers to the process by which wind turbines convert the movement of wind into electricity. Winds are caused by the uneven heating of the atmosphere by the sun, the irregularities of the earth's surface, and rotation of the earth. Humans use this wind flow for many purposes: sailing boats, pumping water, and also generating electricity. Wind turbines convert the kinetic energy of the moving wind into electricity. A small wind energy system can provide a practical and economical source of electricity if all the following apply to the project:

Element	Response
Property has a good wind resource? <i>Based on a review of the windpower resource map at http://www.windpoweringamerica.gov/wind_maps.asp</i>	No
Project is located on at least one acre of land in a rural area?	No
Increased noise levels from the turbines is not a factor for the site and neighboring sites?	No
Project site has large amounts of undeveloped land that can be utilized for wind energy towers?	No

4.3. COMBINED HEAT AND POWER (CHP) FEASIBILITY

The average efficiency of the fossil-fueled power plants in the U.S. is 33% and has remained virtually unchanged for 40 years. This means that two-thirds of the energy in the fuel is lost as heat, and 8% of the remainder is lost in transmission and distribution over wires. Combined Heat and Power (CHP)--also known as "cogeneration"—is the sequential production of two or more useful forms of energy from a single fuel consuming device. CHP systems recycle waste heat and convert it to useful energy, and they can achieve overall efficiencies of over 80%.

CHP can significantly reduce a multi-family building's annual energy costs. Instead of buying all the building's electricity from a utility and separately purchasing fuel for its heating (mechanical) equipment, most--or even all--of the electricity and heat can be produced for less money by a small on-site power plant operating at a higher combined efficiency. The best economic prospects for CHP are single buildings with at least 100 units, master metered for utilities, with access to natural gas. The type of CHP system commonly applied to multi-family housing uses a "prime mover," that is, a reciprocating engine similar to that found in a car or truck, or a microturbine, that drives a generator to produce electricity. The heat (thermal energy) produced by this process is recovered and used to produce hot water or steam, operate a chiller or serve as a desiccant, instead of being exhausted from the engine and transferred through the engine radiator. CHP systems also often lead to increased ability to handle electric loads during power outages.

The following is a preliminary analysis to explore if CHP is an option that should be further investigated for the project. If three are answered "yes," the next step in assessing the potential of an investment in CHP is to perform a Level 1 Feasibility analysis to estimate the preliminary return on investment. The EPA CHP Partnership offers comprehensive Level 1 analysis services for qualifying projects and can provide contact information to others who perform these types of analyses.

Element	Response
Project pays more than \$.07/ kWh on average for electricity (including generation, transmission and distribution)?	Yes
Is there concern about the impact of current or future energy costs on the property?	No
Is your building located in a deregulated electricity market?	Yes
Are there concerns about power reliability? Is there a substantial financial impact to your building or residents if the power goes out for 1 hour? For 5 minutes?	No
Does the project have thermal loads throughout the year (including hot water, chilled water, hot air, steam, etc.)?	Yes
Does the building have an existing central plant?	Yes
Is there a plan to replace, upgrade or retrofit central plant equipment within the next 3-5 years?	No
Is there a plan for a significant building expansion or new construction project within the next 3-5 years?	No
Has the project already implemented energy efficiency measures and still have high energy costs?	No

4.4. GEOTHERMAL ENERGY FEASIBILITY

Geothermal systems utilize the relatively constant temperature of the earth as a heat synch to reject or absorb heat for a heating or cooling system. The predominant use of energy in such a system is the pumping energy used to circulate the fluid medium. Geothermal system configurations require wells to be bored into the ground to accommodate a pipe loop. A geotechnical survey of the property is required in order to estimate the cost of a geothermal installation. Generally multiple wells are required for multi-family applications and the costs become prohibitive if the electricity rate is reasonable.

4.5. FUEL CELL TECHNOLOGY

Fuel cell technology is in the early stages of development and to date is only being utilized in large commercial and industrial applications. EMG does not recommend the further exploration of fuel cell technology for the subject property based on high development cost, lack of technology for small scale applications and potential safety concerns in residential applications.

4.6. GREEN ENERGY TECHNOLOGY RECOMMENDATIONS

Observations/Comments:

- Since there was a positive response to three or more of the preliminary Solar Energy analysis questions. EMG recommends assessing the potential of an investment in Solar Energy to estimate the preliminary return on investment. EMG recommends contacting an installing contractor to determine feasibility and cost.
- Since there was a negative response to preliminary Wind Energy analysis questions EMG concludes that further investigation of feasibility is not warranted at the subject property.
- Since there was a mostly negative response to the preliminary CHP analysis questions. EMG does not recommend assessing the potential of an investment in CHP.
- Geothermal systems are not recommended for further study at this property. The cost of obtaining a geotechnical survey of the property and drilling the multiple wells required is likely prohibitive considering the reasonable electricity rate in the area.
- Since fuel cell technology is primarily used on large commercial and industrial applications, EMG concludes that further investigation of feasibility is not warranted at the subject property. No further action is needed at this time.

5. ENERGY CONSERVATION MEASURES

5.1. ENERGY CONSERVATION RECOMMENDATIONS

EMG has identified Energy Conservation Measures (ECM) for this property. The basis for an ECM recommendation is a payback of less than the remaining useful life of the system or component. Recommended energy efficiency improvements and the installed cost estimates for recommended energy efficiency measures are provided in the following table:

Priority	Brief description of ECM	Initial Investment	Annual Savings	Differential Payback Period (yrs)	Component EUL (yrs)
2	Replace Older Refrigerators with Energy Star Rated Refrigerators	\$4,350	\$78	4.5	15
3	Replace Incandescent Lighting with Energy Star Light Fixtures in Apartments	\$6,435	\$320	6.2	15
3	Replace Fluorescent Fixtures in Apartments with T-8 Bulbs & Electronic Ballasts	\$15,444	\$307	7.6	15
3	Replace Fluorescent Fixtures in Common Areas with T-8 Bulbs & Electronic Ballasts	\$14,196	\$848	7.6	15
2	Replace Site Light Fixtures with LED Fixtures	\$10,450	\$650	3.6	20
3	Replace Wall Pack Light Fixtures with LED Fixtures	\$6,600	\$342	6.6	20
3	Replace Older Plumbing Fixtures with Low Flow Devices	\$39,501	\$5,451	7.2	20

5.2. ENERGY CONSERVATION DESCRIPTIONS

The following descriptions provide a summary of each energy savings recommendation, along with specific implementation considerations for High Point Apartments. These energy conservation measures are recommended for implementation as part of the Green Rehabilitation Significant Additions.

This ECM recommends replacement of the windows at the property. Replacements should include replacement or repair of any window sills to slope away from the building. Refer to the ECM Worksheet in Appendix D for energy savings calculations.

ECM: Replace Incandescent Lighting with Compact Fluorescent Lamps in Dwelling Units

Standard incandescent light bulbs, typically used in public housing dwelling units, use three to four times more electricity than fluorescent lamps. Replacing incandescent bulbs with fluorescent lamps will save as much as 75 percent of the electricity costs per lamp. In addition, because fluorescent lamps last longer than incandescent bulbs, the PHA saves on replacement and maintenance costs. The most appropriate type of fluorescent lighting for dwelling units is a compact fluorescent lamp (CFL). Advances in technology over the past few years have brought great improvements to CFLs in terms of light quality and appearance, and CFLs now come in a variety of shapes and sizes.

Although the initial cost of CFLs is high relative to incandescent lamps, the energy savings and reduced time and expense from lamp replacement make CFLs a cost effective energy conservation measure for many applications. Because the energy savings from a CFL depends on the number of hours the lamp is on, CFLs should be installed in areas with the heaviest use, such as the kitchen, bathroom, and hallways. There is a fair amount of variation in the light output (lumens) per watt of CFLs. To save on energy costs first choose the bulb with the light output you need, then choose the one with the lowest watts. The **ENERGY STAR lumen chart** will help you determine the lumens you need.

This ECM recommends replacing all T12 fixtures with T8 fixtures at the property. Replacements should include replacement of the fixture ballast and not only the bulb. Refer to the ECM Worksheet in Appendix C for energy savings calculations.

ECM: Replace Standard Fluorescent Lamps with Energy-Saving Lamps in Common Areas, and Install Electronic Ballasts in Common Areas

Developments that have relatively old fluorescent lighting in common areas can realize modest energy savings by simply replacing the existing fluorescent lamps (tubes) with energy saving lamps which use 10 to 20 percent less electricity. Energy-savings lamps are T12 size (1.5 inches in diameter) and are designed to replace older lamps of the same size. Additionally, a very common and effective lighting improvement is to replace old fluorescent lamps and ballasts with new T8 (1 inch in diameter) lamps and electronic ballasts. "ballast" is a device that all fluorescent lights require in order to turn on and give off light. The ballast controls the light output as well as the energy use. By replacing magnetic ballasts and existing fluorescent lamps with electronic ballasts and new fluorescent lamps, significant savings can be achieved.

This ECM recommends adding occupancy sensors at the property in the common areas. Refer to the ECM Worksheet in Appendix C for energy savings calculations. No costs are included for this ECM.

ECM: Convert Exterior Lighting Fixtures

In developments where mercury vapor, incandescent, or halogen exterior lighting fixtures illuminate exterior areas such as grounds or parking lots, substantial savings can be realized by converting these fixtures to high pressure sodium (HPS) or metal halide lighting. In addition, the color quality of both types of lighting is much better than that of mercury vapor lamps. In some cases, such as porch lights, compact fluorescent lamps may be the most appropriate replacement for incandescent lighting.

This ECM recommends replacement of the refrigerators at the property. Replacements should include the appliances over three years old as most of the refrigerators were replaced three years ago with units using close to the recommended energy usage. Refer to the ECM Worksheet in Appendix C for energy savings calculations.

ECM: Replace Older Refrigerators with High-Efficiency Units

After lighting, refrigerators are the second largest users of electricity in most households (not including households with electric heat or hot water). Because refrigerators are such a significant user of energy, they should be a focus of conservation efforts. Older units use up to four times more electricity than the most efficient new models available in the same size. Replacing these inefficient units with new, more efficient refrigerators can realize substantial energy and cost savings. In many cases, it is cost-effective to replace older refrigerators before scheduled replacement because of the electricity cost savings.

The most common size of refrigerators in public housing is the 14- to 15-cubic-foot range. In that range, the most efficient refrigerator available today uses 372 kWh per year. This automatic-defrost model is ENERGY STAR® qualified because it is 15 percent more efficient than federal standards require. By contrast, the average refrigerator in that size purchased before 1991 uses around 1,100 kWh, with older units using more than 1,500 kWh per year.

This ECM recommends replacing the common area washers and dryers at the property. Replacements should include Energy Star units. Refer to the ECM Worksheet in Appendix C for energy savings calculations.

ECM: Install Low-Flow Plumbing Fixtures (Aerators, Showerheads, Toilets)

About half the hot water consumed in a typical household is for bathing, and another 7 to 14 percent is used in the sink. By reducing the flow of water coming from the shower and faucets, water efficient showerheads and faucet aerators can generate significant energy savings at low cost and with easy installation. In addition to saving energy, showerheads and aerators save on water and sewer costs, which are rising in many areas.

Older showerheads deliver as much as 5 to 10 gallons per minute (GPM). New showerheads are required to be water efficient, delivering 2.5 GPM or less at a standard water pressure. Water-efficient, or low-flow, showerheads are designed to provide an acceptable shower at a greater reduced flow rate. Most are equipped with a button to switch the water off at the showerhead, to wave water while shaving or lathering. Water-efficient showerheads should not be confused with the flow restrictors used in the 1970s and early 1980s, which simply reduced the flow rate far below design level, often resulting in an unacceptable shower.

The average faucet has a flow rate of about 3 to 5 GPM. Adding a screw-in faucet aerator reduces the flow to 0.5 to 1.5 GPM in the bathroom and 2.2 GPM in the kitchen. In addition to saving energy and water, the “foamier” water that comes from faucet aerators wets objects better than water from a faucet with no aerator, which tends to bounce off the object rather than thoroughly wetting it.

In some areas, water and sewer rates have increased dramatically over the past few years and are rivaling the cost of energy. Reducing water use through conservation strategies can generate significant cost savings. Significant advances in technology over the past decade have resulted in the availability of reliable, high-quality water-saving toilets on the market.

Some water providers offer rebates and incentives for replacing inefficient toilets. Contact your provider to see if there is a program available.

This ECM recommends replacement of all the toilets with 1.6 gpm flush rates at the property. Refer to the ECM Worksheet in Appendix C for energy savings calculations.

5.3. ENERGY CONSERVATION MEASURES CONSIDERED

The table below is a summary of Energy Conservation Measures considered as part of EMG’s review of the energy use at the property. The review of the property was not limited to the below list of ECMs; however, these are those that typically have a quantifiable payback or can be documented. The actual ECM calculations can be found in Appendix C to this report.

Item		Recommend	Already exists	Payback Period>EUL	Infeasible	Comment (req for all infeasible)
Architectural/Building Envelope ECMs						
1	Install Replacement Windows	✓		✓	✓	
2	Install Window Sun Shades: South-facing windows	✓				
3	Install Window Sun Shades: East & West-facing windows	✓				
4	Install Roof Insulation: R10					
5	Install Roof Insulation: R20	✓				
6	Install Wall Insulation				✓	
7	Control Air Leakage	✓	✓			Weather sealing performed recently with replacement of sealant. Need better windows
Space Heating and Cooling ECMs						
8	Install Vent Dampers		✓			
9	Install Energy Management Systems (EMS)				✓	Elderly housing
10	Convert to Electronic Ignition		✓			
11	Install Boiler Controls		✓			

Item		Recommend	Already exists	Payback Period>EUL	Infeasible	Comment (req for all infeasible)
Space Heating and Cooling ECMs						
12	Replace Inefficient Heating Plant		✓			
13	Install Programmable/ Setback Thermostats	✓				No costs due to elderly housing
14	Insulate Hot Water or Steam Pipes	✓				
15	Seal and Insulate Ducts	✓				No ducts
16	Install Geothermal Heat Pumps			✓	✓	No water source heat pumps
17	Replace Inefficient Air Conditioners/fan coils	✓				No Air conditioning for apartments except per tenant
18	Install Swamp Coolers					Not Applicable for this part of the country.
Domestic Water & Heating Systems ECMs						
19	Install Water-efficient Showerheads and Faucet Aerators		✓			
20	Insulate Hot Water Tanks		✓			
21	Install Hot Water (DHW) Off-Peak Controls		✓			Needs to be part of EMS system
22	Replace Inefficient Water Heaters	✓				Water storage tanks served by high efficiency boilers
Lighting System ECMs						
23	Replace Older Fluorescent Lamps with Energy-Saving Lamps in Apartments	✓				
24	Install Electronic Ballasts in Building	✓				
25	Install Lighting Controls in Building	✓				
Lighting System ECMs						
26	Convert Exterior Lighting Fixtures	✓				
27	Install Photo-Controls for Exterior Lighting	✓				
Miscellaneous ECMs						
28	Upgrade or Replace inefficient Motors	✓				Small capacity motors only
29	Install Water-Saving Toilets	✓				
30	Convert Water Supply Pumps					None at property
31	Install Check Metering or Individual Metering		✓			Electric only
Additional ECMs to Consider						
32	Convert Hot Water Heater System to Solar			✓	✓	
33	Install Soil Moisture Sensors	✓				
34	Install Direct Use Geothermal System for Heating and Hot Water				✓	
35	Install Occupational Sensors for Interior Lighting	✓				Some exist
36	LED Exist Signs		✓			

6. OPERATIONS AND MAINTENANCE

6.1. RESIDENT EDUCATION

A significant portion of each unit's energy consumption is also due to tenant-owned electronics and appliances. The property management should consider working with the utility providers (electricity, water, gas) to educate tenants on saving energy. Tenant behavior change could ultimately account for on average 5% to 8% energy savings per unit. Likewise, management should consider preparation of Operations and Maintenance Manuals for the maintenance staff, regarding HVAC systems, Electrical systems and Plumbing systems to ensure proper operation, future maintenance, and appropriate repair. The Green O&M plan should address the following points:

- A description of maintenance practices that use a materially lower use of chemicals thought to be harmful to humans and where practicable, that use more recycling (including construction debris removal). Should the Owner decide to proceed with the Green Initiative, any pending construction and maintenance activities are required to subscribe to construction waste minimization practices. This includes construction waste management, segregation, and the promotion of recycling and reuse. The Owner/Contractor should consider the donation of salvageable equipment/materials to non-profit entities for reuse. The future O&M plan is required to have a detailed section regarding green waste minimization practices. It is important to note that waste minimization typically saves money, as it reduces tipping charges and disposal costs.
- Specification of green cleaning products and materials that are biodegradable and contain low or no volatile organic compounds.
- Include a Resident Involvement, Outreach, and Incentive Plan, featuring Green Training which is applicable to the recommended rehabilitation items.(e.g. programmable thermostats, etc.).
- An Integrated Pest Management Plan (IPM) is to be adopted, to include periodic interior and exterior inspections and best management practices for pest control.
- Operations and maintenance inspection checklists for routine inspections by management/maintenance staff involving landscaping, building envelope penetrations, dumpster location cleanliness, litter control, and water leaks.
- Operations and maintenance requirements for routine cleaning of walk-off matting, common area recycling bins, and other Green Components warranting daily/weekly upkeep to prevent pest, odor and allergen build-up.
- Specify green landscaping methods, to include waste minimization practices (mulching and composting of yard waste), and fertilizer treatment schedules (where fertilizers are used, they should be applied in several smaller applications in lieu of one heavy application).
- Indoor Environmental Quality (IEQ) testing protocols are to be established, including routine schedules for monitoring of resident comfort (e.g. temperature and relative humidity are significant indicators of indoor air quality and for avoiding mold problems), as well as protocols for reactive testing (e.g. specialty testing to occupancy complaints).
- Energy and Water Usage Monitoring. Management is required to establish a tracking mechanism for utility consumption in order to benchmark the effects of the Green improvements.

6.2. OPERATION AND MAINTENANCE RECOMMENDATIONS

The following general operations and maintenance recommendations should be continued or implemented.

Building Envelope:

1. Caulking and weather stripping is functional and effective.
2. Holes are patched in the building envelope.
3. Automatic door closing mechanisms are functional.
4. Interior vestibule doors are closed.

Heating and Cooling:

1. The burners are clean and fuel/air ratios are optimized.
2. Heat exchange surfaces of furnaces are clean and free of scale.
3. Temperature settings are reduced in unoccupied areas and set points are seasonally adjusted.
4. Control valves and dampers are fully functional.
5. Equipment is inspected for worn or damaged parts.
6. Ductwork is sealed.
7. Hot air registers, and return air ductwork are clean and unobstructed.
8. Air dampers are operating correctly.
9. Heating is uniform throughout the designated areas.
10. Evaporator and condenser coils in AC equipment are clean.
11. Air filters are clean and replaced as needed.

Domestic Hot Water:

1. Domestic hot water heater temperature is set to the minimum temperature required. Storage tanks
2. Tank-type water heaters are flushed as required. Storage tanks

Lighting:

1. Over-lit areas are managed by bi-level switching or photocell controls.
2. Only energy efficient replacement lamps are used and in-stock.
3. Lighting fixture reflective surfaces and translucent covers are clean.
4. Walls are clean and bright.
5. Timers and/or photocells are operating correctly on exterior lighting.

Tenant areas:

1. Refrigerator and freezer doors close and seal correctly.
2. Kitchen exhaust fans are only used when needed.
3. Office/ computer equipment is either in the "sleep" or off mode when not used.
4. All other recommended equipment specific preventive maintenance actions are conducted,
5. Usage demands on the building/ equipment have not changed significantly since the original building commissioning or the most recent retro-commissioning.
6. Recommend tenants use Energy Star rated computers and copiers.

Equipment Replacement:

1. All equipment replacements are not over/ undersized for the particular application.
2. All equipment replacements should be energy conserving devices.

7. APPENDICES

APPENDIX A:	Photographic Record
APPENDIX B:	Site Plans
APPENDIX C:	Energy Audit Calculations
APPENDIX D:	Manual J Calculations
APPENDIX E:	Supporting Documentation
APPENDIX F:	EMG Accessibility Checklist
APPENDIX G:	Pre-Survey Questionnaires
APPENDIX H:	Resumes

APPENDIX A:
PHOTOGRAPHIC RECORD

EMG PHOTOGRAPHIC RECORD

Project No.: 107534.13R-003.306

Project Name: David F. Roche Apartments



Photo #1: East facing front elevations



Photo #2: Southeast end elevation



Photo #3: Rear southwest elevation



Photo #4: West elevation



Photo #5: North elevation



Photo #6: Main entrance

EMG PHOTOGRAPHIC RECORD

Project No.: 107534.13R-003.306

Project Name: David F. Roche Apartments



Photo #7:	Parking along north portion of parking lot
-----------	--



Photo #8:	Shifted concrete walkway
-----------	--------------------------



Photo #9:	Fencing along east property line
-----------	----------------------------------



Photo #10:	Damaged Dumpster
------------	------------------



Photo #11:	Condensation exhaust causing ice to form at exit from main mechanical room
------------	--



Photo #12:	Separating construction joint
------------	-------------------------------

EMG PHOTOGRAPHIC RECORD

Project No.: 107534.13R-003.306

Project Name: David F. Roche Apartments



Photo #13: Window



Photo #14: ADA parking with post signage at non-compliant heights



Photo #15: Roof overview



Photo #16: Roof close up showing bulges in membrane



Photo #17: Condensing unit



Photo #18: Air handling unit

EMG PHOTOGRAPHIC RECORD

Project No.: 107534.13R-003.306

Project Name: David F. Roche Apartments



Photo #19: Transformer



Photo #20: Elevator lobby



Photo #21: Elevator cab interior



Photo #22: Elevator machinery



Photo #23: Exhaust fans



Photo #24: Fire pump

EMG PHOTOGRAPHIC RECORD

Project No.: 107534.13R-003.306

Project Name: David F. Roche Apartments



Photo #25: Fire pump with excessive corrosion at pan



Photo #26: Boilers



Photo #27: Flat plate heat exchanger



Photo #28: Domestic water storage tanks



Photo #29: Suspect asbestos at duct



Photo #30: Fire alarm panel and electrical meter bank

EMG PHOTOGRAPHIC RECORD

Project No.: 107534.13R-003.306

Project Name: David F. Roche Apartments



Photo #31: Generator



Photo #32: Main entrance vestibule



Photo #33: Fire stair without continuous inner railing but extensions on outer railing



Photo #34: Corridor



Photo #35: Laundry room



Photo #36: Unit heater in laundry room

EMG PHOTOGRAPHIC RECORD

Project No.: 107534.13R-003.306

Project Name: David F. Roche Apartments



Photo #37: Laundry sink with non-GFCI



Photo #38: Community room



Photo #39: Community room kitchen



Photo #40: Common area restroom with signage



Photo #41: Common area men's restroom with loose drain pipe insulation



Photo #42: Common area men's restroom

EMG PHOTOGRAPHIC RECORD

Project No.: 107534.13R-003.306

Project Name: David F. Roche Apartments



Photo #43: Main entrance lobby

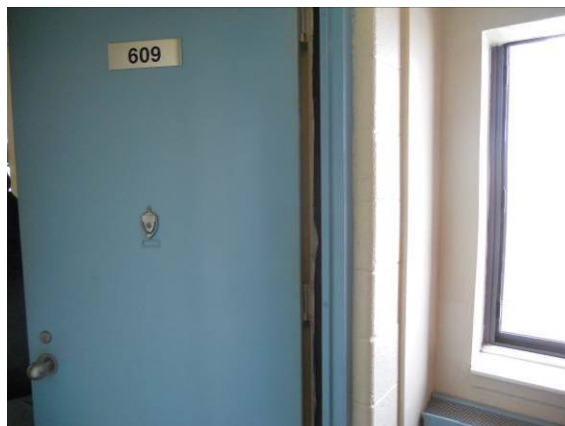


Photo #44: Apartment unit entrance



Photo #45: Apartment unit living room



Photo #46: Apartment unit kitchen



Photo #47: Apartment unit bedroom with no smoke detector



Photo #48: Apartment unit bathroom

EMG PHOTOGRAPHIC RECORD

Project No.: 107534.13R-003.306

Project Name: David F. Roche Apartments



Photo #49: Apartment unit bathtub



Photo #50: Apartment unit smoke detector and strobe just outside of bedroom



Photo #51: Apartment unit ADA entrance



Photo #52: Apartment ADA unit



Photo #53: Apartment ADA unit with roll-in shower



Photo #54: Apartment ADA unit with non-compliant faucet handle and grab bar lengths

EMG PHOTOGRAPHIC RECORD

Project No.: 107534.13R-003.306

Project Name: David F. Roche Apartments



Photo #55: Apartment unit lavatory condition



Photo #56: Vacant apartment unit



Photo #57: Secondary entrance with daylight seen under door frame

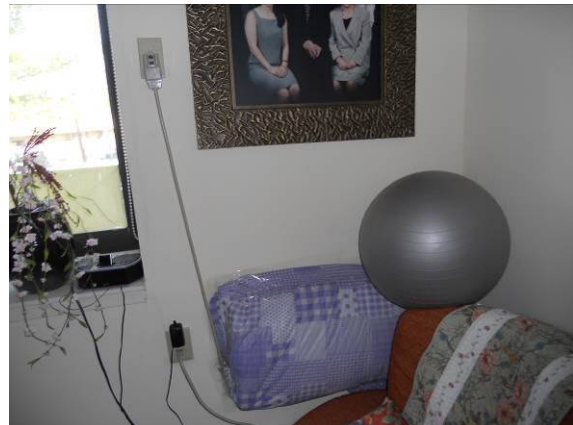


Photo #58: Apartment unit with dedicated receptacle location too far from air conditioning unit



Photo #59: Gazebo at rear of property

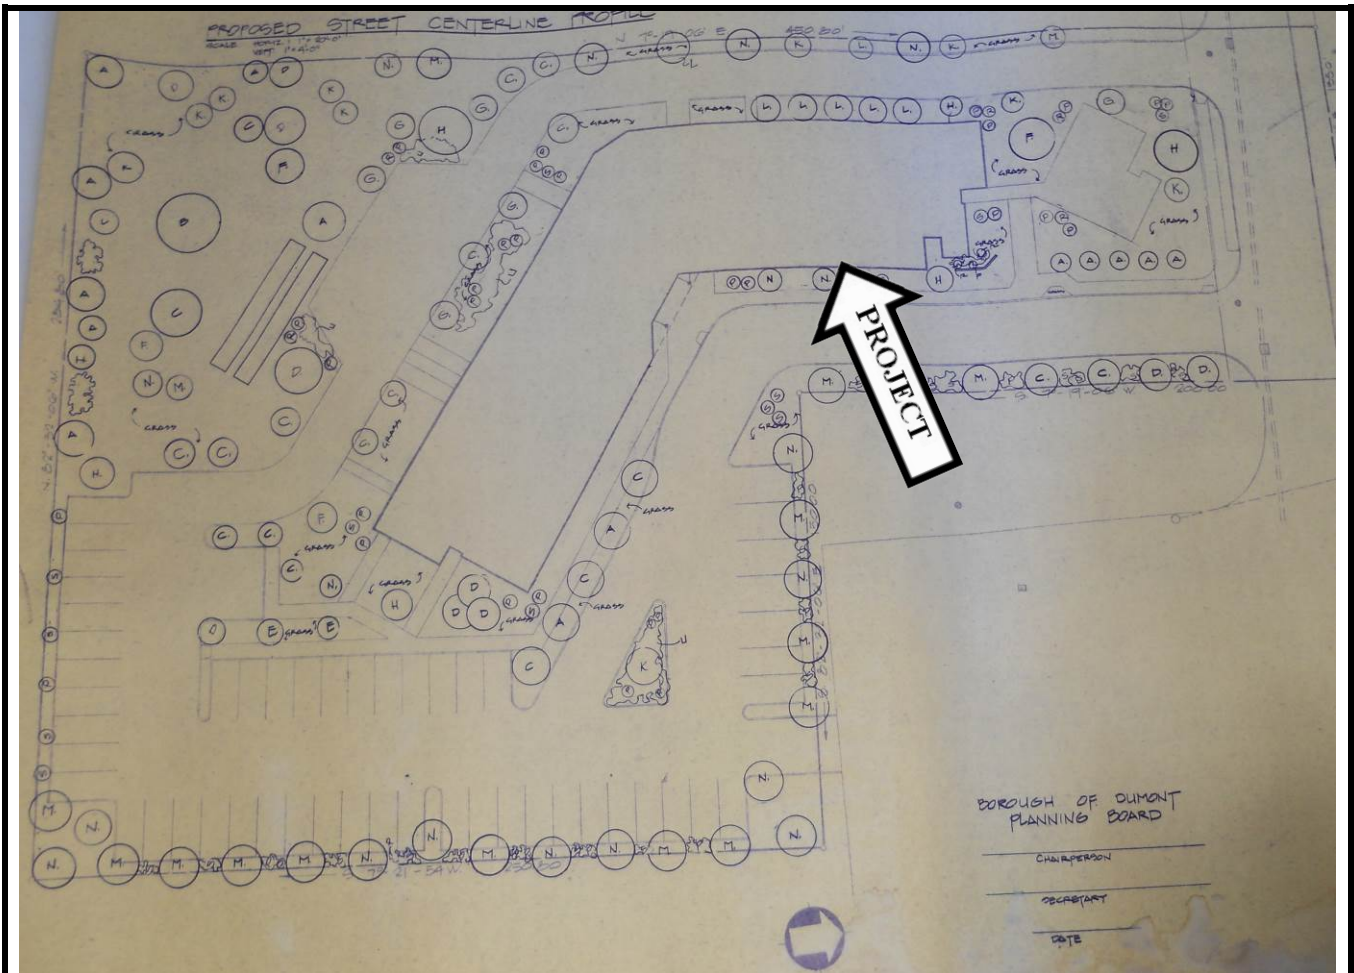


Photo #60: Gazebo interior at rear of property

APPENDIX B:

SITE PLANS

Site Plan



	Source:	Project Number: 107534.13R-003.306
	The north arrow indicator is an approximation of 0° North.	Project Name: David F. Roche Apartments On-Site Date: March 4, 2014

APPENDIX C: ENERGY AUDIT CALCULATIONS

Energy Conservation Measure

Replace Incandescent Lighting with Energy Star Light Fixtures in Apartments

This analysis is for replacment of standard incandescent light fixtures with Energy Star fixtures in the apartments. Average annual usage and 15 Watt CFL replacement bulbs are assumed.

Step 1	Cost Information			
	Cost of installing Energy Star fixtures (Green)	6435.00	\$	
	Cost of installing Incandescent (Traditional)	4455.00	\$	
Step 2	Transfer the following information from the Survey:			
4-13	a Number of dwelling units:	99		
	b Total number of light fixtures to be replaced:	99		
	c Average number of hours/day lights are in use:	4		
5-9	d Cost of electricity:	\$0.09	\$/kWh	
Step 3	Lighting Energy Consumption			
	Existing/Traditional Consumption (60 Watt Incandescent)			
	$\frac{0.040}{\text{kW/fixture}}$	$\times \frac{99}{\text{Fixtures}}$	$\times \frac{1460}{\text{hrs/year}}$	$= \frac{5782}{\text{kWh/yr}}$
	Green Consumption (15 Watt CFL)			
	$\frac{0.015}{\text{kW/fixture}}$	$\times \frac{99}{\text{Fixtures}}$	$\times \frac{1460}{\text{hrs/year}}$	$= \frac{2168}{\text{kWh/yr}}$
Step 4	Estimate annual energy savings vs. Traditional:			
	$\frac{2a}{5782}$	$- \frac{3}{2168}$	$= \frac{3614}{\text{kWh/yr}}$	
Step 5	Calcualte annual cost savings vs. Traditional:			
	$\frac{4}{3613.50}$	$\times \frac{2b}{0.09}$	$= \frac{320.24}{\text{\$/yr}}$	
	$\frac{\text{Cost Savings}}{6435.00}$	$- \frac{\text{Cost Differential}}{4455.00}$	$= \frac{1980.00}{\text{\$/yr}}$	
Step 6	Calculate payback period:			
	$\frac{1}{1980.00}$	$/ \frac{5}{320.24}$	$= \frac{6.18}{\text{yrs}}$	
	Simple Payback Period	$\frac{6435.00}{320.24}$	$= \frac{20.09}{\text{yrs}}$	

Energy Conservation Measure

Replace Fluorescent Fixtures in Apartments with T-8 Bulbs & Electronic Ballasts

This analysis is for replacment of the T-12 fluorescent lamps with T-8 lamps and electronic ballasts in the apartment units. An average annual usage and standard replacement bulb size are assumed.

Step 1	Cost Information			
	Cost of Replacing Fixtures w/ T-8 & Electronic Ballast	15444.00	\$	
	Cost of Replacing Fixtures w/ T-12 & Electronic Ballast	12870.00	\$	
Step 2	Transfer the following information from the Survey:			
4-13	a Number of dwelling units:	99		
	b Total number of light fixtures to be replaced:	198		
	c Existing Watts per bulb	40		
	d Number of linear bulbs per fixture	2		
	e Average number of hours/day bulbs are in use:	4		
5-9	f Cost of electricity:	\$0.09		\$/kWh
Step 3	Lighting Energy Consumption			
	Traditional Consumption <i>T-12 Fluorescent - 40 Watt</i>			
	$\frac{0.040}{\text{kW/bulb}}$	$\times \frac{396}{\text{\# of bulbs}}$	$\times \frac{1460}{\text{hrs/year}}$	$= \frac{23126}{\text{kWh/yr}}$
	Traditional Consumption <i>T-12 Fluorescent - 34 Watt</i>			
	$\frac{0.034}{\text{kW/bulb}}$	$\times \frac{396}{\text{\# of bulbs}}$	$\times \frac{1460}{\text{hrs/year}}$	$= \frac{19657}{\text{kWh/yr}}$
	Green Consumption <i>T-8 Fluorescent - 28 Watt</i>			
	$\frac{0.028}{\text{kW/bulb}}$	$\times \frac{396}{\text{\# of bulbs}}$	$\times \frac{1460}{\text{hrs/year}}$	$= \frac{16188}{\text{kWh/yr}}$
Step 4	Estimate annual energy savings vs. Traditional:			
	$\frac{2a}{19657}$	$- \frac{3}{16188}$	$= \frac{3469}{\text{kWh/yr}}$	
Step 5	Calcualte annual cost savings vs. Traditional:			
	$\frac{4}{3468.96}$	$\times \frac{2b}{0.09}$	$= \frac{307.43}{\text{\$/yr}}$	
	$\frac{15444.00}{\text{Cost Differential}}$	$- \frac{12870.00}{\text{Cost Differential}}$	$= \frac{2574.00}{\text{\$/yr}}$	
Step 6	Calculate payback period:			
	$\frac{1}{2574.00}$	$/ \frac{5}{307.43}$	$= \frac{8.37}{\text{yrs}}$	
	Simple Payback Period	$\frac{15444.00}{307.43}$	$= \frac{50.24}{\text{yrs}}$	

Energy Conservation Measure

Replace Fluorescent Fixtures in Common Areas with T-8 Bulbs & Electronic Ballasts

This analysis is for replacement of the T-12 fluorescent lighting with T-8 Lamps and Electronic Ballasts in the common areas. An average annual usage and standard replacement bulb size are assumed.

Step 1	Cost Information				
	Cost of Replacing Fixtures w/ T-8 & Electronic Ballast	14196.00	\$		
	Cost of Replacing Fixtures w/ T-12 & Electronic Ballast	11830.00	\$		
Step 2	Transfer the following information from the Survey:				
b	Total number of light fixtures to be replaced:	182			
c	Existing Watts per bulb	40			
d	Number of linear bulbs per fixture	2			
e	Average number of hours/day bulbs are in use:	12			
f	Cost of electricity:	\$0.09		\$/kWh	
Step 3	Lighting Energy Consumption				
	Traditional Consumption T-12 Fluorescent - 40 Watt				
	$\frac{0.040}{\text{kW/bulb}}$	$\times \frac{364}{\text{\# of bulbs}}$	$\times \frac{4380}{\text{hrs/year}}$	$= \frac{63773}{\text{kWh/yr}}$	
	Traditional Consumption T-12 Fluorescent - 34 Watt				
	$\frac{0.034}{\text{kW/bulb}}$	$\times \frac{364}{\text{\# of bulbs}}$	$\times \frac{4380}{\text{hrs/year}}$	$= \frac{54207}{\text{kWh/yr}}$	
	Green Consumption T-8 Fluorescent - 28 Watt				
	$\frac{0.028}{\text{kW/bulb}}$	$\times \frac{364}{\text{\# of bulbs}}$	$\times \frac{4380}{\text{hrs/year}}$	$= \frac{44641}{\text{kWh/yr}}$	
Step 4	Estimate annual energy savings vs. Traditional:				
	$\frac{54207}{\text{kWh/yr}}$	-	$\frac{44641}{\text{kWh/yr}}$	$= \frac{9566}{\text{kWh/yr}}$	
Step 5	Calculate annual cost savings vs. Traditional:				
	$\frac{9565.92}{\text{\$/yr}}$	$\times \frac{0.09}{\text{\$/kWh}}$	$= \frac{847.77}{\text{\$/yr}}$		
	$\frac{14196.00}{\text{\$/yr}}$	-	$\frac{11830.00}{\text{\$/yr}}$	$= \frac{2366.00}{\text{\$/yr}}$	
Step 6	Calculate payback period:				
	$\frac{2366.00}{\text{yrs}}$	/	$\frac{847.77}{\text{\$/yr}}$	$= \frac{2.79}{\text{yrs}}$	
	Simple Payback Period	$\frac{14196.00}{\text{\$/yr}}$	/	$\frac{847.77}{\text{\$/yr}}$	$= \frac{16.75}{\text{yrs}}$

Energy Conservation Measure

Replace Site Light Fixtures with LED Fixtures

This analysis is for replacment of the HPS Site Lighting with LED Site Lighting in the common areas. An average annual usage and standard replacement bulb size are assumed.

Step 1	Cost Information	
	Cost of Replacing Fixtures w/ HPS	737.00 \$
	Cost of Replacing Fixtures w/ LED	950.00 \$
Step 2	Transfer the following information from the Survey:	
b	Total number of light fixtures to be replaced:	11
c	Existing Watts per bulb	400
e	Average number of hours/day bulbs are in use:	12
f	Cost of electricity:	\$0.05 \$/kWh
Step 3	Lighting Energy Consumption	
	Traditional Consumption	
	$\frac{0.465}{\text{kW/fixture}} \times \frac{1}{\text{# of bulbs}} \times \frac{4380}{\text{hrs/year}}$	$= 2037 \text{ kWh/yr}$
	Green Consumption	
	$\frac{0.195}{\text{kW/fixture}} \times \frac{1}{\text{# of bulbs}} \times \frac{4380}{\text{hrs/year}}$	$= 854 \text{ kWh/yr}$
Step 4	Estimate annual energy savings vs. Traditional:	
	$\frac{2a}{2037} - \frac{3}{854} = \frac{1183}{\text{kWh/yr}}$	
Step 5	Calcualte annual cost savings vs. Traditional:	
	$\frac{4}{1182.60} \times \frac{2b}{0.05} = \frac{59.13}{\text{\$/yr}}$	
	$\frac{737.00}{\text{Cost Differential}} - \frac{950.00}{\text{Cost Differential}} = \frac{213.00}{\text{\$/yr}}$	
Step 6	Calculate payback period:	
	$\frac{213.00}{\text{Premium Payback}} / \frac{59.13}{\text{\$/yr}} = \frac{3.60}{\text{yrs}}$	
	Simple Payback Period	$\frac{737.00}{\text{\$/yr}} = 12.46 \text{ yrs}$

Energy Conservation Measure

Replace Older Plumbing Fixtures with Low Flow Devices

Input Data:

Step 1	Number of residents	100			
	Total annual use days	365			
		Water closet		Sinks	Shower
	Existing water controls in gallons per use	3.5		2.2	2.5
	low -flow water controls in gallons per use	1.6		1.5	1.75
	Low-flow replacement cost	\$320.00		\$4.00	\$75.00
Step 2		Quantity	Daily Usage Assumption		
	Total number of old water closets	99	6.0 flushes		
	Total number of sinks to be upgraded	99	6.0 minutes		
	Total number of shower heads to be upgraded	99	10.1 minutes		
	Total Water Rate	\$ 0.0065 /gal			
Step 3		Calculations:			
	Water conservation method	Total to be replaced	Cost of replacement	Total cost	
	Replace existing with low flow water closets	99	\$320	\$31,680.00	
	Install aerators on existing faucet controls	99	\$4	\$396.00	
	Replace existing shower heads	99	\$75	\$7,425.00	
			Total	\$39,501.00	
	Results				
	Annual Savings	Annual time used	Gallons saved	Annual cost savings	Payback
	Annual water closet flushes (flushes)	216,810	411,939	\$2,681.43	11.81460541
	Annual sink use (minutes)	216,810	151,767	\$987.89	0.400852683
	Annual shower use (minutes)	365,000	273,750	\$1,781.92	4.166863644
		Total	837,456	\$5,451.24	
	Simple Payback		7.25	years	

Energy Conservation Measure
Replace Site Light Fixtures with LED Fixtures

This analysis is for replacment of the HPS Site Lighting with LED Site Lighting in the common areas. An average annual usage and standard replacement bulb size are assumed.

Step 1	Cost Information				
	Cost of Replacing Fixtures w/ Metal Halide			544.00	\$
	Cost of Replacing Fixtures w/ LED			825.00	\$
Step 2	Transfer the following information from the Survey:				
	a	Number of dwelling units:			
	b	Total number of light fixtures to be replaced:		8	
	c	Existing Watts per bulb		250	
	d	Number of linear bulbs per fixture		1	
	e	Average number of hours/day bulbs are in use:		12	
	f	Cost of electricity:		\$0.05	\$/kWh
Step 3	Lighting Energy Consumption				
	Traditional Consumption				
		$\frac{0.285}{\text{kW/fixture}}$	x	$\frac{1}{\text{\# of bulbs}}$	$\frac{4380}{\text{hrs/year}}$
					= 1248 kWh/yr
	Green Consumption				
		$\frac{0.090}{\text{kW/fixture}}$	x	$\frac{1}{\text{\# of bulbs}}$	$\frac{4380}{\text{hrs/year}}$
					= 394 kWh/yr
Step 4	Estimate annual energy savings vs. Traditional:				
		2a		3	
		1248	-	394	= 854 kWh/yr
Step 5	Calcualte annual cost savings vs. Traditional:				
		4		2b	
	Cost Savings	854.10	x	0.05	= 42.71 \$/yr
	Cost Differential	544.00	-	825.00	= 281.00 \$/yr
Step 6	Calculate payback period:				
	Premium Payback	281.00	/	42.71	= 6.58 yrs
	Simple Payback Period	544.00	/	42.71	= 12.74 yrs

**APPENDIX D:
MANUAL J CALCULATIONS**

Apartment Load Sizing: David F. Roche Apartments
Heat Gain Calculations 1-Bedroom

This analysis is for calculating the heat gain during the cooling season.

Step 1 Calculated total tonnage for cooling equipment:

1.3	Tons
15203	Btu/hr

Step 2 Heat gain from Windows on North Side

a	Height of Window	5.00	ft.
b	Width of Window	2.58	ft.
c	Number of windows on north side	0	
d	Indoor Design Temperature	74	F
e	Outdoor Design Temperature	95	F
f	U-Value for Window	0.50	
g	Heat gain, $Q = (2a \times 2b \times 2c) \times 2f \times (2e - 2d)$	0	BTUH

Step 3 Heat gain from Exterior Doors on North Side

a	Height of Exterior Door	7	ft.
b	Width of Exterior Door	3	ft.
c	Number of exterior doors on north side	0	
d	Indoor Design Temperature	74	F
e	Outdoor Design Temperature	95	F
f	U-Value for Exterior Door	0.10	
g	Heat gain, $Q = (3a \times 3b \times 3c) \times 3f \times (3e - 3d)$	0	BTUH

Step 4 Heat gain from North Wall

a	Length of North wall	24.0	ft.
b	Height of North wall	9.0	ft.
c	Indoor Design Temperature	74	F
d	Outdoor Design Temperature	74	F
e	U-Value for North wall	0.071	
f	Heat gain, $Q = ((4ax4b)-(2a*2b*2c)-(3a*3b*3c)) \times 4e \times (4d - 4c)$	0	BTUH

Step 5 Heat gain from Windows on South Side

a	Height of Window	5.00	ft.
b	Width of Window	2.58	ft.
c	Number of windows on south side	5	
d	Indoor Design Temperature	74	F
e	Outdoor Design Temperature	95	F
f	U-Value for Window	0.50	
g	SHGC, Solar Heat Gain Coefficient	0.6	
h	Heat gain, $Q = ((5a \times 5b \times 5c) \times 5f \times (5e - 5d)) + (5ax5bx5cx5gx125)$	5,515	BTUH

Step 6 Heat gain from Exterior Doors on South Side

a	Height of Exterior Door	7	ft.
b	Width of Exterior Door	3	ft.
c	Number of exterior doors on south side	0	
d	Indoor Design Temperature	74	F
e	Outdoor Design Temperature	95	F
f	U-Value for Exterior Doors	0.10	
g	Heat gain, $Q = (6a \times 6b \times 6c) \times 6f \times (6e - 6d + 10)$	0	BTUH

Apartment Load Sizing: David F. Roche Apartments
Heat Gain Calculations 1-Bedroom

This analysis is for calculating the heat gain during the cooling season.

Step 7 Heat gain from South Wall

a	Length of South wall	24.0	ft.
b	Height of South wall	9.0	ft.
c	Indoor Design Temperature	74	F
d	Outdoor Design Temperature	95	F
e	U-Value for South wall	0.071	
f	Heat gain, $Q = ((7a \times 7b) - (5a \times 5b \times 5c) - (6a \times 6b \times 6c)) \times 7e \times (7d - 7c + 10)$	335	BTUH

Step 8 Heat gain from Windows on East Side

a	Height of Window	5.80	ft.
b	Width of Window	2.58	ft.
c	Number of windows on east side	0	
d	Indoor Design Temperature	74	F
e	Outdoor Design Temperature	95	F
f	U-Value for Window	0.50	
g	Heat gain, $Q = (8a \times 8b \times 8c) \times 8f \times (8e - 8d)$	0	BTUH

Step 9 Heat gain from Exterior Doors on East Side

a	Height of Exterior Door	7	ft.
b	Width of Exterior Door	3	ft.
c	Number of exterior doors on east side	0	
d	Indoor Design Temperature	74	F
e	Outdoor Design Temperature	95	F
f	U-Value for Exterior Doors	0.10	
g	Heat gain, $Q = (9a \times 9b \times 9c) \times 9f \times (9e - 9d)$	0	BTUH

Step 10 Heat gain from East Wall

a	Length of East wall	23.6	ft.
b	Height of East wall	9.0	ft.
c	Indoor Design Temperature	74	F
d	Outdoor Design Temperature	74	F
e	U-Value for East wall	0.071	
f	Heat gain, $Q = ((10a \times 10b) - (8a \times 8b \times 8c) - (9a \times 9b \times 9c)) \times 10e \times (10d - 10c)$	0	BTUH

Step 11 Heat gain from Windows on West Side

a	Height of Window	5.83	ft.
b	Width of Window	2.58	ft.
c	Number of windows on west side	1	
d	Indoor Design Temperature	74	F
e	Outdoor Design Temperature	95	F
f	U-Value for Window	0.50	
g	SHGC, Solar Heat Gain Coefficient	0.0	
h	Heat gain, $Q = ((11a \times 11b \times 11c) \times 11f \times (11e - 11d)) + (11a \times 11b \times 11c \times 11g \times 125)$	158	BTUH

Apartment Load Sizing: David F. Roche Apartments
Heat Gain Calculations 1-Bedroom

This analysis is for calculating the heat gain during the cooling season.

Step 12 Heat gain from Exterior Doors on West Side

a	Height of Exterior Door	7	ft.
b	Width of Exterior Door	3	ft.
c	Number of exterior doors on west side	0	
d	Indoor Design Temperature	74	F
e	Outdoor Design Temperature	95	F
f	U-Value for Exterior Doors	0.10	
g	Heat gain, $Q = (12a \times 12b \times 12c) \times 12f \times (12e - 12d + 10)$	0	BTUH

Step 13 Heat gain from West Wall

a	Length of West wall	23.6	ft.
b	Height of West wall	9.0	ft.
c	Indoor Design Temperature	74	F
d	Outdoor Design Temperature	95	F
e	U-Value for West wall	0.071	
f	Heat gain, $Q = ((13a \times 13b) - (11a \times 11b \times 11c) - (12a \times 12b \times 12c)) \times 13e \times (13d - 13c + 10)$	32	BTUH

Step 14 Heat gain from Roof

a	Length of Roof	24.0	ft.
b	Width of Roof	23.6	ft.
c	Slope Factor for Roof (1.0 for flat roofs, 1.20 for sloped roofs)	1.00	
d	Indoor Design Temperature	74	F
e	Outdoor Design Temperature	95	F
f	U-Value for Roof	0.067	
g	Heat gain, $Q = (14a \times 14b \times 14c) \times 14f \times (14e - 14d + 30)$	1,926	BTUH

Step 15 Heat gain from Ground Floor

a	Length of ground floor	24.0	ft.
b	Width of ground floor	23.6	ft.
c	Indoor Design Temperature	74	F
d	Outdoor Design Temperature	75	F
e	U-Value for ground floor	0.000	
f	Heat gain, $Q = (15a \times 15b) \times 15e \times (15d - 15c)$	0	BTUH

Step 16 Heat gain from Infiltration

a	Length of Building or Unit	24.0	ft.
b	Width of Building or Unit	23.6	ft.
c	Height of Building or Unit	9.0	
d	Indoor Design Temperature	74	F
e	Outdoor Design Temperature	95	F
f	ACH, Air Change Per Hour	1.0	
g	Enthalpy, H	10.0	
h	Heat gain, $Q = ((16a \times 16b \times 16c) / 60) \times 16f \times 4.5 \times 16g$	3,823	BTUH

Step 17 Heat gain from electrical heat

a	Kilowatt of continuous power (per hour)	1.0	kW
b	Heat gain, $Q = 3414 \times 17a$	3,414	BTUH

Apartment Load Sizing: David F. Roche Apartments
Heat Loss Calculations 1-Bedroom

This analysis is for calculating the heat loss during the winter heating season.

Step 1 Calculated total BTUH for heating equipment:

22886	BTUH
6.7	kW

Step 2 Heat loss from Windows on North Side

a	Height of Window	5.0	ft.
b	Width of Window	2.6	ft.
c	Number of windows on north side	5	
d	Indoor Design Temperature	76	F
e	Outdoor Design Temperature	0	F
f	U-Value for Window	0.50	
g	Heat Loss, $Q = (2a \times 2b \times 2c) \times 2f \times (2d - 2e)$	2,451	BTUH

Step 3 Heat loss from Exterior Doors on North Side

a	Height of Exterior Door	7.0	ft.
b	Width of Exterior Door	3.0	ft.
c	Number of exterior doors on north side	0	
d	Indoor Design Temperature	76	F
e	Outdoor Design Temperature	0	F
f	U-Value for Exterior Door	0.10	
g	Heat Loss, $Q = (3a \times 3b \times 3c) \times 3f \times (3d - 3e)$	0	BTUH

Step 4 Heat loss from North Wall

a	Length of North wall	24.0	ft.
b	Height of North wall	9.0	ft.
c	Indoor Design Temperature	76	F
d	Outdoor Design Temperature	0	F
e	U-Value for North wall	0.071	
f	Heat Loss, $Q = ((4a \times 4b) - (2a \times 2b \times 2c) - (3a \times 3b \times 3c)) \times 4e \times (4c - 4d)$	822	BTUH

Step 5 Heat loss from Windows on South Side

a	Height of Window	5.0	ft.
b	Width of Window	2.6	ft.
c	Number of windows on south side	0	
d	Indoor Design Temperature	76	F
e	Outdoor Design Temperature	0	F
f	U-Value for Window	0.50	
g	Heat Loss, $Q = (5a \times 5b \times 5c) \times 5f \times (5d - 5e)$	0	BTUH

Step 6 Heat loss from Exterior Doors on South Side

a	Height of Exterior Door	7.0	ft.
b	Width of Exterior Door	3.0	ft.
c	Number of exterior doors on south side	0	
d	Indoor Design Temperature	76	F
e	Outdoor Design Temperature	0	F
f	U-Value for Exterior Doors	0.10	
g	Heat Loss, $Q = (6a \times 6b \times 6c) \times 6f \times (6d - 6e)$	0	BTUH

Apartment Load Sizing: David F. Roche Apartments
Heat Loss Calculations 1-Bedroom

This analysis is for calculating the heat loss during the winter heating season.

Step 7 Heat loss from South Wall

a	Length of South wall	24.0	ft.
b	Height of South wall	9.0	ft.
c	Indoor Design Temperature	76	F
d	Outdoor Design Temperature	76	F
e	U-Value for South wall	0.071	
f	Heat Loss, $Q = ((7a \times 7b) - (5a \times 5b \times 5c) - (6a \times 6b \times 6c)) \times 7e \times (7c - 7d)$	0	BTUH

Step 8 Heat loss from Windows on East Side

a	Height of Window	5.8	ft.
b	Width of Window	2.6	ft.
c	Number of windows on east side	0	
d	Indoor Design Temperature	76	F
e	Outdoor Design Temperature	76	F
f	U-Value for Window	0.50	
g	Heat Loss, $Q = (8a \times 8b \times 8c) \times 8f \times (8d - 8e)$	0	BTUH

Step 9 Heat loss from Exterior Doors on East Side

a	Height of Exterior Door	7.0	ft.
b	Width of Exterior Door	3.0	ft.
c	Number of exterior doors on east side	0	
d	Indoor Design Temperature	76	F
e	Outdoor Design Temperature	0	F
f	U-Value for Exterior Doors	0.10	
g	Heat Loss, $Q = (9a \times 9b \times 9c) \times 9f \times (9d - 9e)$	0	BTUH

Step 10 Heat loss from East Wall

a	Length of East wall	23.6	ft.
b	Height of East wall	9.0	ft.
c	Indoor Design Temperature	76	F
d	Outdoor Design Temperature	0	F
e	U-Value for East wall	0.071	
f	Heat Loss, $Q = ((10a \times 10b) - (8a \times 8b \times 8c) - (9a \times 9b \times 9c)) \times 10e \times (10c - 10d)$	1,153	BTUH

Step 11 Heat loss from Windows on West Side

a	Height of Window	5.8	ft.
b	Width of Window	2.6	ft.
c	Number of windows on west side	1	
d	Indoor Design Temperature	76	F
e	Outdoor Design Temperature	0	F
f	U-Value for Window	0.50	
g	Heat Loss, $Q = (11a \times 11b \times 11c) \times 11f \times (11d - 11e)$	572	BTUH

Apartment Load Sizing:	David F. Roche Apartments
Heat Loss Calculations	1-Bedroom

This analysis is for calculating the heat loss during the winter heating season.

Step 12 Heat loss from Exterior Doors on West Side

a	Height of Exterior Door	7.0	ft.
b	Width of Exterior Door	3.0	ft.
c	Number of exterior doors on west side	0	
d	Indoor Design Temperature	76	F
e	Outdoor Design Temperature	0	F
f	U-Value for Exterior Doors	0.10	
g	Heat Loss, $Q = (12a \times 12b \times 12c) \times 12f \times (12d - 12e)$	0	BTUH

Step 13 Heat loss from West Wall

a	Length of West wall	23.6	ft.
b	Height of West wall	9.0	ft.
c	Indoor Design Temperature	76	F
d	Outdoor Design Temperature	0	F
e	U-Value for West wall	0.071	
f	Heat Loss, $Q = ((13a \times 13b) - (11a \times 11b \times 11c) - (12a \times 12b \times 12c)) \times 13e \times (13c - 13d)$	1,071	BTUH

Step 14 Heat loss from Roof

a	Length of Roof	24.0	ft.
b	Width of Roof	23.6	ft.
c	Slope Factor for Roof (1.0 for flat roofs, 1.20 for sloped roofs)	1.00	
d	Indoor Design Temperature	76	F
e	Outdoor Design Temperature	0	F
f	U-Value for Roof	0.067	
g	Heat Loss, $Q = (14a \times 14b \times 14c) \times 14f \times (14d - 14e)$	2,870	BTUH

Step 15 Heat loss from Ground Floor

a	Length of ground floor	24.0	ft.
b	Width of ground floor	23.6	ft.
c	Indoor Design Temperature	76	F
d	Outdoor Design Temperature	68	F
e	U-Value for ground floor	0.000	
f	Heat Loss, $Q = (15a \times 15b) \times 15e \times (15c - 15d)$	0	BTUH

Step 16 Heat loss from Infiltration

a	Length of Building or Unit	24.0	ft.
b	Width of Building or Unit	23.6	ft.
c	Height of Building or Unit	9.0	
d	Indoor Design Temperature	76	F
e	Outdoor Design Temperature	0	F
f	ACH, Air Change Per Hour	2.0	
g	Heat Loss, $Q = ((16a \times 16b \times 16c) / 60) \times 16f \times 1.08 \times (16d - 16e)$	13,947	BTUH

Apartment Load Sizing: David F. Roche Apartments
Heat Gain Calculations 2-Bedroom

This analysis is for calculating the heat gain during the cooling season.

Step 1 Calculated total tonnage for cooling equipment:

1.5	Tons
18578	Btu/hr

Step 2 Heat gain from Windows on North Side

a	Height of Window	5.00	ft.
b	Width of Window	2.58	ft.
c	Number of windows on north side	0	
d	Indoor Design Temperature	74	F
e	Outdoor Design Temperature	95	F
f	U-Value for Window	0.50	
g	Heat gain, $Q = (2a \times 2b \times 2c) \times 2f \times (2e - 2d)$	0	BTUH

Step 3 Heat gain from Exterior Doors on North Side

a	Height of Exterior Door	7	ft.
b	Width of Exterior Door	3	ft.
c	Number of exterior doors on north side	0	
d	Indoor Design Temperature	74	F
e	Outdoor Design Temperature	95	F
f	U-Value for Exterior Door	0.10	
g	Heat gain, $Q = (3a \times 3b \times 3c) \times 3f \times (3e - 3d)$	0	BTUH

Step 4 Heat gain from North Wall

a	Length of North wall	39.0	ft.
b	Height of North wall	9.0	ft.
c	Indoor Design Temperature	74	F
d	Outdoor Design Temperature	74	F
e	U-Value for North wall	0.071	
f	Heat gain, $Q = ((4ax4b)-(2a*2b*2c)-(3a*3b*3c)) \times 4e \times (4d - 4c)$	0	BTUH

Step 5 Heat gain from Windows on South Side

a	Height of Window	5.00	ft.
b	Width of Window	2.58	ft.
c	Number of windows on south side	8	
d	Indoor Design Temperature	74	F
e	Outdoor Design Temperature	95	F
f	U-Value for Window	0.50	
g	SHGC, Solar Heat Gain Coefficient	0.4	
h	Heat gain, $Q = ((5a \times 5b \times 5c) \times 5f \times (5e - 5d)) + (5ax5bx5cx5gx125)$	6,244	BTUH

Step 6 Heat gain from Exterior Doors on South Side

a	Height of Exterior Door	7	ft.
b	Width of Exterior Door	3	ft.
c	Number of exterior doors on south side	0	
d	Indoor Design Temperature	74	F
e	Outdoor Design Temperature	95	F
f	U-Value for Exterior Doors	0.10	
g	Heat gain, $Q = (6a \times 6b \times 6c) \times 6f \times (6e - 6d + 10)$	0	BTUH

Apartment Load Sizing: David F. Roche Apartments
Heat Gain Calculations 2-Bedroom

This analysis is for calculating the heat gain during the cooling season.

Step 7 Heat gain from South Wall

a	Length of South wall	39.0	ft.
b	Height of South wall	9.0	ft.
c	Indoor Design Temperature	74	F
d	Outdoor Design Temperature	95	F
e	U-Value for South wall	0.071	
f	Heat gain, $Q = ((7a \times 7b) - (5a \times 5b \times 5c) - (6a \times 6b \times 6c)) \times 7e \times (7d - 7c + 10)$	549	BTUH

Step 8 Heat gain from Windows on East Side

a	Height of Window	5.00	ft.
b	Width of Window	2.58	ft.
c	Number of windows on east side (1 window + 1 set of french doors)	0	
d	Indoor Design Temperature	74	F
e	Outdoor Design Temperature	74	F
f	U-Value for Window	0.50	
g	Heat gain, $Q = (8a \times 8b \times 8c) \times 8f \times (8e - 8d)$	0	BTUH

Step 9 Heat gain from Exterior Doors on East Side

a	Height of Exterior Door	7	ft.
b	Width of Exterior Door	3	ft.
c	Number of exterior doors on east side	0	
d	Indoor Design Temperature	74	F
e	Outdoor Design Temperature	95	F
f	U-Value for Exterior Doors	0.10	
g	Heat gain, $Q = (9a \times 9b \times 9c) \times 9f \times (9e - 9d)$	0	BTUH

Step 10 Heat gain from East Wall

a	Length of East wall	23.6	ft.
b	Height of East wall	9.0	ft.
c	Indoor Design Temperature	74	F
d	Outdoor Design Temperature	74	F
e	U-Value for East wall	0.071	
f	Heat gain, $Q = ((10a \times 10b) - (8a \times 8b \times 8c) - (9a \times 9b \times 9c)) \times 10e \times (10d - 10c)$	0	BTUH

Step 11 Heat gain from Windows on West Side

a	Height of Window	5.00	ft.
b	Width of Window	2.58	ft.
c	Number of windows on west side	0	
d	Indoor Design Temperature	74	F
e	Outdoor Design Temperature	95	F
f	U-Value for Window	0.50	
g	SHGC, Solar Heat Gain Coefficient	0.4	
h	Heat gain, $Q = ((11a \times 11b \times 11c) \times 11f \times (11e - 11d)) + (11a \times 11b \times 11c \times 11g \times 125)$	0	BTUH

Apartment Load Sizing: David F. Roche Apartments
Heat Gain Calculations 2-Bedroom

This analysis is for calculating the heat gain during the cooling season.

Step 12 Heat gain from Exterior Doors on West Side

a	Height of Exterior Door	7	ft.
b	Width of Exterior Door	3	ft.
c	Number of exterior doors on west side	0	
d	Indoor Design Temperature	74	F
e	Outdoor Design Temperature	95	F
f	U-Value for Exterior Doors	0.10	
g	Heat gain, $Q = (12a \times 12b \times 12c) \times 12f \times (12e - 12d + 10)$	0	BTUH

Step 13 Heat gain from West Wall

a	Length of West wall	23.6	ft.
b	Height of West wall	9.0	ft.
c	Indoor Design Temperature	74	F
d	Outdoor Design Temperature	95	F
e	U-Value for West wall	0.071	
f	Heat gain, $Q = ((13a \times 13b) - (11a \times 11b \times 11c) - (12a \times 12b \times 12c)) \times 13e \times (13d - 13c + 10)$	319	BTUH

Step 14 Heat gain from Roof

a	Length of Roof	39.0	ft.
b	Width of Roof	23.6	ft.
c	Slope Factor for Roof (1.0 for flat roofs, 1.20 for sloped roofs)	1.00	
d	Indoor Design Temperature	74	F
e	Outdoor Design Temperature	74	F
f	U-Value for Roof	0.067	
g	Heat gain, $Q = (14a \times 14b \times 14c) \times 14f \times (14e - 14d + 30)$	1,841	BTUH

Step 15 Heat gain from Ground Floor

a	Length of ground floor	39.0	ft.
b	Width of ground floor	23.6	ft.
c	Indoor Design Temperature	74	F
d	Outdoor Design Temperature	74	F
e	U-Value for ground floor	0.000	
f	Heat gain, $Q = (15a \times 15b) \times 15e \times (15d - 15c)$	0	BTUH

Step 16 Heat gain from Infiltration

a	Length of Building or Unit	39.0	ft.
b	Width of Building or Unit	23.6	ft.
c	Height of Building or Unit	9.0	
d	Indoor Design Temperature	74	F
e	Outdoor Design Temperature	95	F
f	ACH, Air Change Per Hour	1.0	
g	Enthalpy, H	10.0	
h	Heat gain, $Q = ((16a \times 16b \times 16c) / 60) \times 16f \times 4.5 \times 16g$	6,213	BTUH

Step 17 Heat gain from electrical heat

a	Kilowatt of continuous power (per hour)	1.0	kW
b	Heat gain, $Q = 3414 \times 17a$	3,414	BTUH

Apartment Load Sizing: David F. Roche Apartments
Heat Loss Calculations 2-Bedroom

This analysis is for calculating the heat loss during the winter heating season.

Step 1 Calculated total BTUH for heating equipment:

29084	BTUH
8.5	kW

Step 2 Heat loss from Windows on North Side

a	Height of Window	5.0	ft.
b	Width of Window	2.6	ft.
c	Number of windows on north side	0	
d	Indoor Design Temperature	76	F
e	Outdoor Design Temperature	0	F
f	U-Value for Window	0.50	
g	Heat Loss, $Q = (2a \times 2b \times 2c) \times 2f \times (2d - 2e)$	0	BTUH

Step 3 Heat loss from Exterior Doors on North Side

a	Height of Exterior Door	7.0	ft.
b	Width of Exterior Door	3.0	ft.
c	Number of exterior doors on north side	0	
d	Indoor Design Temperature	76	F
e	Outdoor Design Temperature	0	F
f	U-Value for Exterior Door	0.10	
g	Heat Loss, $Q = (3a \times 3b \times 3c) \times 3f \times (3d - 3e)$	0	BTUH

Step 4 Heat loss from North Wall

a	Length of North wall	39.0	ft.
b	Height of North wall	9.0	ft.
c	Indoor Design Temperature	76	F
d	Outdoor Design Temperature	76	F
e	U-Value for North wall	0.071	
f	Heat Loss, $Q = ((4a \times 4b) - (2a \times 2b \times 2c) - (3a \times 3b \times 3c)) \times 4e \times (4c - 4d)$	0	BTUH

Step 5 Heat loss from Windows on South Side

a	Height of Window	5.0	ft.
b	Width of Window	2.6	ft.
c	Number of windows on south side	8	
d	Indoor Design Temperature	76	F
e	Outdoor Design Temperature	0	F
f	U-Value for Window	0.50	
g	Heat Loss, $Q = (5a \times 5b \times 5c) \times 5f \times (5d - 5e)$	3,922	BTUH

Step 6 Heat loss from Exterior Doors on South Side

a	Height of Exterior Door	7.0	ft.
b	Width of Exterior Door	3.0	ft.
c	Number of exterior doors on south side	0	
d	Indoor Design Temperature	76	F
e	Outdoor Design Temperature	0	F
f	U-Value for Exterior Doors	0.10	
g	Heat Loss, $Q = (6a \times 6b \times 6c) \times 6f \times (6d - 6e)$	0	BTUH

Apartment Load Sizing:	David F. Roche Apartments
Heat Loss Calculations	2-Bedroom

This analysis is for calculating the heat loss during the winter heating season.

Step 7 Heat loss from South Wall

a	Length of South wall	39.0	ft.
b	Height of South wall	9.0	ft.
c	Indoor Design Temperature	76	F
d	Outdoor Design Temperature	0	F
e	U-Value for South wall	0.071	
f	Heat Loss, $Q = ((7a \times 7b) - (5a \times 5b \times 5c) - (6a \times 6b \times 6c)) \times 7e \times (7c - 7d)$	1,345	BTUH

Step 8 Heat loss from Windows on East Side

a	Height of Window	5.0	ft.
b	Width of Window	2.6	ft.
c	Number of windows on east side	0	
d	Indoor Design Temperature	76	F
e	Outdoor Design Temperature	76	F
f	U-Value for Window	0.50	
g	Heat Loss, $Q = (8a \times 8b \times 8c) \times 8f \times (8d - 8e)$	0	BTUH

Step 9 Heat loss from Exterior Doors on East Side

a	Height of Exterior Door	7.0	ft.
b	Width of Exterior Door	3.0	ft.
c	Number of exterior doors on east side	0	
d	Indoor Design Temperature	76	F
e	Outdoor Design Temperature	76	F
f	U-Value for Exterior Doors	0.10	
g	Heat Loss, $Q = (9a \times 9b \times 9c) \times 9f \times (9d - 9e)$	0	BTUH

Step 10 Heat loss from East Wall

a	Length of East wall	23.6	ft.
b	Height of East wall	9.0	ft.
c	Indoor Design Temperature	76	F
d	Outdoor Design Temperature	76	F
e	U-Value for East wall	0.071	
f	Heat Loss, $Q = ((10a \times 10b) - (8a \times 8b \times 8c) - (9a \times 9b \times 9c)) \times 10e \times (10c - 10d)$	0	BTUH

Step 11 Heat loss from Windows on West Side

a	Height of Window	5.0	ft.
b	Width of Window	2.6	ft.
c	Number of windows on west side	0	
d	Indoor Design Temperature	76	F
e	Outdoor Design Temperature	0	F
f	U-Value for Window	0.50	
g	Heat Loss, $Q = (11a \times 11b \times 11c) \times 11f \times (11d - 11e)$	0	BTUH

Apartment Load Sizing:	David F. Roche Apartments
Heat Loss Calculations	2-Bedroom

This analysis is for calculating the heat loss during the winter heating season.

Step 12 Heat loss from Exterior Doors on West Side

a	Height of Exterior Door	7.0	ft.
b	Width of Exterior Door	3.0	ft.
c	Number of exterior doors on west side	0	
d	Indoor Design Temperature	76	F
e	Outdoor Design Temperature	0	F
f	U-Value for Exterior Doors	0.10	
g	Heat Loss, $Q = (12a \times 12b \times 12c) \times 12f \times (12d - 12e)$	0	BTUH

Step 13 Heat loss from West Wall

a	Length of West wall	23.6	ft.
b	Height of West wall	9.0	ft.
c	Indoor Design Temperature	76	F
d	Outdoor Design Temperature	0	F
e	U-Value for West wall	0.071	
f	Heat Loss, $Q = ((13a \times 13b) - (11a \times 11b \times 11c) - (12a \times 12b \times 12c)) \times 13e \times (13c - 13d)$	1,153	BTUH

Step 14 Heat loss from Roof

a	Length of Roof	39.0	ft.
b	Width of Roof	23.6	ft.
c	Slope Factor for Roof (1.0 for flat roofs, 1.20 for sloped roofs)	1.00	
d	Indoor Design Temperature	76	F
e	Outdoor Design Temperature	76	F
f	U-Value for Roof	0.067	
g	Heat Loss, $Q = (14a \times 14b \times 14c) \times 14f \times (14d - 14e)$	0	BTUH

Step 15 Heat loss from Ground Floor

a	Length of ground floor	39.0	ft.
b	Width of ground floor	23.6	ft.
c	Indoor Design Temperature	76	F
d	Outdoor Design Temperature	68	F
e	U-Value for ground floor	0.000	
f	Heat Loss, $Q = (15a \times 15b) \times 15e \times (15c - 15d)$	0	BTUH

Step 16 Heat loss from Infiltration

a	Length of Building or Unit	39.0	ft.
b	Width of Building or Unit	23.6	ft.
c	Height of Building or Unit	9.0	
d	Indoor Design Temperature	76	F
e	Outdoor Design Temperature	0	F
f	ACH, Air Change Per Hour	2.0	
g	Heat Loss, $Q = ((16a \times 16b \times 16c) / 60) \times 16f \times 1.08 \times (16d - 16e)$	22,664	BTUH

Common Load Sizing: David F. Roche Apartments
Heat Gain Calculations Rental Office/Community Bldg

This analysis is for calculating the heat gain during the cooling season.

Step 1 Calculated total tonnage for cooling equipment:

0.8	Tons
9720	Btu/hr

Step 2 Heat gain from Windows on North Side

a	Height of Window	5.00	ft.
b	Width of Window	2.58	ft.
c	Number of windows on north side	0	
d	Indoor Design Temperature	74	F
e	Outdoor Design Temperature	95	F
f	U-Value for Window	0.50	
g	Heat gain, $Q = (2a \times 2b \times 2c) \times 2f \times (2e - 2d)$	0	BTUH

Step 3 Heat gain from Exterior Doors on North Side

a	Height of Exterior Door	7	ft.
b	Width of Exterior Door	3	ft.
c	Number of exterior doors on north side	0	
d	Indoor Design Temperature	74	F
e	Outdoor Design Temperature	95	F
f	U-Value for Exterior Door	0.10	
g	Heat gain, $Q = (3a \times 3b \times 3c) \times 3f \times (3e - 3d)$	0	BTUH

Step 4 Heat gain from North Wall

a	Length of North wall	0.0	ft.
b	Height of North wall	0.0	ft.
c	Indoor Design Temperature	74	F
d	Outdoor Design Temperature	95	F
e	U-Value for North wall	0.071	
f	Heat gain, $Q = ((4ax4b)-(2a*2b*2c)-(3a*3b*3c)) \times 4e \times (4d - 4c)$	0	BTUH

Step 5 Heat gain from Windows on South Side

a	Height of Window	5.00	ft.
b	Width of Window	2.58	ft.
c	Number of windows on south side	2	
d	Indoor Design Temperature	74	F
e	Outdoor Design Temperature	95	F
f	U-Value for Window	0.50	
g	SHGC, Solar Heat Gain Coefficient	0.6	
h	Heat gain, $Q = ((5a \times 5b \times 5c) \times 5f \times (5e - 5d)) + (5ax5bx5cx5gx125)$	2,206	BTUH

Step 6 Heat gain from Exterior Doors on South Side

a	Height of Exterior Door	7	ft.
b	Width of Exterior Door	3	ft.
c	Number of exterior doors on south side	0	
d	Indoor Design Temperature	74	F
e	Outdoor Design Temperature	95	F
f	U-Value for Exterior Doors	0.10	
g	Heat gain, $Q = (6a \times 6b \times 6c) \times 6f \times (6e - 6d+10)$	0	BTUH

Common Load Sizing: David F. Roche Apartments
Heat Gain Calculations Rental Office/Community Bldg

This analysis is for calculating the heat gain during the cooling season.

Step 7 Heat gain from South Wall

a	Length of South wall	0.0	ft.
b	Height of South wall	0.0	ft.
c	Indoor Design Temperature	74	F
d	Outdoor Design Temperature	95	F
e	U-Value for South wall	0.071	
f	Heat gain, $Q = ((7a \times 7b) - (5a \times 5b \times 5c) - (6a \times 6b \times 6c)) \times 7e \times (7d - 7c + 10)$	-57	BTUH

Step 8 Heat gain from Windows on East Side

a	Height of Window	5.00	ft.
b	Width of Window	2.58	ft.
c	Number of windows on east side	6	
d	Indoor Design Temperature	74	F
e	Outdoor Design Temperature	95	F
f	U-Value for Window	0.50	
g	Heat gain, $Q = (8a \times 8b \times 8c) \times 8f \times (8e - 8d)$	813	BTUH

Step 9 Heat gain from Exterior Doors on East Side

a	Height of Exterior Door	7	ft.
b	Width of Exterior Door	3	ft.
c	Number of exterior doors on east side	1	
d	Indoor Design Temperature	74	F
e	Outdoor Design Temperature	95	F
f	U-Value for Exterior Doors	0.10	
g	Heat gain, $Q = (9a \times 9b \times 9c) \times 9f \times (9e - 9d)$	44	BTUH

Step 10 Heat gain from East Wall

a	Length of East wall	0.0	ft.
b	Height of East wall	0.0	ft.
c	Indoor Design Temperature	74	F
d	Outdoor Design Temperature	95	F
e	U-Value for East wall	0.071	
f	Heat gain, $Q = ((10a \times 10b) - (8a \times 8b \times 8c) - (9a \times 9b \times 9c)) \times 10e \times (10d - 10c)$	-148	BTUH

Step 11 Heat gain from Windows on West Side

a	Height of Window	5.00	ft.
b	Width of Window	2.58	ft.
c	Number of windows on west side	0	
d	Indoor Design Temperature	74	F
e	Outdoor Design Temperature	95	F
f	U-Value for Window	0.50	
g	SHGC, Solar Heat Gain Coefficient	0.0	
h	Heat gain, $Q = ((11a \times 11b \times 11c) \times 11f \times (11e - 11d)) + (11a \times 11b \times 11c \times 11g \times 125)$	0	BTUH

Common Load Sizing: David F. Roche Apartments
Heat Gain Calculations Rental Office/Community Bldg

This analysis is for calculating the heat gain during the cooling season.

Step 12 Heat gain from Exterior Doors on West Side

a	Height of Exterior Door	7	ft.
b	Width of Exterior Door	3	ft.
c	Number of exterior doors on west side	1	
d	Indoor Design Temperature	74	F
e	Outdoor Design Temperature	95	F
f	U-Value for Exterior Doors	0.10	
g	Heat gain, $Q = (12a \times 12b \times 12c) \times 12f \times (12e - 12d + 10)$	65	BTUH

Step 13 Heat gain from West Wall

a	Length of West wall	0.0	ft.
b	Height of West wall	0.0	ft.
c	Indoor Design Temperature	74	F
d	Outdoor Design Temperature	95	F
e	U-Value for West wall	0.071	
f	Heat gain, $Q = ((13a \times 13b) - (11a \times 11b \times 11c) - (12a \times 12b \times 12c)) \times 13e \times (13d - 13c + 10)$	-32	BTUH

Step 14 Heat gain from Roof

a	Length of Roof	0.0	ft.
b	Width of Roof	0.0	ft.
c	Slope Factor for Roof (1.0 for flat roofs, 1.20 for sloped roofs)	1.00	
d	Indoor Design Temperature	74	F
e	Outdoor Design Temperature	95	F
f	U-Value for Roof	0.067	
g	Heat gain, $Q = (14a \times 14b \times 14c) \times 14f \times (14e - 14d + 30)$	0	BTUH

Step 15 Heat gain from Ground Floor

a	Length of ground floor	0.0	ft.
b	Width of ground floor	0.0	ft.
c	Indoor Design Temperature	74	F
d	Outdoor Design Temperature	75	F
e	U-Value for ground floor	0.000	
f	Heat gain, $Q = (15a \times 15b) \times 15e \times (15d - 15c)$	0	BTUH

Step 16 Heat gain from Infiltration

a	Length of Building or Unit	0.0	ft.
b	Width of Building or Unit	0.0	ft.
c	Height of Building or Unit	0.0	
d	Indoor Design Temperature	74	F
e	Outdoor Design Temperature	95	F
f	ACH, Air Change Per Hour	1.0	
g	Enthalpy, H	10.0	
h	Heat gain, $Q = ((16a \times 16b \times 16c) / 60) \times 16f \times 4.5 \times 16g$	0	BTUH

Step 17 Heat gain from electrical heat

a	Kilowatt of continuous power (per hour)	2.0	kW
b	Heat gain, $Q = 3414 \times 17a$	6,828	BTUH

Common Load Sizing:	David F. Roche Apartments
Heat Loss Calculations	Rental Office/Community Bldg

This analysis is for calculating the heat loss during the winter heating season.

Step 1 Calculated total BTUH for heating equipment:

3407	BTUH
1.0	kW

Step 2 Heat loss from Windows on North Side

a	Height of Window	5.0	ft.
b	Width of Window	2.6	ft.
c	Number of windows on north side	0	
d	Indoor Design Temperature	76	F
e	Outdoor Design Temperature	0	F
f	U-Value for Window	0.50	
g	Heat Loss, $Q = (2a \times 2b \times 2c) \times 2f \times (2d - 2e)$	0	BTUH

Step 3 Heat loss from Exterior Doors on North Side

a	Height of Exterior Door	7.0	ft.
b	Width of Exterior Door	3.0	ft.
c	Number of exterior doors on north side	0	
d	Indoor Design Temperature	76	F
e	Outdoor Design Temperature	0	F
f	U-Value for Exterior Door	0.10	
g	Heat Loss, $Q = (3a \times 3b \times 3c) \times 3f \times (3d - 3e)$	0	BTUH

Step 4 Heat loss from North Wall

a	Length of North wall	0.0	ft.
b	Height of North wall	0.0	ft.
c	Indoor Design Temperature	76	F
d	Outdoor Design Temperature	0	F
e	U-Value for North wall	0.071	
f	Heat Loss, $Q = ((4a \times 4b) - (2a \times 2b \times 2c) - (3a \times 3b \times 3c)) \times 4e \times (4c - 4d)$	0	BTUH

Step 5 Heat loss from Windows on South Side

a	Height of Window	5.0	ft.
b	Width of Window	2.6	ft.
c	Number of windows on south side	2	
d	Indoor Design Temperature	76	F
e	Outdoor Design Temperature	0	F
f	U-Value for Window	0.50	
g	Heat Loss, $Q = (5a \times 5b \times 5c) \times 5f \times (5d - 5e)$	980	BTUH

Step 6 Heat loss from Exterior Doors on South Side

a	Height of Exterior Door	7.0	ft.
b	Width of Exterior Door	3.0	ft.
c	Number of exterior doors on south side	0	
d	Indoor Design Temperature	76	F
e	Outdoor Design Temperature	0	F
f	U-Value for Exterior Doors	0.10	
g	Heat Loss, $Q = (6a \times 6b \times 6c) \times 6f \times (6d - 6e)$	0	BTUH

Common Load Sizing:	David F. Roche Apartments
Heat Loss Calculations	Rental Office/Community Bldg

This analysis is for calculating the heat loss during the winter heating season.

Step 7 Heat loss from South Wall

a	Length of South wall	0.0	ft.
b	Height of South wall	0.0	ft.
c	Indoor Design Temperature	76	F
d	Outdoor Design Temperature	0	F
e	U-Value for South wall	0.071	
f	Heat Loss, $Q = ((7a \times 7b) - (5a \times 5b \times 5c) - (6a \times 6b \times 6c)) \times 7e \times (7c - 7d)$	-140	BTUH

Step 8 Heat loss from Windows on East Side

a	Height of Window	5.0	ft.
b	Width of Window	2.6	ft.
c	Number of windows on east side	6	
d	Indoor Design Temperature	76	F
e	Outdoor Design Temperature	0	F
f	U-Value for Window	0.50	
g	Heat Loss, $Q = (8a \times 8b \times 8c) \times 8f \times (8d - 8e)$	2,941	BTUH

Step 9 Heat loss from Exterior Doors on East Side

a	Height of Exterior Door	7.0	ft.
b	Width of Exterior Door	3.0	ft.
c	Number of exterior doors on east side	1	
d	Indoor Design Temperature	76	F
e	Outdoor Design Temperature	0	F
f	U-Value for Exterior Doors	0.10	
g	Heat Loss, $Q = (9a \times 9b \times 9c) \times 9f \times (9d - 9e)$	160	BTUH

Step 10 Heat loss from East Wall

a	Length of East wall	0.0	ft.
b	Height of East wall	0.0	ft.
c	Indoor Design Temperature	76	F
d	Outdoor Design Temperature	0	F
e	U-Value for East wall	0.071	
f	Heat Loss, $Q = ((10a \times 10b) - (8a \times 8b \times 8c) - (9a \times 9b \times 9c)) \times 10e \times (10c - 10d)$	-534	BTUH

Step 11 Heat loss from Windows on West Side

a	Height of Window	5.0	ft.
b	Width of Window	2.6	ft.
c	Number of windows on west side	0	
d	Indoor Design Temperature	76	F
e	Outdoor Design Temperature	0	F
f	U-Value for Window	0.50	
g	Heat Loss, $Q = (11a \times 11b \times 11c) \times 11f \times (11d - 11e)$	0	BTUH

Common Load Sizing:	David F. Roche Apartments
Heat Loss Calculations	Rental Office/Community Bldg

This analysis is for calculating the heat loss during the winter heating season.

Step 12 Heat loss from Exterior Doors on West Side

a	Height of Exterior Door	7.0	ft.
b	Width of Exterior Door	3.0	ft.
c	Number of exterior doors on west side	0	
d	Indoor Design Temperature	76	F
e	Outdoor Design Temperature	0	F
f	U-Value for Exterior Doors	0.10	
g	Heat Loss, $Q = (12a \times 12b \times 12c) \times 12f \times (12d - 12e)$	0	BTUH

Step 13 Heat loss from West Wall

a	Length of West wall	0.0	ft.
b	Height of West wall	0.0	ft.
c	Indoor Design Temperature	76	F
d	Outdoor Design Temperature	0	F
e	U-Value for West wall	0.071	
f	Heat Loss, $Q = ((13a \times 13b) - (11a \times 11b \times 11c) - (12a \times 12b \times 12c)) \times 13e \times (13c - 13d)$	0	BTUH

Step 14 Heat loss from Roof

a	Length of Roof	0.0	ft.
b	Width of Roof	0.0	ft.
c	Slope Factor for Roof (1.0 for flat roofs, 1.20 for sloped roofs)	1.00	
d	Indoor Design Temperature	76	F
e	Outdoor Design Temperature	0	F
f	U-Value for Roof	0.067	
g	Heat Loss, $Q = (14a \times 14b \times 14c) \times 14f \times (14d - 14e)$	0	BTUH


Step 15 Heat loss from Ground Floor

a	Length of ground floor	0.0	ft.
b	Width of ground floor	0.0	ft.
c	Indoor Design Temperature	76	F
d	Outdoor Design Temperature	68	F
e	U-Value for ground floor	0.000	
f	Heat Loss, $Q = (15a \times 15b) \times 15e \times (15c - 15d)$	0	BTUH


Step 16 Heat loss from Infiltration

a	Length of Building or Unit	0.0	ft.
b	Width of Building or Unit	0.0	ft.
c	Height of Building or Unit	0.0	
d	Indoor Design Temperature	76	F
e	Outdoor Design Temperature	0	F
f	ACH, Air Change Per Hour	1.0	
g	Heat Loss, $Q = ((16a \times 16b \times 16c) / 60) \times 16f \times 1.08 \times (16d - 16e)$	0	BTUH

APPENDIX E:
SUPPORTING DOCUMENTATION

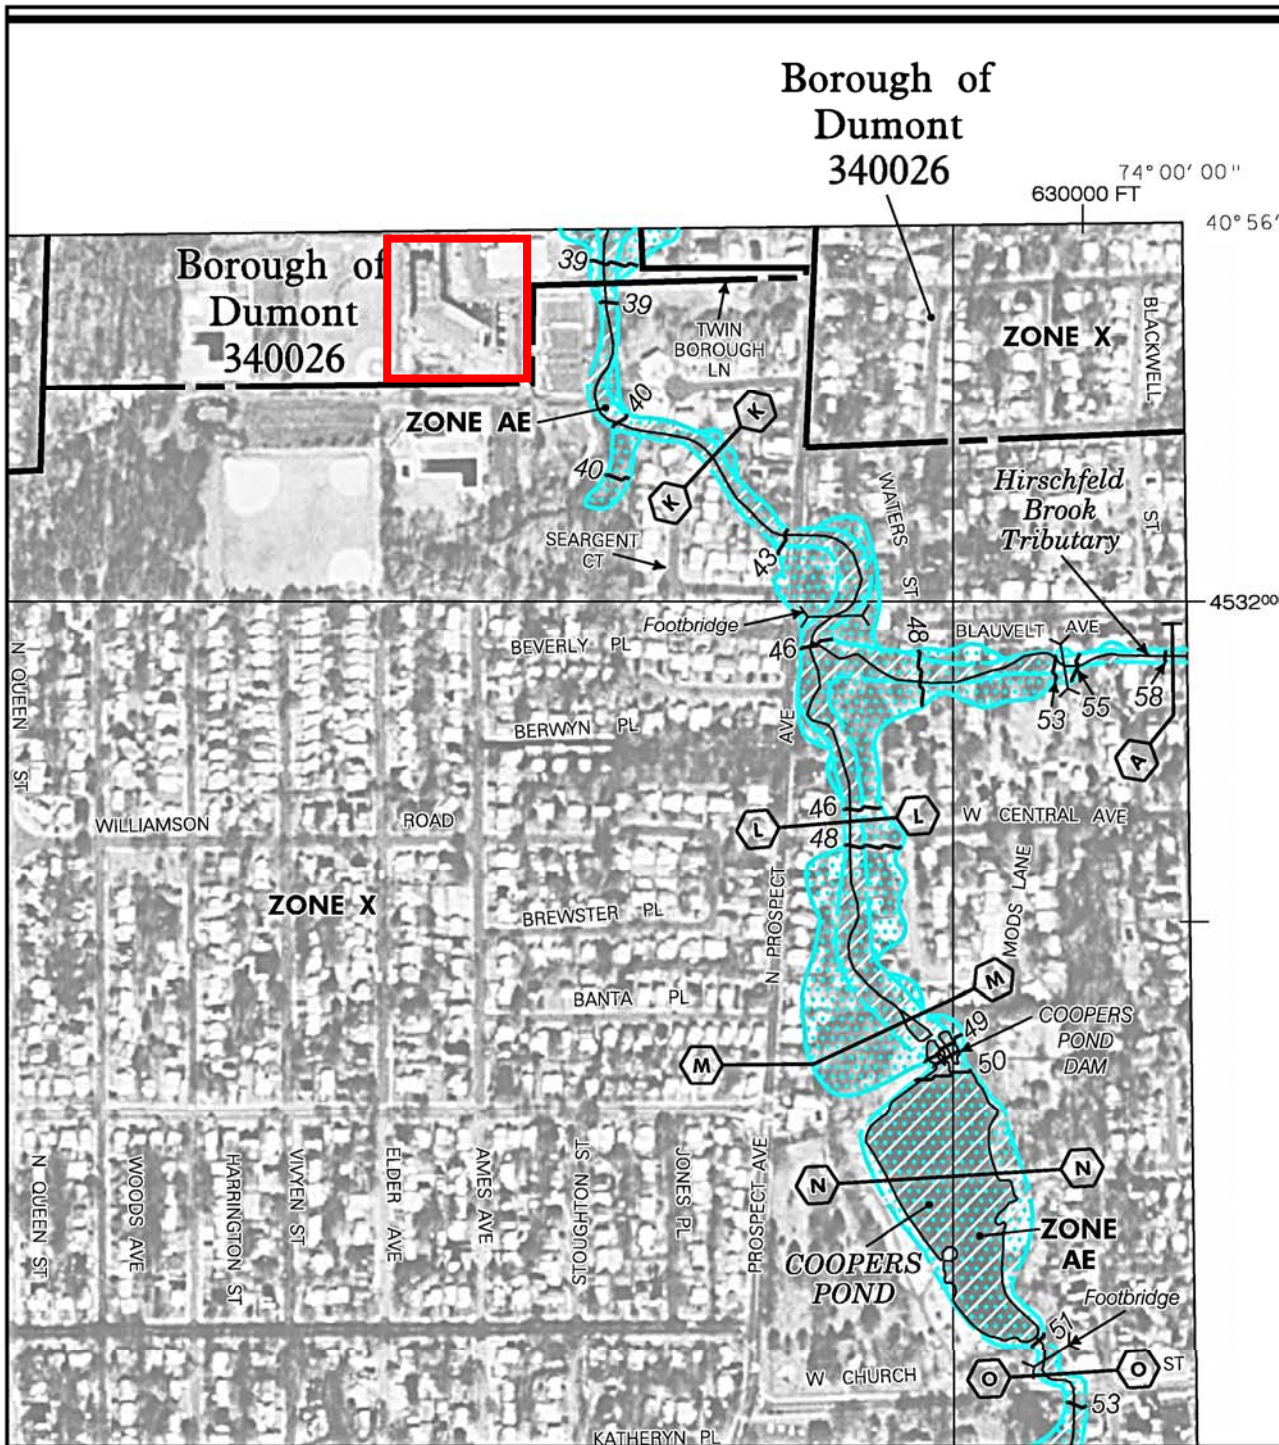

MAP SCALE 1" = 500'



NFIP

NATIONAL FLOOD INSURANCE PROGRAM

PANEL 0192 G

FIRM
FLOOD INSURANCE RATE MAP
BERGEN COUNTY,
NEW JERSEY
(ALL JURISDICTIONS)

PANEL 192 OF 332

(SEE MAP INDEX FOR FIRM PANEL LAYOUT)

CONTAINS:

COMMUNITY	NUMBER	PANEL	SUFFIX
BERGENFIELD, BOR OF	340020	0192	G
DUMONT, BOR OF	340026	0192	G
HACKENSACK, CITY OF	340039	0192	G
NEW MILFORD, BOR OF	340064	0192	G
RIVER EDGE, BOR OF	340068	0192	G
TEANECK, TWP OF	340075	0192	G

Notice to User: The **Map Number** shown below should be used when placing map orders; the **Community Number** shown above should be used on insurance applications for the subject community.



MAP NUMBER
34003C0192G

MAP REVISED
SEPTEMBER 30, 2005

Federal Emergency Management Agency

This is an official copy of a portion of the above referenced flood map. It was extracted using F-MIT On-Line. This map does not reflect changes or amendments which may have been made subsequent to the date on the title block. For the latest product information about National Flood Insurance Program flood maps check the FEMA Flood Map Store at www.msc.fema.gov

DOE Cool Roof Calculator

Estimates Cooling and Heating Savings for Flat Roofs with Non-Black Surfaces

- Developed by the U.S. Department of Energy's Oak Ridge National Laboratory (Version 1.2)
- This version of the calculator is for small and medium-sized facilities that purchase electricity without a demand charge based on peak monthly load. If you have a large facility that purchases electricity with a demand charge, run the [CoolCalcPeak](#) version in order to include the savings in peak demand charges from using solar radiation control.
- What you get out of this calculator is only as good as what you put in. If you [CLICK HERE](#), you'll find help in figuring out the best input values. Some things, such as the weathering of the solar radiation control properties and the effects of a plenum, are especially important. You'll also find help in figuring out your heating and cooling system efficiencies and proper fuel prices.
- To compare two non-black roofs, print out results of separate estimates for each vs. a black roof. Manually compute the difference in savings to compare the two non-black roofs.
- If your energy costs are determined by on-peak and off-peak rates, print out results of separate estimates with on-peak and off-peak rates for the same roof. Judge what fraction of the savings with on-peak rates is appropriate.

My State

New Jersey ▼

My City

Newark ▼

Click to see [Data for All 243 Locations](#)

My Proposed Roof:

R-value (HIGH=20; AVG=10; LOW=5) [$\text{h} \cdot \text{ft}^2 \cdot ^\circ\text{F}/\text{Btu}$]

10

Solar reflectance, SR (HIGH=80; AVG=50; LOW=10) [%]

26

Infrared emittance, IE (HIGH=90; AVG=60; LOW=10) [%]

92

My Energy Costs and Equipment Efficiencies

Summertime cost of electricity (HIGH=0.20; AVG=0.10; LOW=0.05) [$\$/\text{kWh}$]

.14

Air conditioner efficiency (Coefficient of Performance) (HIGH=2.5; AVG=2.0; LOW=1.5)

2

Energy source for heating (choose one)

☐ Electricity ☒ Fuel

If electricity, wintertime cost (HIGH=0.20; AVG=0.10; LOW=0.05) [$\$/\text{kWh}$]

If fuel, cost (Natural gas: HIGH=1.00; AVG=0.70; LOW=0.50) [$\$/\text{Therm}$]

(Fuel oil: 2002 East coast=0.85; 2002 Midwest=0.70) [$\$/\text{Therm}$]

.26

Heating system efficiency (Furnace or boiler: HIGH=0.8; AVG=0.7; LOW=0.5)

(Electric heat pump: HIGH=2.0; AVG=1.5) (Electric resistance: 1.0)

Calculate My Annual Savings Relative to a Black Roof

Net Savings [\$ / ft² per year]

Cooling savings [\$ / ft² per year]

Heating savings (heating penalty if negative) [\$ / ft² per year]

Insulation in Black Roof to Yield Same Annual Energy Savings:

Upgrade from R- to R- [h · ft² · °F / Btu]

Details of Comparison:

Heating degree days for location chosen [Annual °F-day]

Cooling degree days for location chosen [Annual °F-day]

Solar load for location chosen [Annual Average Btu / ft² per day]

Cooling load for black roof (SR=5%; IE=90%) [Btu / ft² per year]

Heating load for black roof (SR=5%; IE=90%) [Btu / ft² per year]

Cooling load for proposed roof [Btu / ft² per year]

Heating load for proposed roof [Btu / ft² per year]

DOE Cool Roof Calculator

Estimates Cooling and Heating Savings for Flat Roofs with Non-Black Surfaces

- Developed by the U.S. Department of Energy's Oak Ridge National Laboratory (Version 1.2)
- This version of the calculator is for small and medium-sized facilities that purchase electricity without a demand charge based on peak monthly load. If you have a large facility that purchases electricity with a demand charge, run the [CoolCalcPeak](#) version in order to include the savings in peak demand charges from using solar radiation control.
- What you get out of this calculator is only as good as what you put in. If you [CLICK HERE](#), you'll find help in figuring out the best input values. Some things, such as the weathering of the solar radiation control properties and the effects of a plenum, are especially important. You'll also find help in figuring out your heating and cooling system efficiencies and proper fuel prices.
- To compare two non-black roofs, print out results of separate estimates for each vs. a black roof. Manually compute the difference in savings to compare the two non-black roofs.
- If your energy costs are determined by on-peak and off-peak rates, print out results of separate estimates with on-peak and off-peak rates for the same roof. Judge what fraction of the savings with on-peak rates is appropriate.

My State

New Jersey ▼

My City

Newark ▼

Click to see [Data for All 243 Locations](#)

My Proposed Roof:

R-value (HIGH=20; AVG=10; LOW=5) [$\text{h} \cdot \text{ft}^2 \cdot ^\circ\text{F}/\text{Btu}$]

10

Solar reflectance, SR (HIGH=80; AVG=50; LOW=10) [%]

83

Infrared emittance, IE (HIGH=90; AVG=60; LOW=10) [%]

92

My Energy Costs and Equipment Efficiencies

Summertime cost of electricity (HIGH=0.20; AVG=0.10; LOW=0.05) [$\$/\text{kWh}$]

.14

Air conditioner efficiency (Coefficient of Performance) (HIGH=2.5; AVG=2.0; LOW=1.5)

2

Energy source for heating (choose one)

☐ Electricity ☒ Fuel

If electricity, wintertime cost (HIGH=0.20; AVG=0.10; LOW=0.05) [$\$/\text{kWh}$]

If fuel, cost (Natural gas: HIGH=1.00; AVG=0.70; LOW=0.50) [$\$/\text{Therm}$]

(Fuel oil: 2002 East coast=0.85; 2002 Midwest=0.70) [$\$/\text{Therm}$]

.26

Heating system efficiency (Furnace or boiler: HIGH=0.8; AVG=0.7; LOW=0.5)

(Electric heat pump: HIGH=2.0; AVG=1.5) (Electric resistance: 1.0)

Calculate My Annual Savings Relative to a Black Roof

Net Savings [\$ /ft² per year]

Cooling savings [\$ /ft² per year]

Heating savings (heating penalty if negative) [\$ /ft² per year]

Insulation in Black Roof to Yield Same Annual Energy Savings:

Upgrade from R- to R- [h·ft²·°F/Btu]

Details of Comparison:

Heating degree days for location chosen [Annual °F-day]

Cooling degree days for location chosen [Annual °F-day]

Solar load for location chosen [Annual Average Btu/ft² per day]

Cooling load for black roof (SR=5%; IE=90%) [Btu/ft² per year]

Heating load for black roof (SR=5%; IE=90%) [Btu/ft² per year]

Cooling load for proposed roof [Btu/ft² per year]

Heating load for proposed roof [Btu/ft² per year]



architects + engineers

119 Cherry Hill Road, Ste 200
Parsippany, NJ 07054

tel 862.207.5900
fax 973.334.0507

July 31, 2012

Mr. George Stavrou
Bergen County Housing Authority
25 Rockwood Place, Suite 205
Englewood, New Jersey 07631

Re: Proposal for Environmental Services
David F Roche Apartments
2 Aladdin Avenue
Dumont, Bergen County
LP 12-678

Dear Mr. Stavrou:

H2M Associates, Inc. (H2M) is pleased to provide the following proposal for environmental consulting services associated with the property located at 2 Aladdin Avenue in Dumont, Bergen County, New Jersey. It is understood that there is historic fill material present at the property which was identified during previous sampling activities. A summary of the previous investigation and the proposed activities is presented below.

1.0 Previous Investigations

A Preliminary Assessment (PA) was prepared by H2M Associates, Inc. (H2M) in May 2012 to identify areas of potential environmental concern associated with past and present uses of the property. The PA identified potential areas of environmental concern (AOCs) that warranted further investigation including historic fill and the former use of the property as a sewage treatment plant. Subsequently, the soil and groundwater investigation was conducted to characterize soil and groundwater at the property in the two AOCs identified during the PA.

In summary, the results of H2M's Site Investigation have confirmed that:

- Fill material consistent with "Historic Fill Material" as defined in NJAC 7:26E-1.8 has been identified along the southern, southwestern and southeastern portions of the site. Contaminants of potential concern detected in the fill above the NJDEP Residential Soil Remediation Standards include Lead, Benzo(a)anthracene, Benzo(a)pyrene, Benzo(b)fluoranthene, Indeno(1,2,3-cd) pyrene, and Chlordane. The historic fill is designated as AOC A.
- The same eight soil borings used to investigate AOC A were used to investigate AOC B – The Former Sewage Treatment Facility. There were no contaminants of concern, other than the compounds listed above associated with the historic fill material (AOC A) identified resulting from the former sewerage treatment facility operations. Therefore, no further action is warranted relating to AOC B.
- One temporary well point was installed to characterize groundwater at the property. Iron (total) was detected at a concentration in exceedance of the applicable NJ Groundwater Quality Standard. However, since the groundwater sample was turbid since it was unfiltered and collected from a temporary well, the results may not be

representative of actual groundwater concentrations. Resampling of the groundwater was recommended following the installation of a permanent monitoring well.

2.0 Scope of Work

2.1 Soils

The soil investigation at the subject property confirmed the presence of historic fill material located along the southern, southwestern and southeastern portions of the site. In order to determine the extent of the remedial action for the historic fill material, H2M recommends additional surficial soil sampling be performed along the eastern and northeastern portions of the subject property. This further delineation may be used to limit the areal extent of the remedial action required at the property.

In order to further delineate the surficial historic fill and potentially limit the area where remedial action is required, H2M proposes to collect additional soil samples. At a minimum, ten (10) surficial soil samples will be collected from the 0-6 inch interval below ground cover and submitted to a NJDEP certified laboratory for base neutral compounds, metals and pesticide analysis.

Soil for other analyses will be homogenized using a stainless steel trowel and mixing bowl, as required by the NJDEP August 2005 Field Sampling Procedures Manual (FSPM). Soil samples will be sent to a NJDEP certified laboratory for analysis.

2.2 Groundwater

It is recommended that one (1) permanent monitoring well be installed in the downgradient direction of SB-5 to confirm whether iron concentrations are elevated in site groundwater. The monitoring well will be constructed using the hollow stem auger drilling methodology and completed with a flush mount protective cover. Upon completion of the well installation, the well will be developed using either a submersible pump and/or block and surge techniques. During well development, initial depth to groundwater, well volume and depth to bottom before and after purging will be recorded. Well development will continue until either turbid free discharge or the evacuation of ten well volumes occurs.

Two weeks following the installation, the new well will be purged and sampled in accordance with the Technical Requirements for Site Remediation, N.J.A.C. 7:26E, et seq., as well as the August 2005 NJDEP Field Sampling Procedures Manual. Thirty days later, a second confirmatory sampling event will be completed. A static water level will be measured to the nearest hundredth (0.01) foot. Samples will be collected for filtered and unfiltered iron only since the results of the temporary well sampling indicated compliance of all other contaminants analyzed for. For QA/QC purposes a field blank sample will be included as part of the sampling event. The groundwater samples will be analyzed by a NJ-certified analytical laboratory. In addition, the field parameters of pH, conductivity, temperature, and dissolved oxygen will be

Mr. George Stavrou
Re: David F Roche Apartments
July 31, 2012
Page 3



measured prior to, during, and following purging and sampling of the groundwater monitoring well. Analytical data generated from these analyses will be provided in NJDEP Appendix A Reduced Deliverable hardcopy format and electronically in accordance with the requirements of NJDEP's *Electronic Data Interchange Handbook*.

The elevation and location of the newly installed monitoring wells will be surveyed by a licensed New Jersey Land Surveyor. The surveyor will generate Form B's for the wells as required by the NJDEP.

2.2.1 Decontamination and Management of Investigative Derived Waste

All downhole drilling, purging and sampling equipment will be decontaminated prior to arriving and leaving the site and between sampling locations in accordance with NJDEP field sampling procedure protocols. All investigative derived waste (e.g., soil cutting, purge water) generated as part of this investigation will be managed in accordance with the NJDEP Guidance Memorandum, *Disposition of Material Generated During Site Investigation*. Accordingly, if based on field observations and screening, obvious signs of contamination or elevated PID responses are observed, these materials will be staged on and covered by plastic or containerized in 55 gallon drums for subsequent waste characterization and off-site disposal. All drums will be labeled as to their contents, dated, and staged on-site until characterization sample results are received to coordinate disposal pickup.

For the purpose of this proposal, it is assumed that all of the investigative derived waste will be containerized in 55 gallon drums and staged in an area identified by the client pending characterization and subsequent disposal. It is assumed that two (2) non-hazardous drums of soil cuttings will be disposed of.

2.3 Reporting

At the conclusion of the ground water investigation, H2M will prepare a Remedial Investigation Report in accordance with Technical Requirements for Site Remediation, N.J.A.C. 7:26E, which will present and summarize the soil and ground water investigation, sampling data and provide recommendations for further action, if necessary.

3.0 Project Estimated Costs

This scope of work will be performed on a cost not to exceed \$15,200. Based on the scope of work presented above, H2M anticipates the following estimated costs:



Scope of Work	Estimated Cost
Monitoring well Installation and Survey	\$4,500.00
Soil and Groundwater Sampling & Analysis	\$9,300.00
Remedial Investigation Letter Report	\$1,400.00
Total Estimate Cost:	\$15,200.00

Note:
NO letter
report authorized
Cav.

The above costs are based on the assumption that H2M will have full access to the site and that the fieldwork will be completed in four days. The cost does not include any NJDEP oversight or filing fees.

Notes:

1. The cost estimate does not include the following items:
 - a. NJDEP review fees or permits, county filing fees, etc. These costs will be identified by H2M and paid directly by the client along with the submissions.
 - b. Federal, state or local taxes and/or permits
 - c. Contingency laboratory analysis.
 - d. Additional drilling costs beyond the scope of work.
 - e. Excessive Site Surveying Costs.

Neither H2M nor its subcontractor(s) will be responsible for utilities not identified by the One Call Service markout vendors or the owner. The price above assumes no interference from underground or overhead utilities.

As noted above, the estimated cost does not include the disposal of purge water or soil cuttings generated during permanent monitor well installation and sampling. An estimate for these services will be provided under separate cover, if necessary. It is estimated that the ground water monitoring well installation, development and sampling will take four (4) days to complete. If additional days are necessary for the drilling/sampling activities, the additional expenses and labor incurred will be billed out on a time and materials basis, plus a 10% administrative markup on all direct expenses (e.g. subcontractor costs). While the costs of drums for containment of the investigative derived wastes and characterization of the material are included in the identified cost, the costs associated with the disposal of the soil have not been included and will be identified once the disposal facility has been selected.

Any work performed outside the scope of this proposal will be billed on a time and materials basis in accordance with H2M's hourly rates of compensation pursuant to our Standard Proposal Statement. And direct expenses incurred by H2M will be billed out at cost with a 10% administrative markup.

4.0 Schedule

Well installation will proceed within one week of receipt of the NJDEP well permit. The groundwater sampling will commence within two weeks following development of the newly installed well. Laboratory analytical reports will be received three (3) weeks following the sampling event.

Mr. George Stavrou
Re: David F Roche Apartments
July 31, 2012
Page 5




Billing shall be made by monthly invoice. Monthly invoices shall be payable in full within thirty (30) days of the invoice date. This proposal shall remain open for sixty (60) days from the date of this proposal. Extensions shall be made in writing only.

This proposal shall remain open for sixty (60) days from the date of this proposal. Extensions shall be made in writing only. If this proposal meets with your approval, kindly return a signed copy of this letter as your Notice to Proceed. Billing shall be made by monthly invoice. Monthly invoices shall be payable in full within thirty (30) days of the invoice date.

H2M welcomes the opportunity to provide you with our services. We thank you for the opportunity to submit this proposal and look forward to working with you. If you should have any questions or concerns regarding this proposal, please call Joanne Derby at (862) 207-5900 ext. 2248.

Very truly Yours,
H2M ASSOCIATES, INC.


Joanne Derby, P.G.
Senior Geologist


Sui Y. Leong, P.E., LEED AP, LSRP
Vice President

AGREED AND ACCEPTED: *see note in section 3.0*
pg. 4.



Signature

GEORGE STAVROU

Name Printed

PURCHASING / CONTRACT PROCUREMENT

Title COORDINATOR

8.7.12

Date

FIRE DEPARTMENT FOIA

To: Matt Banta
Dumont Fire Department
50 Washington Avenue
Dumont, New Jersey 07628

Date: March 4, 2014
Phone #: 201.387.5042

Re: David F. Roche Apartments
2 Aladdin Avenue
Dumont, New Jersey 07628

EMG Project No: 107534.14R-003.306

Project Manager: Jill Orlov

Dear Matt Banta:

EMG is an engineering firm currently conducting a property condition survey of the above-referenced property. As part of the due-diligence process, we are submitting this letter through the Freedom of Information Act to obtain information specific to the property. We request your assistance by providing us with the following information concerning the site and buildings:

1. Date of last fire department inspection ____/____/____
mo. day year
2. Are there any OUTSTANDING fire code violations? YES / NO
(circle one)
3. How often is the subject property inspected? annually, biennially, other
(circle one)

Responses may be faxed directly to our office, at (410) 785-6220, or mailed to our corporate offices:

EMG
Attn: Senior Engineering Consultant, Edward Beeghly
222 Schilling Circle, Suite 275
Hunt Valley, Maryland 21031

If **outstanding** violations are on file, please provide copies of the reports/citations. Please note the EMG Project Number and the Senior Engineering Consultant's name on all correspondence. If you need additional information to complete this request, please contact me at (800) 733-0660. Thank you for your prompt attention to this matter.

Sincerely,
Jill Orlov
Project Manager

APPENDIX F:
EMG ACCESSIBILITY CHECKLIST

EMG ACCESSIBILITY CHECKLIST

Property Name: David F. Roche Apartments

Date: March 4, 2014

Project Number: 107534.14R-003.306

EMG Accessibility Checklist						
UFAS/ADA Accessibility						
	Building History	Yes	No	N/A	Unk	Comments
1.	Has the management previously completed an accessibility review?				✓	
2.	Does an accessibility compliance plan exist for the property?		✓			
3.	Has the plan been reviewed/approved by outside agencies (engineering firms, building department, other agencies)?				✓	
4.	Have any accessibility related complaints been received in the past?		✓			
5.	Is the property Section 504 compliant?	✓				
	Building Access	Yes	No	N/A	Comments	
1.	Are there an adequate number (per regulation) of wheelchair accessible parking spaces available at the rental office (96" wide/ 60" aisle)	✓				
2.	Is there at least one wheelchair accessible van parking space (96" wide/ 96" aisle) for every 8 standard accessible spaces?	✓				
3.	Are accessible parking spaces located on the shortest accessible route of travel from an accessible building entrance?	✓				
4.	Does signage exist directing you to wheelchair accessible parking and an accessible building entrance?	✓				
5.	Is there a ramp from the parking to an accessible building entrance (1:12 slope or less)			✓		
6.	If the main entrance is inaccessible, are there alternate accessible entrances?			✓		
7.	Is the accessible entrance doorway at least 32" wide?	✓				

EMG Accessibility Checklist					
	Building Access	Yes	No	N/A	Comments
8.	Is the door handle easy to open? (lever/push type knob, no twisting required, no higher than 48" above floor)	√			
9.	Are entry doors other than revolving doors available?	√			
	Rental office	Yes	No	N/A	Comments
1.	Is the entry door to the rental office 3' wide with no step or threshold over ½" tall?	√			
2.	Is there a counter or table at 30" high for wheelchair access to fill out a rental application?	√			
3.	Is there clearance behind the counter for an employee in a wheelchair?	√			
	Building Corridors and Elevators	Yes	No	N/A	Comments
1.	Is the path of travel free of obstructions and wide enough for a wheelchair (at least 60" wide)?	√			
2.	Are floor surfaces firm, stable and slip resistant (carpets wheelchair friendly)?	√			
3.	Do obstacles (phones, fountains, etc.) protrude no more than 4" into walkways or corridor?	√			
4.	Are elevator controls low enough to be reached from a wheelchair (48" front approach/54" side approach)?	√			
5.	Are there raised elevator markings in Braille and standard alphabet for the blind?	√			
6.	Are there audible signals inside cars indicating floor changes?	√			
7.	Do elevator lobbies have visual and audible indicators of the cars arrival?	√			
8.	Does the elevator interior provide sufficient wheelchair turning area (51" x 68" minimum)?		√		50"x68"
9.	Is at least one wheelchair accessible public phone available?			√	
10.	Are wheelchair accessible facilities (restrooms, exits, etc.) identified with signage?	√			

EMG Accessibility Checklist					
	Common Area Restrooms	Yes	No	N/A	Comments
1.	Are common area public restrooms located on an accessible route?	√			
2.	Are pull handles push/pull or lever type?	√			
3.	Are access doors wheelchair accessible (at least 32" wide)?	√			
4.	Are public restrooms large enough for wheelchair turnaround (60" turning diameter)?	√			
5.	Are stall doors wheelchair accessible (at least 32" wide)?	√			
6.	If stalls are too narrow can the toilet room be converted to a single occupant toilet room?			√	
7.	Are grab bars provided in toilet stalls (33"-36" above floor)?	√			
8.	Do sinks provide clearance for a wheelchair to roll under (29" clearance)?	√			
9.	Are sink handles operable with one hand without grasping, pinching or twisting?	√			
10.	Are exposed pipes under sink sufficiently insulated against contact?	√			
11.	Are soap dispensers, towel, etc. reachable (48" from floor for frontal approach, 54" for side approach)?	√			
12.	Is the base of the mirror no more than 40" off floor?	√			
	Common Area Kitchen	Yes	No	N/A	Comments
1.	In a "U"-shaped kitchen is there 60" clear floor space width?			√	
2.	In a "U"-shaped kitchen with base cabinet removed from beneath sink, is there a minimum of 40" width?			√	
3.	In an "L"-shaped kitchen, is there a 40" width minimum maintained?	√			
4.	Are countertops a maximum of 24" deep and 36" high?	√			
5.	Knee space beneath cabinetry is 30" wide and 27" high.	√			
6.	Is insulation installed below sinks on piping?	√			

EMG Accessibility Checklist					
	Common Area Kitchen	Yes	No	N/A	Comments
7.	Are adaptable units equipped with removable or retractable cabinetry fronts beneath sink or stove?			√	
	Common Area Laundry rooms	Yes	No	N/A	Comments
1.	Are the laundry rooms located on an accessible route?	√			
2.	Are the door handles push/pull or lever type?	√			
3.	Are the access doors wheelchair accessible (at least 32" clear width)?	√			
4.	Are laundry rooms large enough for wheelchair turnaround (60" turning diameter)?	√			
5.	Is there a front load washing machine	√			
6.	If clothes folding tables are provided is one section at 32" high with a clear area below the table?	√			
Fair Housing Accessibility / Section 504					
	Access to Unit	Yes	No	N/A	Comments
1.	Property management reports that the number of units currently accessible and those adaptable meet FHA requirements of all ground floor units or 100% for a high rise.	√			
2.	Are 5% of the units fully accessible to those individuals with mobility impairments and 2% of units accessible to those individuals with audio / visual impairments?	√			
3.	Are there any barriers or structural restrictions preventing access to the building?		√		
4.	Are the accessible units on an accessible route?	√			
5.	Is the apartment entry corridor 36" wide, door 32" wide (frame to frame), threshold height less than ½", and appropriate door hardware present?	√			
	Unit Living Space	Yes	No	N/A	Comments
1.	Is there access throughout unit?	√			
2.	Are electrical outlets 15" minimum above floor minimum?	√			

EMG Accessibility Checklist					
	Unit Living Space	Yes	No	N/A	Comments
3.	Are environmental controls and switches 48" maximum above floor or lower?	√			
	Unit Bathroom	Yes	No	N/A	Comments
1.	Is entry door at least 32" wide frame-to-frame?	√			
2.	Are switches & outlets in accessible locations?	√			
3.	Are bathroom walls around the toilet and tub/shower reinforced?	√			
4.	Is there a 30" x 48" clear floor space outside of door swing area?	√			
5.	Is there a 56" x 48" clear floor space in front of toilet (48" out from wall toilet is hung against)?		√		36"x48" ok
6.	Is there a 30" x 48" clear floor space in front of lavatories (30" deep from front of counter)?	√			
7.	Is there a 30" x 48" clear floor space in front of tub/shower (30" out from tub/shower)?	√			
8.	Is vanity a maximum of 24" deep and 36" high?	√			
9.	Knee space beneath sink is 30" wide and 27" high.	√			
10.	Is shower stall 36"x 42" minimum with small lip?	√			
11.	Is insulation installed below sinks on piping?	√			
	Unit Kitchen	Yes	No	N/A	Comments
1.	In a "U"-shaped kitchen is there 60" clear floor space width?	√			
2.	In a "U"-shaped kitchen with base cabinet removed from beneath sink, is there a minimum of 40" width?	√			
3.	In an "L"-shaped kitchen, is there a 40" width minimum maintained?			√	
4.	Are countertops a maximum of 24" deep and 36" high?	√			
5.	Knee space beneath cabinetry is 30" wide and 27" high.	√			
6.	Is insulation installed below sinks on piping?		√		Required in adaptable unit regardless of occupancy.

EMG Accessibility Checklist

	Unit Kitchen	Yes	No	N/A	Comments
7.	Are adaptable units equipped with removable or retractable cabinetry fronts beneath sink or stove?			√	

It is understood by the Client that the limited observation described herein does not comprise a full ADA Compliance Survey, and that such a survey is beyond the scope of EMG's Physical Condition Assessment. Only a representative sample of areas was observed and, other than as shown on the accessibility checklist, actual measurements were not taken to verify compliance.

ADAAG CRITERIA

Total Parking in Lot	Required Minimum Number of Accessible Spaces
1 to 25	1
26 to 50	2
51 to 75	3
76 to 100	4
101 to 150	5
151 to 200	6
201 to 300	7
301 to 400	8
401 to 500	9
501 to 1000	2% of total
1001 and over	20 plus 1 for each 100 over 1000

For further information or a copy of the Americans with Disabilities Act Accessibility Guidelines contact 1-800-949-4ADA

**APPENDIX G:
PRE-SURVEY QUESTIONNAIRES**



ENERGY AUDIT : PRE-SURVEY QUESTIONNAIRE

This questionnaire must be completed by the property owner, management point of contact or other person knowledgeable about the subject property.

The completed form must be presented to EMG's Field Observer on or before the site visit.

If the form is not completed, EMG's Project Manager will require additional time during the on-site visit in order to complete the questionnaire. During the site visit, EMG's Field Observer may ask for details associated with selected questions. This questionnaire will be utilized as an exhibit in EMG's final report.

Housing Authority: Bergen County	Address: 1 Bergen County Plaza, 2 nd Floor Hackensack, NJ 07601
Owner, if other than Authority:	Address:
Name of Subject Site: David F. Roche Apartments	Residential Buildings: 1 Common Buildings: Other Buildings:
Address: 2 Aladdin Ave	City, State, Zip: Dumont, NJ 07628
Building Manager: Vincent M. Bufis	Phone: (201) 206-9413
Maintenance Manager: Vincent M. Bufis	Phone: (201) 206-9413
Energy Management Coordinator	Phone
Building Description (circle all that apply) ☒ <u>Masonry</u> - Wood framed - Steel framed - Curtain wall Detached - Townhouse - Low-rise - ☒ <u>Mid-rise</u> - High-rise Basement - Crawl Space - Attic - ☒ <u>Flat Roof</u> - Slope Roof Number of: ___ Efficiencies ___98___ One BR ___1___ Two BR ___ Three BR ___ Four BR ___ Five BR ___ Six BR ___ SRO Date of original completion ___1981___ Dates of significant renovations ___2006 & 2011 & 2013___ Describe: Roof replacement & New boilers (heating and domestic hot water & Contaminated Soil Remediation	
Other uses on this site ___ Rental Office ___ Community Service Offices ☒ Common Laundry ☒ Common Meeting-Activity ☒ Common Kitchen Residential or Commercial ___ Daycare ___ Training Education ___ Gym Fitness Recreation ☒ Maintenance Storage ☒ Other, Specify: Gazebo, YMCA classes, TV room	
Anticipated Modifications or Changes In Use in the next 15 yrs: Carpet replacement, hallways & common area, new furniture lobby and tv room, replace generator	
Have there been previous Energy Audits or Retrofit Programs? ___Yes ___x___No Date _____ Agency _____ Scope _____ Are related Energy Audit or Retrofit documents available? Any additional Energy Investment Programs? _____	

Does the Institution Have an ongoing energy management program? ___Yes ___x_No

Utilities			
	Utility Supplier to the Site	Master Metered	Tenant Metered
Electric	PSE&G		X
Natural/LP Gas	PSE&G	X	
Fuel Oil	N/A		
Other _____			
Domestic Water		X	
Sewer			

- Utility data is required for the most recent available 12 month period. EMG can provide you with Excel form to assist you in supplying this data. Request this form from your Program Manager.
- Tenant paid data is required for best evaluation results. At minimum a representative sample of actual tenant consumption and cost is required for the 12 month period.

Tenant Utility Cost Paid By		
	Landlord or Housing Authority	Tenant
Heating	x	
Cooling		x
Domestic Hot Water	x	
Water Supply	x	
Sewer	x	

Unk = Unknown, NA = Not Applicable	Yes	No	Unk	NA	Comments
1. Does the boiler or furnaces seem to be oversized for the property (i.e. – cycles on and off often)?		x			
2. Do any of the gas fired boilers, furnaces, or water heaters have vent or flue dampers?		X			
3. Does the boiler have outdoor reset controls?			X		
4. Does the County pay for the tenant gas or oil consumption?			X		The Housing Authority pays the bill for the gas
5. Are low-flow faucet aerators and shower heads installed on all or most faucets and showers?	X				
6. Are the water closets low-flow (1.6 gpf)?		X			

Unk = Unknown, NA = Not Applicable	Yes	No	Unk	NA	Comments
7. Are the motors used for the elevators high-efficiency motors?			X		
8. Are the motors used for the ventilation systems (i.e. - air handlers, fan coils, etc.) high-efficiency motors?			X		
9. Are the motors used for the hydronic heating system (i.e. – pumps) high-efficiency motors?			X		
10. Are the motors used for the hydronic cooling system (i.e. – pumps, chillers, cooling tower fan) high-efficiency motors?			X		
11. Is there any uninsulated heating water, chilled water, or domestic hot water piping in unconditioned spaces such as mechanical rooms, basements, or storage areas?		X			
12. Is a booster pump required to maintain water pressure at the property?		X			
13. Are laundry room washing machines fixed to cold rinse only?		X			
14. Are there any wall or window leaks?		X			
15. Are there any poorly insulated areas?		X			
16. Do the utilities (electric, gas, sewer, water) provide adequate service?	X				
17. Are HVAC systems at the property inspected and maintained, at a minimum, annually?	X				
18. Is the HVAC equipment more than ten years old?		X			
19. Are the water heaters/boilers more than ten years old?		X			
20. Are there any leaks or pressure problems with natural gas service?		X			
21. Is the electrical service adequate?	X				
22. Are there any emergency electrical generators?	X				
23. Are there any large UPS battery systems?	X				
24. Are there any vacant buildings or significant building areas?		X			
25. Is there anything else that EMG should know about when assessing this property? If so, what?		x			



PROPERTY CONDITION ASSESSMENT: PRE-SURVEY QUESTIONNAIRE

This questionnaire must be completed by the property owner, the owner's designated representative, or someone knowledgeable about the subject property. **The completed form must be presented to EMG's Field Observer on the day of the site visit.** If the form is not completed, EMG's Project Manager will require **additional time** during the on-site visit with such a knowledgeable person in order to complete the questionnaire. During the site visit, EMG's Field Observer may ask for details associated with selected questions. This questionnaire will be utilized as an exhibit in EMG's final Property Condition Report.

Name of person completing questionnaire: Vincent M. Bufis

Association with property: Property Manager

Length of association with property: 2 Years – September 2011

Date Completed: January 21, 2014

Phone Number: 201 206 9413

Property Name: David F. Roche Apartments

EMG Project Number: _____

Directions: Please answer all questions to the best of your knowledge and in good faith. Please provide additional details in the Comments column, of add backup documentation for any Yes responses.

INSPECTIONS		DATE LAST INSPECTED	LIST ANY OUTSTANDING REPAIRS REQUIRED
1	Elevators	1/17/14	N/A
2	HVAC, Mechanical, Electric, Plumbing	1/14/14	Low water cutoff switch needs to be replaced
3	Life-Safety/Fire	01/8/14	Extinguishers are checked monthly and logged
4	Roofs	1/13/14	Inspected monthly
QUESTION		RESPONSE	
5	List any major capital improvement within the last three years.	4 heating boilers replaced, 2 hot water boilers replaced Soil contamination remediation project	
6	List any major capital expenditures planned for the next year.	Generator replacement	
7	What is the age of the roof(s)?	8 years	
8	What building systems (HVAC, roof, interior/exterior finishes, paving, etc.) are the responsibilities of the tenant to maintain and replace?	None of the building systems are the responsibility of the tenants to maintain and replace. They must pay their electric bill, keep their apartments in a neat manner, and, if they so choose, have up their cable provider through Verizon or Optimum	

Mark the column corresponding to the appropriate response. Please provide additional details in the Comments column, or backup documentation for any Yes responses. (NA indicates "Not Applicable", Unk indicates "Unknown")

QUESTION		RESPONSE				COMMENTS
		Y	N	Unk	NA	
9	Are there any unresolved building, fire, or zoning code issues?		x			
10	Are there any "down" or unusable units?		x			
11	Are there any problems with erosion, stormwater drainage or areas of paving that do not drain?		x			
12	Is the property served by a private water well?		x			
13	Is the property served by a private septic system or other waste treatment systems?		x			
14	Are there any problems with foundations or structures?		x			
15	Is there any water infiltration in basements or crawl spaces?		x			
16	Are there any wall, or window leaks?		x			
17	Are there any roof leaks?		x			
18	Is the roofing covered by a warranty or bond?			x		
19	Are there any poorly insulated areas?		x			
20	Is Fire Retardant Treated (FRT) plywood used?			x		
21	Is exterior insulation and finish system (EIFS) or a synthetic stucco finish used?		x			
22	Are there any problems with the utilities, such as inadequate capacities?		x			
23	Are there any problems with the landscape irrigation systems?		x			
24	Has a termite/wood boring insect inspection been performed within the last year?	x				
25	Do any of the HVAC systems use R-11, 12, or 22 refrigerants?			x		

Mark the column corresponding to the appropriate response. Please provide additional details in the Comments column, or backup documentation for any Yes responses. (NA indicates "Not Applicable", Unk indicates "Unknown")

QUESTION		RESPONSE				COMMENTS
		Y	N	Unk	NA	
26	Has any part of the property ever contained visible suspect mold growth?		x			
27	Is there a mold Operations and Maintenance Plan?		x			
28	Have there been indoor air quality or mold related complaints from tenants?		x			
29	Is polybutylene piping used?		x			
30	Are there any plumbing leaks or water pressure problems?		x			
31	Are there any leaks or pressure problems with natural gas service?		x			
32	Does any part of the electrical system use aluminum wiring?			x		
33	Do Residential units have a less than 60-Amp service?		x			
34	Do Commercial units have less than 200-Amp service?				x	
35	Are there any recalled fire sprinkler heads (Star, GEM, Central, Omega)?		X			
36	Is there any pending litigation concerning the property?		X			
37	Has the management previously completed an ADA review?			X		
38	Have any ADA improvements been made to the property?			X		
39	Does a Barrier Removal Plan exist for the property?			X		
40	Has the Barrier Removal Plan been approved by an arms-length third party?			X		
41	Has building ownership or management received any ADA related complaints?		X			
42	Does elevator equipment require upgrades to meet ADA standards?		X			

Mark the column corresponding to the appropriate response. Please provide additional details in the Comments column, or backup documentation for any Yes responses. (NA indicates "Not Applicable", Unk indicates "Unknown")						
QUESTION		RESPONSE				COMMENTS
		Y	N	Unk	NA	
43	Are there any problems with exterior lighting?		X			
44	Are there any other significant issues/hazards with the property?		X			
45	Are there any unresolved construction defects at the property?		X			

Vincent M. Bufis

January 21, 2014

Signature of person Interviewed or completing form

Date



PROPERTY CONDITION ASSESSMENT: PRE-SURVEY QUESTIONNAIRE

This questionnaire must be completed by the property owner, the owner's designated representative, or someone knowledgeable about the subject property. **The completed form must be presented to EMG's Field Observer on the day of the site visit.** If the form is not completed, EMG's Project Manager will require **additional time** during the on-site visit with such a knowledgeable person in order to complete the questionnaire. During the site visit, EMG's Field Observer may ask for details associated with selected questions. This questionnaire will be utilized as an exhibit in EMG's final Property Condition Report.

**Name of person completing
questionnaire:**

Vincent M. Bufis

Association with property:

Property Manager

Length of association with property:

2 Years – September 2011

Date Completed:

January 21, 2014

Phone Number:

201 206 9413

Property Name:

Mahwah Public Housing

EMG Project Number:

Directions: Please answer all questions to the best of your knowledge and in good faith. Please provide additional details in the Comments column, or add backup documentation for any Yes responses.

INSPECTIONS		DATE LAST INSPECTED	LIST ANY OUTSTANDING REPAIRS REQUIRED
1	Elevators	N/A	
2	HVAC, Mechanical, Electric, Plumbing	1/14/14 & 1/23/14	
3	Life-Safety/Fire	1/21/14	
4	Roofs	10/2013 (NEW)	
QUESTION			RESPONSE
5	List any major capital improvement within the last three years.		Roof replacement on all 10 buildings and sheds.
6	List any major capital expenditures planned for the next year.		
7	What is the age of the roof(s)?		Less than 1 year old
8	What building systems (HVAC, roof, interior/exterior finishes, paving, etc.) are the responsibilities of the tenant to maintain and replace?		None of the building systems are the responsibility of the tenants to maintain and replace. They must pay their electric and gas bill, keep their apartments in a neat manner, and, if they so choose, have up their cable installed and maintained.

Mark the column corresponding to the appropriate response. Please provide additional details in the Comments column, or backup documentation for any Yes responses. (NA indicates "Not Applicable", Unk indicates "Unknown")

QUESTION		RESPONSE				COMMENTS
		Y	N	Unk	NA	
9	Are there any unresolved building, fire, or zoning code issues?		x			
10	Are there any "down" or unusable units?		x			
11	Are there any problems with erosion, stormwater drainage or areas of paving that do not drain?		x			
12	Is the property served by a private water well?		x			
13	Is the property served by a private septic system or other waste treatment systems?		x			
14	Are there any problems with foundations or structures?		x			
15	Is there any water infiltration in basements or crawl spaces?		x			
16	Are there any wall, or window leaks?		x			
17	Are there any roof leaks?		x			
18	Is the roofing covered by a warranty or bond?	x				
19	Are there any poorly insulated areas?		x			
20	Is Fire Retardant Treated (FRT) plywood used?			x		
21	Is exterior insulation and finish system (EIFS) or a synthetic stucco finish used?		x			
22	Are there any problems with the utilities, such as inadequate capacities?		x			
23	Are there any problems with the landscape irrigation systems?	x				The sprinkler system needs repairs.
24	Has a termite/wood boring insect inspection been performed within the last year?			x		
25	Do any of the HVAC systems use R-11, 12, or 22 refrigerants?			x		

Mark the column corresponding to the appropriate response. Please provide additional details in the Comments column, or backup documentation for any Yes responses. (NA indicates "Not Applicable", Unk indicates "Unknown")

QUESTION		RESPONSE				COMMENTS
		Y	N	Unk	NA	
26	Has any part of the property ever contained visible suspect mold growth?	X				During our inspections a couple of the bathrooms start to early process of mold growth, because the tenant does not utilize the exhaust fan properly. We address this issue immediately, and are going to be installing a new switch that activates the light and exhaust fan together.
27	Is there a mold Operations and Maintenance Plan?		X			
28	Have there been indoor air quality or mold related complaints from tenants?		X			
29	Is polybutylene piping used?	x				The water to the second floor and in the crawl space is carried through polybutylene piping.
30	Are there any plumbing leaks or water pressure problems?		x			
31	Are there any leaks or pressure problems with natural gas service?		x			
32	Does any part of the electrical system use aluminum wiring?		x			
33	Do Residential units have a less than 60-Amp service?		x			
34	Do Commercial units have less than 200-Amp service?		x			
35	Are there any recalled fire sprinkler heads (Star, GEM, Central, Omega)?		x			
36	Is there any pending litigation concerning the property?		x			
37	Has the management previously completed an ADA review?			x		
38	Have any ADA improvements been made to the property?		x			
39	Does a Barrier Removal Plan exist for the property?		x			
40	Has the Barrier Removal Plan been approved by an arms-length third party?		x			
41	Has building ownership or management received any ADA related complaints?		x			
42	Does elevator equipment require upgrades to meet ADA standards?				x	

Mark the column corresponding to the appropriate response. Please provide additional details in the Comments column, or backup documentation for any Yes responses. (NA indicates "Not Applicable", Unk indicates "Unknown")						
QUESTION		RESPONSE				COMMENTS
		Y	N	Unk	NA	
43	Are there any problems with exterior lighting?		x			
44	Are there any other significant issues/hazards with the property?		x			
45	Are there any unresolved construction defects at the property?		x			

Vincent M. Bufis

January 28, 2014

Signature of person Interviewed or completing form

Date



ENERGY AUDIT : PRE-SURVEY QUESTIONNAIRE

This questionnaire must be completed by the property owner, management point of contact or other person knowledgeable about the subject property.

The completed form must be presented to EMG's Field Observer on or before the site visit.

If the form is not completed, EMG's Project Manager will require additional time during the on-site visit in order to complete the questionnaire. During the site visit, EMG's Field Observer may ask for details associated with selected questions. This questionnaire will be utilized as an exhibit in EMG's final report.

Housing Authority: Bergen County	Address: 1 Bergen County Plaza, 2 nd Floor Hackensack, NJ 07601
Owner, if other than Authority:	Address:
Name of Subject Site: Mahwah Public Housing	Residential Buildings: 9 Common Buildings: 1 Other Buildings:
Address: 1600 Ramapo Brae Lane	City, State, Zip: Mahwah, NJ 07430
Building Manager: Vincent M. Bufis	Phone (201) 206-9413
Maintenance Manage: Vincent M. Bufis	Phone (201) 206-9413
Energy Management Coordinator	Phone
Building Description (circle all that apply) Masonry <u>Wood framed</u> – Steel framed – Curtain wall Detached – <u>Townhouse</u> – Low-rise – Mid-rise – High-rise Basement – <u>Crawl Space</u> – <u>Attic</u> – Flat Roof – <u>Slope Roof</u> Number of: ___ Efficiencies ___ One BR <u>2</u> Two BR <u>52</u> Three BR ___ Four BR ___ Five BR ___ Six BR ___ SRO Date of original completion: 1989 _____ Dates of significant renovations: 2013 _____ Describe: Roof replacement all buildings Other uses on this site ___ Rental Office ___ Community Service Offices <u>x</u> ___ Common Laundry ___ Common Meeting-Activity ___ Common Kitchen ___ Residential or Commercial ___ Daycare ___ Training Education ___ Gym Fitness Recreation <u>x</u> ___ Maintenance Storage <u>x</u> ___ Other, Specify: 2 sheds, park, basketball court	
Anticipated Modifications or Changes In Use in the next 15 yrs: Playground renovation, basketball court upgrade/modification	
Have there been previous Energy Audits or Retrofit Programs? ___Yes ___No Date _____ Agency _____ Scope _____ Are related Energy Audit or Retrofit documents available? Any additional Energy Investment Programs? _____	
Does the Institution Have an ongoing energy management program? ___Yes ___No	

Utilities			
	Utility Supplier to the Site	Master Metered	Tenant Metered
Electric	Rockland Electric		X
Natural/LP Gas	PSE&G		X
Fuel Oil			
Other _____			
Domestic Water	Mahwah Water	X	
Sewer			

- Utility data is required for the most recent available 12 month period. EMG can provide you with Excel form to assist you in supplying this data. Request this form from your Program Manager.
- Tenant paid data is required for best evaluation results. At minimum a representative sample of actual tenant consumption and cost is required for the 12 month period.

Tenant Utility Cost Paid By		
	Landlord or Housing Authority	Tenant
Heating		X
Cooling		X
Domestic Hot Water	X	
Water Supply	X	
Sewer	X	

Unk = Unknown, NA = Not Applicable	Yes	No	Unk	NA	Comments
1. Does the boiler or furnaces seem to be oversized for the property (i.e. – cycles on and off often)?		x			
2. Do any of the gas fired boilers, furnaces, or water heaters have vent or flue dampers?		x			
3. Does the boiler have outdoor reset controls?		x			
4. Does the County pay for the tenant gas or oil consumption?		x			
5. Are low-flow faucet aerators and shower heads installed on all or most faucets and showers?	x				
6. Are the water closets low-flow (1.6 gpf)?			x		
7. Are the motors used for the elevators high-efficiency motors?				x	

Unk = Unknown, NA = Not Applicable	Yes	No	Unk	NA	Comments
8. Are the motors used for the ventilation systems (i.e. - air handlers, fan coils, etc.) high-efficiency motors?				x	
9. Are the motors used for the hydronic heating system (i.e. – pumps) high-efficiency motors?			x		
10. Are the motors used for the hydronic cooling system (i.e. – pumps, chillers, cooling tower fan) high-efficiency motors?				x	
11. Is there any uninsulated heating water, chilled water, or domestic hot water piping in unconditioned spaces such as mechanical rooms, basements, or storage areas?	x				
12. Is a booster pump required to maintain water pressure at the property?		x			
13. Are laundry room washing machines fixed to cold rinse only?		x			
14. Are there any wall or window leaks?		x			
15. Are there any poorly insulated areas?		x			
16. Do the utilities (electric, gas, sewer, water) provide adequate service?	x				
17. Are HVAC systems at the property inspected and maintained, at a minimum, annually?	x				
18. Is the HVAC equipment more than ten years old?	x				Each unit has their own wall hung boiler, storage tank, and wall sleeves for the tenant's provided air conditioners. Some of the items are over 10 yrs old.
19. Are the water heaters/boilers more than ten years old?	x				See above
20. Are there any leaks or pressure problems with natural gas service?		x			
21. Is the electrical service adequate?	x				
22. Are there any emergency electrical generators?		x			
23. Are there any large UPS battery systems?	x				For the community building there is an fire alarm panel that has battery backup

Unk = Unknown, NA = Not Applicable	Yes	No	Unk	NA	Comments
24. Are there any vacant buildings or significant building areas?		x			
25. Is there anything else that EMG should know about when assessing this property? If so, what?		x			



ENERGY AUDIT : PRE-SURVEY QUESTIONNAIRE

This questionnaire must be completed by the property owner, management point of contact or other person knowledgeable about the subject property.

The completed form must be presented to EMG's Field Observer on or before the site visit.

If the form is not completed, EMG's Project Manager will require additional time during the on-site visit in order to complete the questionnaire. During the site visit, EMG's Field Observer may ask for details associated with selected questions. This questionnaire will be utilized as an exhibit in EMG's final report.

Housing Authority: Bergen County	Address: 1 Bergen County Plaza, 2 nd Floor Hackensack, NJ 07601
Owner, if other than Authority:	Address:
Name of Subject Site: Lehmann Gardens	Residential Buildings: 2 Common Buildings: Other Buildings:
Address: 12-14 Sulak Lane	City, State, Zip: Park Ridge, NJ 07656
Building Manager : Vincent M. Bufis	Phone: (201) 206-9413
Maintenance Manager: Vincent M. Bufis	Phone: (201) 206-9413
Energy Management Coordinator:	Phone
Building Description (circle all that apply) Masonry <u>Wood framed</u> - Steel framed - Curtain wall Detached - Townhouse <u>Low-rise</u> - Mid-rise - High-rise Basement - Crawl Space <u>Attic</u> - Flat Roof <u>Slope Roof</u> Number of: ___ Efficiencies <u>31</u> One BR <u>5</u> Two BR ___ Three BR ___ Four BR ___ Five BR ___ Six BR ___ SRO Date of original completion: 1993 Dates of significant renovations: 4/16/13 New domestic hot water tank and boiler system. Describe:	
Other uses on this site ___ Rental Office ___ Community Service Offices <u>x</u> ___ Common Laundry ___ Common Meeting-Activity <u>x</u> ___ Common Kitchen ___ Residential or Commercial ___ Daycare ___ Training Education ___ Gym Fitness Recreation <u>x</u> ___ Maintenance Storage <u>x</u> ___ Other, Specify: Office, Sheds, Gazebo, Basketball hoop	
Anticipated Modifications or Changes In Use in the next 15 yrs: Roof replacement, driveway milling and resurfacing.	
Have there been previous Energy Audits or Retrofit Programs? ___Yes <u>X</u> No Date _____ Agency _____ Scope _____ Are related Energy Audit or Retrofit documents available? Any additional Energy Investment Programs? _____	

Does the Institution Have an ongoing energy management program? ___Yes _X_No

Utilities			
	Utility Supplier to the Site	Master Metered	Tenant Metered
Electric	Park Ridge Utilities		X
Natural/LP Gas	PSE&G	X	
Fuel Oil	Rachles/Michele's Oil Company Inc		
Other _____			
Domestic Water	Park Ridge Utilities	X	
Sewer	Park Ridge Utilities		

- Utility data is required for the most recent available 12 month period. EMG can provide you with Excel form to assist you in supplying this data. Request this form from your Program Manager.
- Tenant paid data is required for best evaluation results. At minimum a representative sample of actual tenant consumption and cost is required for the 12 month period.

Tenant Utility Cost Paid By		
	Landlord or Housing Authority	Tenant
Heating	x	
Cooling		x
Domestic Hot Water	x	
Water Supply	x	
Sewer	x	

Unk = Unknown NA = Not Applicable	Yes	No	Unk	NA	Comments
1. Does the boiler or furnaces seem to be oversized for the property (i.e. – cycles on and off often)?		X			
2. Do any of the gas fired boilers, furnaces, or water heaters have vent or flue dampers?		X			
3. Does the boiler have outdoor reset controls?	X				The heating boilers operate off of a temperature sensor on the side of the building.
4. Does the County pay for the tenant gas or oil consumption?			X		The gas is paid by the Housing Authority of Bergen County.
5. Are low-flow faucet aerators and shower heads installed on all or most faucets and showers?	X				

Unk = Unknown, NA = Not Applicable	Yes	No	Unk	NA	Comments
6. Are the water closets low-flow (1.6 gpf)?			X		
7. Are the motors used for the elevators high-efficiency motors?				X	
8. Are the motors used for the ventilation systems (i.e. - air handlers, fan coils, etc.) high-efficiency motors?			X		
9. Are the motors used for the hydronic heating system (i.e. - pumps) high-efficiency motors?			X		
10. Are the motors used for the hydronic cooling system (i.e. - pumps, chillers, cooling tower fan) high-efficiency motors?			X		
11. Is there any uninsulated heating water, chilled water, or domestic hot water piping in unconditioned spaces such as mechanical rooms, basements, or storage areas?		X			
12. Is a booster pump required to maintain water pressure at the property?		X			
13. Are laundry room washing machines fixed to cold rinse only?		X			
14. Are there any wall or window leaks?		X			
15. Are there any poorly insulated areas?		X			
16. Do the utilities (electric, gas, sewer, water) provide adequate service?	X				
17. Are HVAC systems at the property inspected and maintained, at a minimum, annually?	X				
18. Is the HVAC equipment more than ten years old?		X			Community room air handler system is, but not the boilers
19. Are the water heaters/boilers more than ten years old?		X			
20. Are there any leaks or pressure problems with natural gas service?		X			
21. Is the electrical service adequate?	X				
22. Are there any emergency electrical generators?	X				
23. Are there any large UPS battery systems?	X				

Unk = Unknown, NA = Not Applicable	Yes	No	Unk	NA	Comments
24. Are there any vacant buildings or significant building areas?		X			
25. Is there anything else that EMG should know about when assessing this property? If so, what?	X				Lehmann Gardens was developed to house those with physical disabilities. Therefore, most of the residents here are wheelchair bound. Some permanently confined other part time users. The apartments all have VCT tile throughout which is laid on top of the concrete sub floor.



PROPERTY CONDITION ASSESSMENT: PRE-SURVEY QUESTIONNAIRE

This questionnaire must be completed by the property owner, the owner's designated representative, or someone knowledgeable about the subject property. **The completed form must be presented to EMG's Field Observer on the day of the site visit.** If the form is not completed, EMG's Project Manager will require **additional time** during the on-site visit with such a knowledgeable person in order to complete the questionnaire. During the site visit, EMG's Field Observer may ask for details associated with selected questions. This questionnaire will be utilized as an exhibit in EMG's final Property Condition Report.

Name of person completing questionnaire: Vincent M. Bufis

Association with property: Property Manager

Length of association with property: 2 years – September 2011

Date Completed: January 2, 2014

Phone Number: (201) 206-9413

Property Name: Lehmann Gardens

EMG Project Number: _____

Directions: Please answer all questions to the best of your knowledge and in good faith. Please provide additional details in the Comments column, or add backup documentation for any Yes responses.

INSPECTIONS		DATE LAST INSPECTED	LIST ANY OUTSTANDING REPAIRS REQUIRED
1	Elevators	N/A	N/A – There are no elevators in this property.
2	HVAC, Mechanical, Electric, Plumbing	4/16/13	Heating in community room – Thermostat and air handler need repair.
3	Life-Safety/Fire	1/2/14 – inspected monthly	N/A – There are no outstanding repairs required at this time.
4	Roofs	11/2013	N/A – There are no outstanding repairs required at this time.
QUESTION		RESPONSE	
5	List any major capital improvement within the last three years.	Domestic Hot Water – Boiler and tank system replaced Bollard Lights – Replaced with new LED bollards Landscape of site – Removal of undesirable trees, bushes, vines, weeds, etc.	
6	List any major capital expenditures planned for the next year.	Landscape– Including adding new bushes, trees, and repairing parts of the lawn irrigation system.	
7	What is the age of the roof(s)?	11 years	
8	What building systems (HVAC, roof, interior/exterior finishes, paving, etc.) are the responsibilities of the tenant to maintain and replace?	None of the building systems are the responsibility of the tenants to maintain and replace. They must pay their electric bill, keep their apartments in a neat manner, and, if they so choose, have up their cable provider through Verizon or Optimum.	

Mark the column corresponding to the appropriate response. Please provide additional details in the Comments column, or backup documentation for any Yes responses. (NA indicates "Not Applicable", Unk indicates "Unknown")

QUESTION		RESPONSE				COMMENTS
		Y	N	Unk	NA	
9	Are there any unresolved building, fire, or zoning code issues?		X			
10	Are there any "down" or unusable units?		X			
11	Are there any problems with erosion, stormwater drainage or areas of paving that do not drain?	X				Some of the grass areas around the site need improved drainage. All paved areas drain properly.
12	Is the property served by a private water well?		X			
13	Is the property served by a private septic system or other waste treatment systems?		X			
14	Are there any problems with foundations or structures?		X			
15	Is there any water infiltration in basements or crawl spaces?		X			
16	Are there any wall, or window leaks?		X			
17	Are there any roof leaks?		X			
18	Is the roofing covered by a warranty or bond?			X		
19	Are there any poorly insulated areas?		X			
20	Is Fire Retardant Treated (FRT) plywood used?			X		
21	Is exterior insulation and finish system (EIFS) or a synthetic stucco finish used?		X			
22	Are there any problems with the utilities, such as inadequate capacities?		X			
23	Are there any problems with the landscape irrigation systems?	X				Some of the sprinklers need adjusting or replacing. Some of the lines are pinched and need replacing to provide more adequate water flow.
24	Has a termite/wood boring insect inspection been performed within the last year?		X			
25	Do any of the HVAC systems use R-11, 12, or 22 refrigerants?			X		

Mark the column corresponding to the appropriate response. Please provide additional details in the Comments column, or backup documentation for any Yes responses. (NA indicates "Not Applicable", Unk indicates "Unknown")

QUESTION		RESPONSE				COMMENTS
		Y	N	Unk	NA	
26	Has any part of the property ever contained visible suspect mold growth?		X			
27	Is there a mold Operations and Maintenance Plan?		X			
28	Have there been indoor air quality or mold related complaints from tenants?	X				The tenants have issues with the heating and air conditioning of the hallways. Being that there are only heaters located near the entry doors and no real circulation of air.
29	Is polybutylene piping used?		X			
30	Are there any plumbing leaks or water pressure problems?		X			
31	Are there any leaks or pressure problems with natural gas service?		X			
32	Does any part of the electrical system use aluminum wiring?		X			
33	Do Residential units have a less than 60-Amp service?		X			
34	Do Commercial units have less than 200-Amp service?				X	
35	Are there any recalled fire sprinkler heads (Star, GEM, Central, Omega)?		X			
36	Is there any pending litigation concerning the property?		X			
37	Has the management previously completed an ADA review?			X		
38	Have any ADA improvements been made to the property?		X			
39	Does a Barrier Removal Plan exist for the property?		X			
40	Has the Barrier Removal Plan been approved by an arms-length third party?		X			
41	Has building ownership or management received any ADA related complaints?		X			
42	Does elevator equipment require upgrades to meet ADA standards?				X	

Mark the column corresponding to the appropriate response. Please provide additional details in the Comments column, or backup documentation for any Yes responses. (NA indicates "Not Applicable", Unk indicates "Unknown")						
QUESTION		RESPONSE				COMMENTS
		Y	N	Unk	NA	
43	Are there any problems with exterior lighting?		X			
44	Are there any other significant issues/hazards with the property?		X			
45	Are there any unresolved construction defects at the property?		X			

Vincent M. Bufis

January 2, 2014

Signature of person Interviewed or completing form

Date



PROPERTY CONDITION ASSESSMENT: PRE-SURVEY QUESTIONNAIRE

This questionnaire must be completed by the property owner, the owner's designated representative, or someone knowledgeable about the subject property. **The completed form must be presented to EMG's Field Observer on the day of the site visit.** If the form is not completed, EMG's Project Manager will require **additional time** during the on-site visit with such a knowledgeable person in order to complete the questionnaire. During the site visit, EMG's Field Observer may ask for details associated with selected questions. This questionnaire will be utilized as an exhibit in EMG's final Property Condition Report.

Name of person completing
questionnaire:

Vincent M. Bufis

Association with property:

Property Manager

Length of association with property:

2 Years – September 2011

Date Completed:

January 28, 2014

Phone Number:

201 206 9413

Property Name:

Ramsey Public Housing

EMG Project Number:

Directions: Please answer all questions to the best of your knowledge and in good faith. Please provide additional details in the Comments column, or add backup documentation for any Yes responses.

INSPECTIONS		DATE LAST INSPECTED	LIST ANY OUTSTANDING REPAIRS REQUIRED
1	Elevators	N/A	
2	HVAC, Mechanical, Electric, Plumbing	1/23/14	
3	Life-Safety/Fire	1/23/14	
4	Roofs	1/23/14	
QUESTION		RESPONSE	
5	List any major capital improvement within the last three years.	4 roofs were re-constructed in latter part of 2013.	
6	List any major capital expenditures planned for the next year.		
7	What is the age of the roof(s)?	4 are less than 1 year old. The other 8 are original approximately 15 years old.	
8	What building systems (HVAC, roof, interior/exterior finishes, paving, etc.) are the responsibilities of the tenant to maintain and replace?	None of the building systems are the responsibility of the tenants to maintain and replace. They must pay their electric bill, keep their apartments in a neat manner, and, if they so choose, have up their cable provider through Verizon or Optimum	

Mark the column corresponding to the appropriate response. Please provide additional details in the Comments column, or backup documentation for any Yes responses. (NA indicates "Not Applicable", Unk indicates "Unknown")

QUESTION		RESPONSE				COMMENTS
		Y	N	Unk	NA	
9	Are there any unresolved building, fire, or zoning code issues?		x			
10	Are there any "down" or unusable units?		x			
11	Are there any problems with erosion, stormwater drainage or areas of paving that do not drain?		x			
12	Is the property served by a private water well?		x			
13	Is the property served by a private septic system or other waste treatment systems?		x			
14	Are there any problems with foundations or structures?		x			
15	Is there any water infiltration in basements or crawl spaces?		x			
16	Are there any wall, or window leaks?		x			
17	Are there any roof leaks?		x			
18	Is the roofing covered by a warranty or bond?	x				
19	Are there any poorly insulated areas?		x			
20	Is Fire Retardant Treated (FRT) plywood used?			x		
21	Is exterior insulation and finish system (EIFS) or a synthetic stucco finish used?		x			
22	Are there any problems with the utilities, such as inadequate capacities?		x			
23	Are there any problems with the landscape irrigation systems?		x			
24	Has a termite/wood boring insect inspection been performed within the last year?		x			
25	Do any of the HVAC systems use R-11, 12, or 22 refrigerants?			x		

Mark the column corresponding to the appropriate response. Please provide additional details in the Comments column, or backup documentation for any Yes responses. (NA indicates "Not Applicable", Unk indicates "Unknown")

QUESTION		RESPONSE				COMMENTS
		Y	N	Unk	NA	
26	Has any part of the property ever contained visible suspect mold growth?	x				Some of the units develop the onset of mold when the tenants do not utilize the exhaust fan in their bathroom. We remedy this problem immediately, and will be installing new switches that operate the light and fan together.
27	Is there a mold Operations and Maintenance Plan?		x			
28	Have there been indoor air quality or mold related complaints from tenants?		x			
29	Is polybutylene piping used?	x				The water to the second floor and in the crawl space is carried through polybutylene piping.
30	Are there any plumbing leaks or water pressure problems?		x			
31	Are there any leaks or pressure problems with natural gas service?		x			
32	Does any part of the electrical system use aluminum wiring?		X			
33	Do Residential units have a less than 60-Amp service?		X			
34	Do Commercial units have less than 200-Amp service?				x	
35	Are there any recalled fire sprinkler heads (Star, GEM, Central, Omega)?		X			
36	Is there any pending litigation concerning the property?		X			
37	Has the management previously completed an ADA review?		X			
38	Have any ADA improvements been made to the property?		X			
39	Does a Barrier Removal Plan exist for the property?			X		
40	Has the Barrier Removal Plan been approved by an arms-length third party?			X		
41	Has building ownership or management received any ADA related complaints?		X			
42	Does elevator equipment require upgrades to meet ADA standards?				X	

Mark the column corresponding to the appropriate response. Please provide additional details in the Comments column, or backup documentation for any Yes responses. (NA indicates "Not Applicable", Unk indicates "Unknown")						
QUESTION		RESPONSE				COMMENTS
		Y	N	Unk	NA	
43	Are there any problems with exterior lighting?		X			
44	Are there any other significant issues/hazards with the property?		X			
45	Are there any unresolved construction defects at the property?		X			

Vincent M. Bufis

January 28, 2014

Signature of person Interviewed or completing form

Date

PROPERTY CONDITION ASSESSMENT: DOCUMENT REQUEST

On the day of the site visit, provide EMG's Field Observer access to all of the available documents listed below. Provide copies if possible. Your timely compliance with this request is greatly appreciated.

- A site plan, preferably 8 1/2" X 11", which depicts the arrangement of buildings, roads, parking stalls, and other site features.
- Diagram floor plan of each floor level at 8 1/2" X 11" with room numbers.
- Any available construction documents (blueprints) for the original construction of the building or for any tenant improvement work or other recent construction work.
- For commercial properties, provide a tenant list which identifies the names of each tenant, vacant tenant units, the floor area of each tenant space, and the gross and net leasable area of the building(s).
- For apartment properties, provide a summary of the apartment unit types and apartment unit type quantities, including the floor area of each apartment unit as measured in square feet.
- For hotel or nursing home properties, provide a summary of the room types and room type quantities.
- Copies of Certificates of Occupancy, building permits, fire or health department inspection reports, elevator inspection certificates, roof or HVAC warranties, or any other similar, relevant documents.
- The names of the local utility companies which serve the property, including the water, sewer, electric, gas, and phone companies.
- The company name, phone number, and contact person of all outside vendors who serve the property, such as mechanical contractors, roof contractors, fire sprinkler or fire extinguisher testing contractors, and elevator contractors.
- A summary of recent (over the last 5 years) capital improvement work which describes the scope of the work and the estimated cost of the improvements. Executed contracts or proposals for improvements. Historical costs for repairs, improvements, and replacements.
- Records of system & material ages (roof, MEP, paving, finishes, and furnishings).
- Any brochures or marketing information.
- Appraisal, either current or previously prepared.
- Current occupancy percentage and typical turnover rate records (for commercial and apartment properties).
- Previous reports pertaining to the physical condition of property.
- ADA survey and status of improvements implemented.
- Current / pending litigation related to property condition.



ENERGY AUDIT : PRE-SURVEY QUESTIONNAIRE

This questionnaire must be completed by the property owner, management point of contact or other person knowledgeable about the subject property.

The completed form must be presented to EMG's Field Observer on or before the site visit.

If the form is not completed, EMG's Project Manager will require additional time during the on-site visit in order to complete the questionnaire. During the site visit, EMG's Field Observer may ask for details associated with selected questions. This questionnaire will be utilized as an exhibit in EMG's final report.

Housing Authority: Bergen County	Address: 1 Bergen County Plaza, 2 nd Floor Hackensack, NJ 07601
Owner, if other than Authority:	Address:
Name of Subject Site: Ramsey Public Housing	Residential Buildings: 9 Common Buildings: 1 Other Buildings:
Address: 800-900 DeSimone Court	City, State, Zip: Ramsey, NJ 07446
Building Manager: Vincent M. Bufis	Phone (201) 206-9413
Maintenance Manage: Vincent M. Bufis	Phone (201) 206-9413
Energy Management Coordinator	Phone
Building Description (circle all that apply) Masonry <u>Wood framed</u> – Steel framed – Curtain wall Detached – <u>Townhouse</u> – Low-rise – Mid-rise – High-rise Basement – <u>Crawl Space</u> – <u>Attic</u> – Flat Roof – <u>Slope Roof</u> Number of: ___ Efficiencies ___ One BR ___ Two BR ___12___ Three BR ___ Four BR ___ Five BR ___ Six BR ___ SRO Date of original completion: 1989 _____ Dates of significant renovations: 2013 _____ Describe: Roof replacement all buildings Other uses on this site ___ Rental Office ___ Community Service Offices ___ Common Laundry ___ Common Meeting-Activity ___ Common Kitchen Residential or Commercial ___ Daycare ___ Training Education ___ Gym Fitness Recreation ___ Maintenance Storage <u>x</u> Other, Specify: Shed, park,	
Anticipated Modifications or Changes In Use in the next 15 yrs: Playground renovation	
Have there been previous Energy Audits or Retrofit Programs? ___Yes <u>x</u> No Date _____ Agency _____ Scope _____ Are related Energy Audit or Retrofit documents available? Any additional Energy Investment Programs? _____	
Does the Institution Have an ongoing energy management program? ___Yes ___No	

Utilities			
	Utility Supplier to the Site	Master Metered	Tenant Metered
Electric	Rockland Electric		X
Natural/LP Gas	PSE&G		X
Fuel Oil			
Other _____			
Domestic Water	Mahwah Water	X	
Sewer			

- Utility data is required for the most recent available 12 month period. EMG can provide you with Excel form to assist you in supplying this data. Request this form from your Program Manager.
- Tenant paid data is required for best evaluation results. At minimum a representative sample of actual tenant consumption and cost is required for the 12 month period.

Tenant Utility Cost Paid By		
	Landlord or Housing Authority	Tenant
Heating		X
Cooling		X
Domestic Hot Water	X	
Water Supply	X	
Sewer	X	

Unk = Unknown, NA = Not Applicable	Yes	No	Unk	NA	Comments
1. Does the boiler or furnaces seem to be oversized for the property (i.e. – cycles on and off often)?		x			
2. Do any of the gas fired boilers, furnaces, or water heaters have vent or flue dampers?		x			
3. Does the boiler have outdoor reset controls?		x			
4. Does the County pay for the tenant gas or oil consumption?		x			
5. Are low-flow faucet aerators and shower heads installed on all or most faucets and showers?	x				
6. Are the water closets low-flow (1.6 gpf)?			x		
7. Are the motors used for the elevators high-efficiency motors?				x	
8. Are the motors used for the ventilation systems (i.e. - air handlers, fan coils,				x	

Unk = Unknown, NA = Not Applicable	Yes	No	Unk	NA	Comments
etc.) high-efficiency motors?					
9. Are the motors used for the hydronic heating system (i.e. – pumps) high-efficiency motors?			x		
10. Are the motors used for the hydronic cooling system (i.e. – pumps, chillers, cooling tower fan) high-efficiency motors?				x	
11. Is there any uninsulated heating water, chilled water, or domestic hot water piping in unconditioned spaces such as mechanical rooms, basements, or storage areas?	x				
12. Is a booster pump required to maintain water pressure at the property?		x			
13. Are laundry room washing machines fixed to cold rinse only?				x	
14. Are there any wall or window leaks?		x			
15. Are there any poorly insulated areas?		x			
16. Do the utilities (electric, gas, sewer, water) provide adequate service?	x				
17. Are HVAC systems at the property inspected and maintained, at a minimum, annually?	x				
18. Is the HVAC equipment more than ten years old	x				Each unit has their own wall hung boiler, storage tank, and wall sleeves for the tenant's provided air conditioners. Some of these are over 10 yrs old.
19. Are the water heaters/boilers more than ten years old?	x				See above
20. Are there any leaks or pressure problems with natural gas service?		x			
21. Is the electrical service adequate?	x				
22. Are there any emergency electrical generators?		x			
23. Are there any large UPS battery systems?		x			
24. Are there any vacant buildings or significant building areas?		x			
25. Is there anything else that EMG should know about when assessing this property? If so, what?		x			

APPENDIX H:

RESUMES

EMG RESUME

EDWARD BEEGHLY

Quality Assurance Manager

Education

- Pursuing Masters of Engineering in Project Management – UMD College Park
- Ohio Northern University; Bachelor of Science, Civil Engineering, May 1995
- Valley Forge Military College; Associate Degree in Business, May 1991

Project Experience

- **Charlottesville Department of Public Works, Charlottesville, NC –** Mr. Beeghly, as the Program Manager on this project, which includes the assessment of eight sites encompassing over 161,000 SF. Projects under this contract include office buildings, a county health center, a fire station, an historic center and an opera house. EMG was responsible for assisting the DPW in developing their capital facilities plan for major rehabilitation projects at these buildings. EMG performed ADA assessments, facility assessments, and completed cost estimates per the RS Means model, adjusted to the location of the projects. Mr. Beeghly was responsible for management of the assessment teams and technical review of deliverables.
- **Atlanta Housing Authority, Atlanta, GA –** Mr. Beeghly is serving as the Program Manager for this ADA and Section 504 Assessment. He is responsible for managing the EMG team, as well as technical oversight and facilitating communication between EMG and AHA. Mr. Beeghly's knowledge of multifamily housing will lead the team to provide ADA assessments. EMG will provide AHA with design solutions to bring each facility in compliance with UFAS, and HUD Section 504 standards.
- **MDSHA District 3, Greenbelt, MD (Chief of Engineering Systems)**
– Mr. Beeghly served as the Chief of Engineering. During this time he managed a staff of seven, including four project managers, two engineering technicians, and one administrative assistant. Their projects included 10 consulting contracts valued at \$12 million dollars. Additionally, he served as Program Manager for District 3's (Suburban Washington D.C.) system preservation programs. He was fiscally responsible for multiple programs valued upwards to \$90 million dollars. He tracked asset management performance goals, program budget, network condition, and public commitments in determining individual project scope and program priority.

Industry Tenure

- A/E: 1995
- EMG: October, 2006

Related Experience

Industry Experience

- Government
- Office
- Industrial
- Affordable/Multi-family Housing
- Healthcare
- Retail
- Hospitality

Active Licenses/Registration

- Engineer in Training – Maryland

Special Skills & Training

- Dean L. H Archer Senior Design Award (Ohio Northern University)
- Geometric Design
- Highway Materials
- Pavement Design
- Project Management

Memberships

- Association of State Highway Engineers

BRETT BYERS

Lead Technical Review, Project Manager, Senior Engineering Consultant

Education

- Associate of Science, Electrical Engineering, Tidewater Community College, 2003

Project Experience

HOUSING

- Massachusetts Department of Housing and Community Development** – Capital Needs Assessment for MDHCD, which consists of 252 local housing authorities and more than 3,300 housing units.
- Brandywine Apartments, Tullahoma, TN** – Capital needs assessment of this multifamily housing facility located in southern Tennessee in accordance with HUD requirements and protocols.
- Morristown Housing Authority, Morristown, TN** – Senior Engineering Consultant for HUD Green Physical Needs Assessments of public housing authority managed multi-family properties.
- Scottsboro Housing Authority, Scottsboro, AL** – Senior Engineering Consultant for HUD Rental Assistance Demonstration program conversion of multi-family properties managed by the housing authority.
- Winn Development, PA** – Senior Engineering Consultant on several Capital Needs Assessment projects to meet Pennsylvania Housing Finance Administration requirements for Low Income Housing Tax Credit financing.
- Stone Gate Apartments, Maynardville, TN** – Project Manager for Physical Needs Assessment of apartment community.

COMMERCIAL

- Citibank, New York City, NY** – Senior Engineering Consultant for Facility Condition Assessments of 16 bank branches in the greater NYC area.
- Opryland Hotel, Nashville, TN** – Property Condition Assessment of the four-million square foot premiere showcase property in the clients' resort hotel portfolio.
- Nursing Homes, Various Locations Nationwide and Canada** – Senior Engineering Consultant on portfolios of Senior

Industry Tenure

- A/E: 1992
- EMG: 2006

Related Experience

- Educational Facility Condition Assessment reports
- Utility System Infrastructure Condition Assessment Reports
- Historical Structure Condition Assessments
- Retail and Restaurant
- Office Portfolios
- Acute Care Hospitals

Industry Experience

- Government Facilities
- Hospitals and Health Care Facilities
- Office
- Housing/Multi-family
- K-12
- Hospitality
- Infrastructure
- Retail/Wholesale
- Commercial Garage
- Universities

Active Licenses/Registration

- EPA Transitional Refrigerant Recovery Certification, 1994

Special Skills & Training

- Water Treatment Plant Operation
- Wastewater Treatment Plant Operation
- ANSI 3.1 Senior Health Physics Technician

Regional Location

- Knoxville, TN

- ***Shady Grove and Washington Adventist Hospitals, Behavioral Health Hospitals*** – Senior Engineering Consultant for Facility Condition Assessments of Acute Care Hospitals, Behavioral Health Hospitals, and Physical Plants.
- ***Hendrick Automotive Properties Nationwide*** – Senior Engineering Consultant and Project manager for Physical Needs Assessments of properties owned or being purchased; including retail auto sales outlets, office buildings, and retail sales stores leased by other companies.

FEDERAL GOVERNMENT

- ***Bureau of Indian Affairs, Various Locations in Arizona, Oregon, and Washington States*** – FCAs at schools, offices, housing quarters, maintenance garages, and utility systems.
- ***Bureau of Indian Affairs, Muckleshoot Tribal School, Auburn, WA*** – FCA at 140,000 SF K-12 tribal school.
- ***Bureau of Indian Affairs, Cherokee Indian School, Cherokee, NC*** – FCA and Space Utilization Analysis at 400,000 SF high school.
- ***Bureau of Indian Affairs, Chemawa Indian School, Salem, OR*** – FCA and Space Utilization Analysis at 230,000 SF high school.
- ***Bureau of Indian Affairs, Nazlini Community School, Nazlini, AZ*** – FCA and Space Utilization Analysis at 57,000 SF middle school. FCA of fire station and quarters buildings.
- ***Bureau of Indian Affairs, Chinle Boarding School, Chinle, AZ*** – FCA and Space Utilization Analysis at 85,000 SF boarding school including FCA of 95 quarters buildings.
- ***Bureau of Indian Affairs, Laguna Elementary School, Laguna, New Mexico*** – FCA and Space Analysis at 80,000 SF elementary school along with administrative office buildings.
- ***Bureau of Indian Affairs, Tesuque Day School, Tesuque Pueblo, New Mexico*** – FCA and Space Analysis at 30,000 SF elementary school including administrative office buildings and classrooms.
- ***Bureau of Indian Affairs, Cheyenne River Agency, Marty, SD*** – client specified equipment inventory and condition assessment of office buildings, fire station, maintenance facilities, and a 40,000 square foot adult and juvenile detention center.
- ***Bureau of Indian Affairs, Cheyenne River Agency, Eagle Butte, SD*** – client specified equipment inventory and condition assessment of school buildings, dormitories, office buildings, and physical plant/maintenance facilities.
- ***US Department of Interior*** - Bureau of Land Management and the National Park Service. Field inspections and assessment reports for utility infrastructures (potable water treatment and distribution; wastewater collection, treatment, and discharge; medium and low voltage electrical supply and distribution) at The Presidio, Yosemite National Park, Grand Canyon National Park, Gateway National Recreation Area, Yellowstone National Park, Sequoia and Kings Canyon National Park, Big Bend National Park, and Lake Meredith National Recreation Area

EDUCATION

- ***University of New Mexico, Albuquerque, NM*** – Facility Condition Assessment of University campus buildings.
- ***Columbia State Community College, Columbia, TN*** – Senior Engineering Consultant for Facility Condition Assessment of the college campus.
- ***Texas Southern University, Houston, TX*** – Senior Engineering Consultant and lead reviewer for Facility Condition Assessments of the University campus buildings including dormitories and apartments.

- **University of the District of Columbia, Washington, D.C.** – Senior Engineering Consultant for Physical Needs Assessment of campus buildings and infrastructure, an in-depth roof survey, and a Phase I Environmental Site Assessment.
- **Alexandria City Public Schools, Alexandria, VA** – Senior Engineering Consultant for Physical Needs Assessment of the schools and support facilities for Alexandria City Public Schools.
- **Stafford County Public Schools, Stafford County, VA** – Physical Needs Assessment of 25 buildings, consisting of 2.9 million square feet of educational facilities.
- **Board of Education of Carroll County, MD;** – Facility Condition Assessment of 41 school buildings.

STATE GOVERNMENTS AND MUNICIPALITIES

- **Pennsylvania National Guard, Multiple PA Sites** – Lead reviewer and project manager on FCAs of 41 National Guard and Army Reserve Centers across the state.
- **City of Dallas, Dallas, TX** – FCA of over 700 City-owned buildings within the incorporated boundaries of the city. Building types included water treatment, waste water treatment, offices, city maintenance, stormwater pumping stations, fair grounds, and the city zoo.
- **County of San Diego, San Diego, CA** – Lead reviewer of FCAs for more than 800 County-owned buildings including offices, road maintenance stations, parks, housing, museums, and vehicle and equipment maintenance facilities.
- **Town of West Tisbury, MA** – Senior Engineering Consultant and Project Manager for Facility Condition Assessments of town-owned buildings.

PARKS

- **National Park Service, Washington, D.C** – Comprehensive condition assessment of the monuments, memorials, maintenance support facilities, park police substations, and historical structures in the National Capital Region Parks. The assessment included national icons such as the Washington Monument, Jefferson Memorial, Lincoln Memorial, FDR Memorial, and Ford's Theatre.
- **National Park Service, Death Valley, CA** – Comprehensive condition survey of single and multi family housing, park visitor centers, park maintenance and support facilities, utility infrastructure systems, and historical museum facilities such as Scotty's Castle.

ENERGY

- **Unicor – Federal Prison Industries, Northeast Locations** – ASHRAE Level I & II energy assessments of US Army Reserve Centers in NY, MD, VA, and other locations.
- **Housing Authority of Baltimore City, Baltimore, MD** – ASHRAE Level I and III energy assessments of high-rise, low-rise, and scattered site multi-family housing buildings.
- **Village of Winnetka, Winnetka, IL** – ASHRAE Level II energy assessments of the Villages' municipal buildings. Included a power generating station and water treatment/distribution facilities.
- **Oak Ridge National Laboratories, Oak Ridge, TN** – Level II energy assessment of office buildings and laboratories (second year of a 5-year rotating assessment schedule).
- **County of Sandoval, Bernalillo, NM** – Combined Level II energy and Facility Condition assessments of County-owned buildings.
- **City of Needham, Needham, MA** – Level II energy assessment of select facilities.

- ***Bristol Housing and Redevelopment Administration, Bristol, VA*** – Level I energy assessment and Physical Needs Assessment.
- ***Schuylkill County Housing Authority, Schuylkill County, PA*** – Level II energy assessment of multi-family buildings.
- Multiple other portfolios across a broad spectrum of client and building types.

KEVIN M. LANTRY, CEM

Lead Project Manager

Education

- Bachelor of Science, Mechanical Engineering - Purdue University School of Mechanical Engineering, 2003.

Project Experience

- **Indianapolis Housing Agency, Indianapolis, IN** – Lead Project Manager. Completed Physical Needs Assessments and Energy Assessments at 11 multifamily and senior living properties in the City of Indianapolis. Provided subsequent comprehensive update assessments for Tax Credit Rehabilitation purposes. Reports included life/safety concerns, deferred maintenance, capital planning, and ADA issues. Compiled capital plan into EMG's AssetCALC database software for client use.
- **Ann Arbor Housing Commission, Ann Arbor, MI** – Lead Project Manager. Completed Physical Needs Assessments and Energy Audits at 17 multifamily and senior living properties in the City of Ann Arbor. Compiled PNA Reports along with energy benchmarking, conservation measures, and financial calculations.
- **Housing Authority of the City of Paterson, Paterson, NJ** – Project Manager. Completed Energy Audits at office, residential, and recreational properties owned and operated by the Housing Authority of Paterson. Energy Audits included physical assessment, plan review, utility consumption analysis, and energy conservation recommendations.
- **Mark to Market Green PCAs; Various Locations** – Project Manager. Completed multiple Mark to Market Green PCAs per Housing and Urban Development (HUD) protocol. Reports included standard mark to market assessments with energy audits including ECMs and recommendations for sustainability.
- **Alan Bible Federal Building; Las Vegas, NV** – Project Manager. Completed a Level IV Building Engineering Report (BER) for the US Government General Services Administration. Evaluated the mechanical, plumbing, and elevator systems as part of the assessment team sent by EMG to analyze all building components.
- **First Energy Facility Assessments; Multiple Sites, PA** - Project Manager. Performed facility assessments on over forty sites in central and eastern Pennsylvania. Evaluated district offices, regional headquarters and maintenance facilities. Compiled results into Facility Condition Reports and AssetCALC software.

Industry Tenure

- A/E: 2001
- EMG: 2004

Related Experience

- GSA Assessment Team

Industry Experience

- Industrial
- Commercial
- Multi-family Residential
- Affordable Housing
- Condition Assessment
- Energy Auditing

Active Licenses/Registration

- Engineer in Training (EIT)
Indiana ET 31011662
- Association of Energy Engineers
Certified Energy Manager
CEM #16678

Special Skills & Training

- Certified Multifamily Building Analyst by Building Performance Institute (BPI)
- Training Program for Energy Managers by the Association of Energy Engineers (AEE)
- AutoCAD
- VFA.Facility Certified
- Cross Trained for Environmental Assessments

Memberships

- ASHRAE
- U.S. Green Building Council

Regional Location

- Indianapolis, Indiana



The Association of Energy Engineers
certifies that

Kevin M. Lantry

*has completed the prescribed standards for certification,
has demonstrated a high level of competence and ethical fitness
for energy management, and is hereby granted the title of*

CERTIFIED ENERGY MANAGER

Expiration Date:


December 31, 2014

CEM

16678




CEM Board Chairman


CEM Director