

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

South 1/4 Corner of Section 6 Township 102N Range 32W, 5th P.M.

STATE OF MINNESOTA, COUNTY OF MARTIN


At the corner location shown on the sketch:

On 11-14-85 found a Broken off cast iron monument, down 0.4'
DATE

left monument as found, lowered monument, removed monument (explain)

On _____ placed a _____
DATE

SKETCH OF REFERENCE TIES

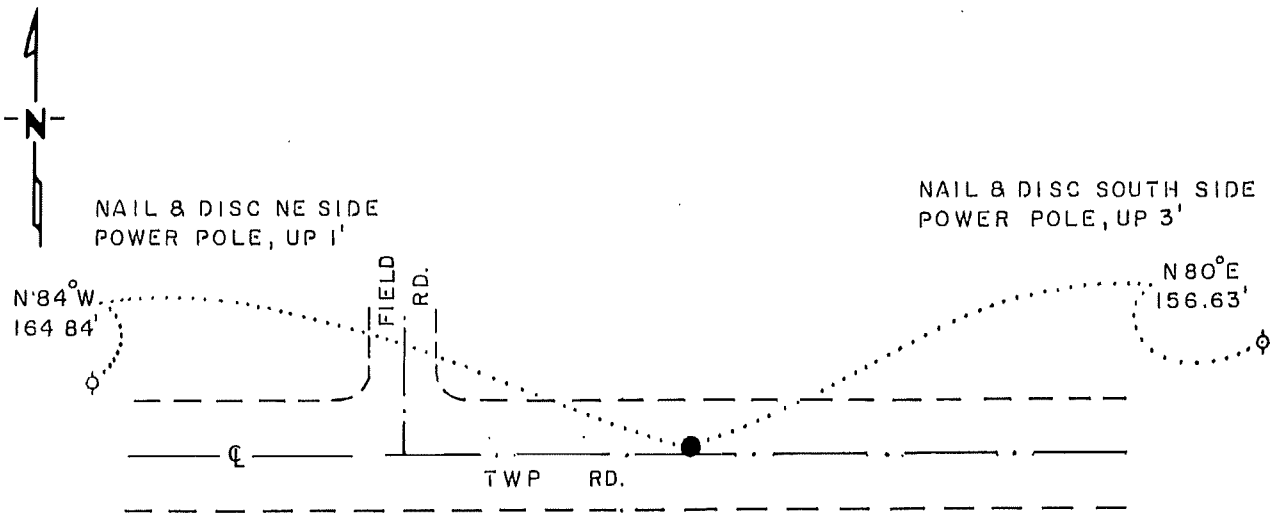

NOTE:
 MONUMENT IS
 2' NORTH OF ϕ E-W ROAD
 78' EAST OF ϕ FIELD ROAD NORTH
 TIES FIELD CHECKED 1-7-88

TIES & MONUMENT VERIFIED 1-7-88
 BEARINGS OVSERVED WITH COMPASS

Statement of evidence relative to this corner location is on back of page

J.B.M 8-13-87
 F - 539

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Laurel R. Pommeroy
SIGNATURE 1-22-88
DATE

Registration No. 17005

- Land Surveyor, Professional Engineer
 County Surveyor, County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the Co. Recorders office at _____ .M. on the _____ day of _____ A.D., 19 _____

County Recorder _____

By _____, Deputy

DOCUMENT NO. _____

North Quarter Corner Section 7, Township 102 North, Range 32 West

The DNR Bureau of Engineering contacted the following offices for survey information:

Secretary of State
Mn/DOT at St. Paul and Windom
Martin County Recorder
Martin County Highway Engineer
Bolton & Menk, Inc. at Fairmont

- 1857 U.S. General Land Office notes obtained from the Secretary of State's Office show set quarter section post, drove a charred stake, raised a mound of earth with trench and pits, planted plum stones north, south, east, and west.
- 1884 Survey Number 564 by L. F. Brainerd, County Surveyor, on Page 258 of Surveyor's Record Book A obtained from the County Recorder's Office shows that the post, mound and pits were renewed at this corner.
- 1893 Survey Number 162 by George E. Sawyer, Deputy County Surveyor, on Page 242 of Surveyor's Record Book B obtained from the County Recorder's Office shows this corner was established at the intersection of the north line of Section 7 (northwest corner to MC #26) and the north-south quarter line of Section 7 (south quarter corner and center of section). Corner was monumented with a broken crockery deposit down 28" and a 14" by 9" by 8" hardhead stone up 2" marked with a cross and 1/4. Corner is shown:
26.04-2/10 chains (1718.77 ft.) from MC #26
41.66-6/10 (2749.96 ft.) from the northwest corner Section 7
- 1896 Survey Number 163 by George E. Sawyer, Deputy County Surveyor, on Page 80½ of Surveyor's Record Book C obtained from the County Recorder's Office shows this corner was identified per Survey Number 162, dated 1893.
- 1964 A corner certificate book obtained from the County Highway Engineer's Office shows a stone with a cross at the corner 6" deep. Four ties are shown and a distance of 2647.5 ft. is shown from this corner to the center of Section 6.
- No Date The right-of-way map for Interstate 90, obtained from Mn/DOT, shows a stone with cross on top down 0.5 ft. at corner with four reference ties. Reference ties are the same shown on the 1964 County Engineer's corner certificate book.
- 1968 A tie page of field notes obtained from Bolton & Menk show the corner as an iron shaft in a crockery deposit 12" below surface. Three Minnesota Highway Department reference ties are shown to the corner. A certificate of survey prepared by Bolton & Menk shows this corner as found and identified.
- 1973 The above mentioned 1968 tie page has a note that states a stone was placed above shaft by other surveyors.
- 1978 A certificate of survey obtained from Bolton & Menk shows the corner as a found M.H.D. cast iron monument. Survey shows a distance of 2749.00 ft. from this corner to the northwest corner of Section 7.
- 1983 Plat Record Book N, on Page 59, obtained from the County Recorder's Office, contains a certificate of survey signed by Bruce Firkins, RLS #13309, of Bolton & Menk, Inc. Survey shows a symbol at the corner indicating a survey marker, found and identified.
- 1985 November 14, the DNR Bureau of Engineering found a broken off cast iron monument, down 0.4 ft. Probed under monument, but found nothing else. Searched for and found record ties as shown. Monument measures:
2749.15 ft. from the northwest corner Section 7
2647.46 ft. from the center of Section 6
2 ft. north of centerline east-west road
Contacted Mn/DOT office at Windom for further information on this corner. No record of this particular monument being set could be found.

Analysis of the available information led the DNR Bureau of Engineering to conclude that the found cast iron monument marks the location of the corner. Its position is in agreement with previous surveys.