

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

LAKE BELT
EAST 1/4

Corner of Section 23, Township 101N, Range 32W, 5th P.M.

STATE OF MINNESOTA, County of MARTIN

At the corner location shown on the sketch:

On 6-10-1994 found a STONE "+" 18" DEEP AND DRILLED HOLE IN STONE.
DATE

left monument as found, lowered monument, removed monument (explain)

On 6-10-1994 Placed a 5/8" x 30" IRON ROD WITH ALUM. CAP 4" DEEP.
DATE

SKETCH OF REFERENCE TIES




DETECTED METAL 33' EAST
AND WEST OF STONE,

B.C. IN P.P.

19.75

70.20

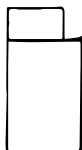

N.E. COR. HOUSE

MARTIN CO. 125 SIGN POST
45.27

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

SIGNATURE

DATE

Registration No. _____

- Land Surveyor, Professional Engineer
- County Surveyor, County Engineer

OFFICE OF THE REGISTER OF DEEDS

County of _____

I hereby certify that this document was filed in the Reg. of Deeds office at

_____, M. on the

____ day of _____, A.D., 19____

Register of Deeds _____

By _____, Deputy

DOCUMENT NO. _____

Statement of Evidence:

The corner was originally established during the public land survey which was completed in Lake Belt Township in 1857.

In April of 1900, George Sawyer, Deputy County Surveyor, identified the corner, recorded in County Surveyor's Book D, page 6.

In May of 1900, Goerge Sawyer, Deputy County Surveyor, identified the corner by 4 pit marks, deposited crockery (30" deep) and set grey granite 15" x 11" x 7" with "+" and $\frac{1}{4}$ " at surface, recorded in County Surveyor's Book D, page 6 $\frac{1}{2}$.

In the following plats the corner was identified as a stone monument: BLOCKS 13 & 14 AND OUTLOTS 11-12-13 & 14 TO THE TOWN OF TENHASSEN, BLOCKS 18 & 19 TO THE TOWN OF TENHASSEN, CARDWELLS ADDITION.

In October of 1901, Goerge Sawyer, Deputy County Surveyor, as recorded in County Surveyor's Book D, page 49, identified the corner.

In September of 1934, George Sawyer, County Surveyor, as recorded in County Surveyor's Book G, page 20, identified the corner now $\frac{1}{2}$ foot deep.

In April of 1950, Frank Jones, County Surveyor, as recorded in County Surveyor's Book I, page 517, identified corner as crockery deposit, stone had been removed, and replaced same with a reddish grey stone 4" x 10" x 12" with "+" over crockery (8" deep).

In 1959, the Martin County Highway Department identified the corner as stone "+" (15" deep) with iron pin over, remaining tie being: 19.55 N.W. SRP in P.P. (M.H.D.)

On 9/29/82, I found a 4" x 8" stone with "+" (15 " deep) with a 1" x 4" x 8" iron pin over stone "+" (5" deep).